

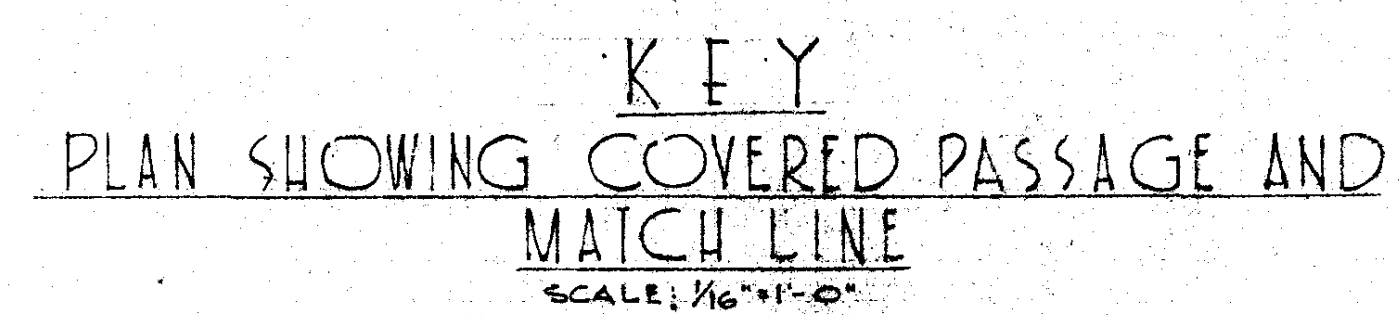
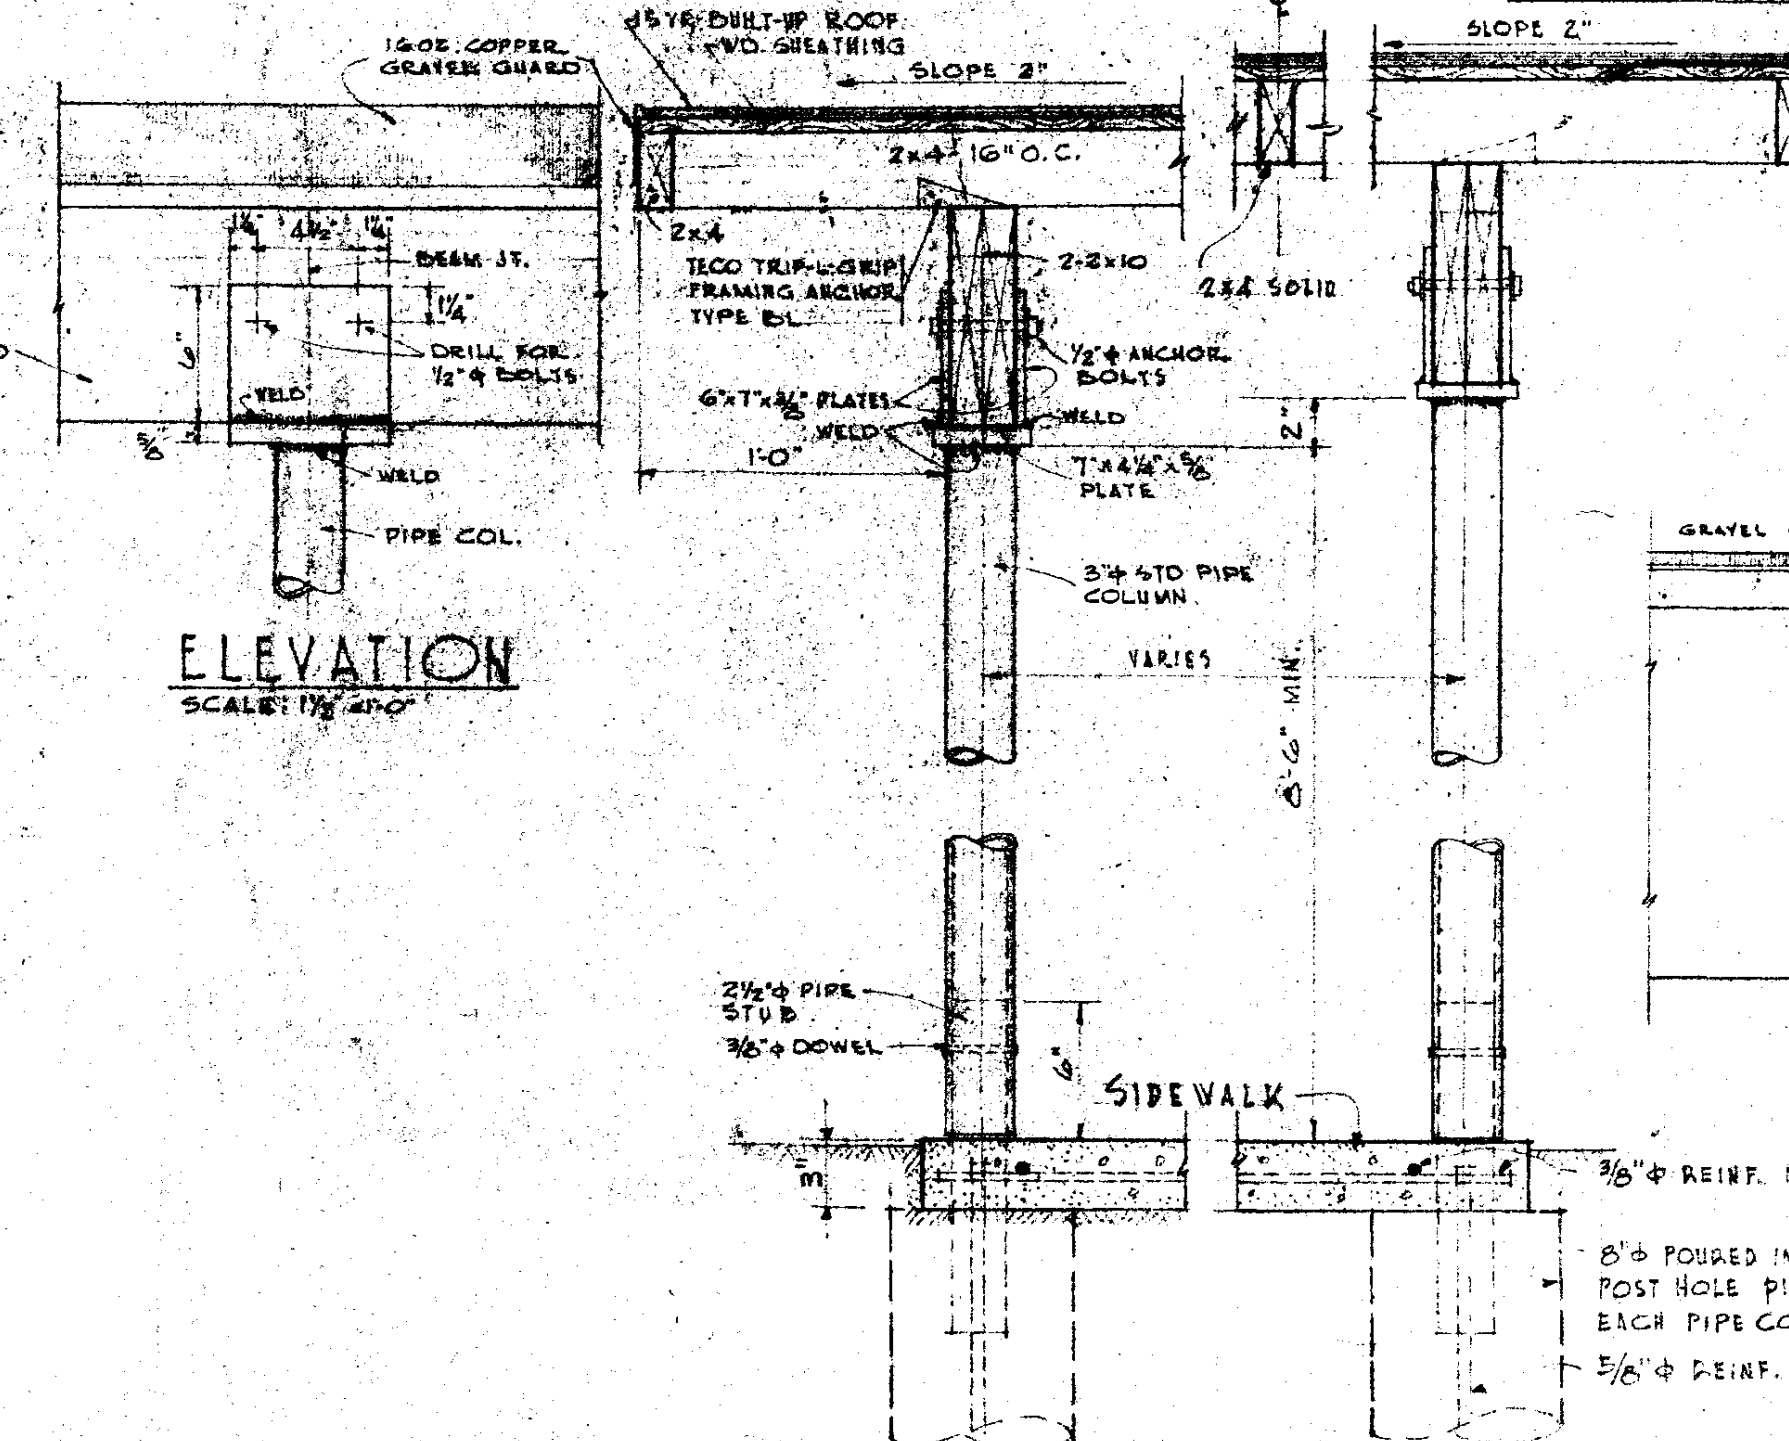
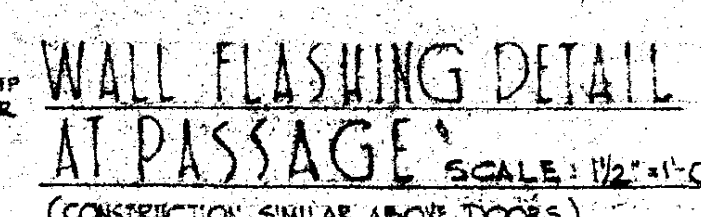
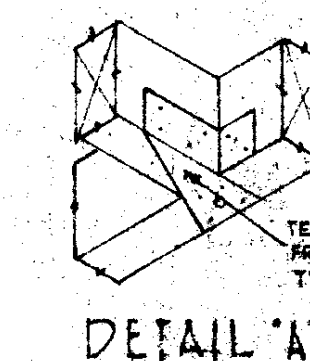
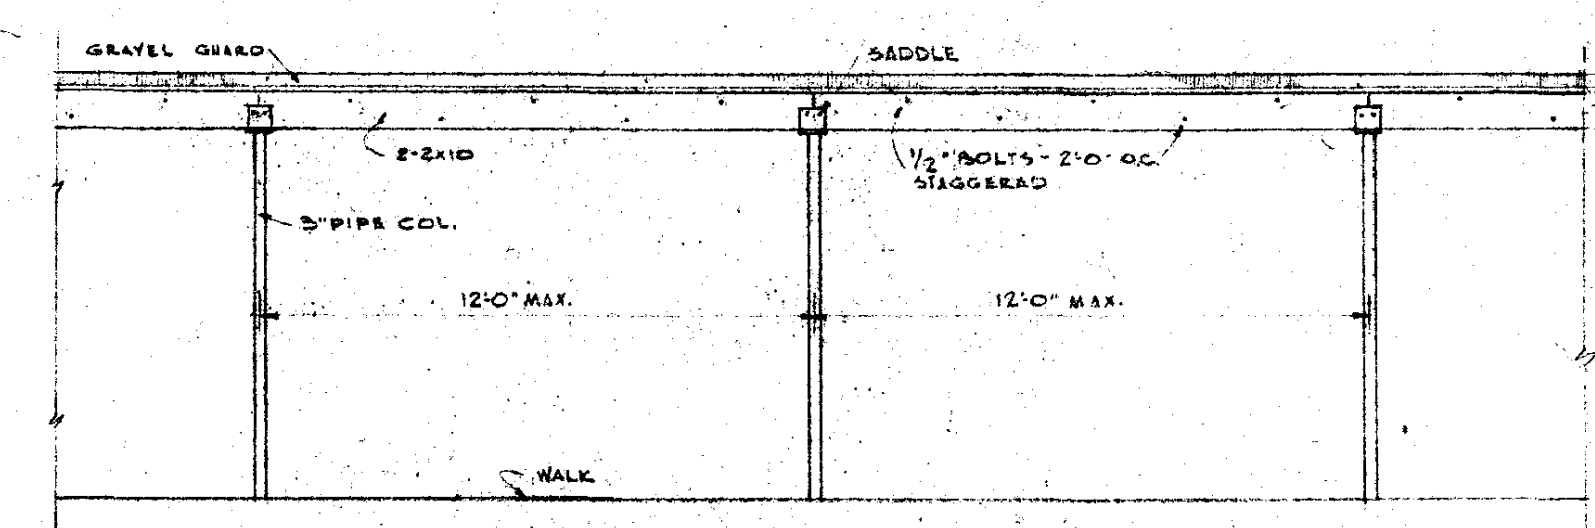
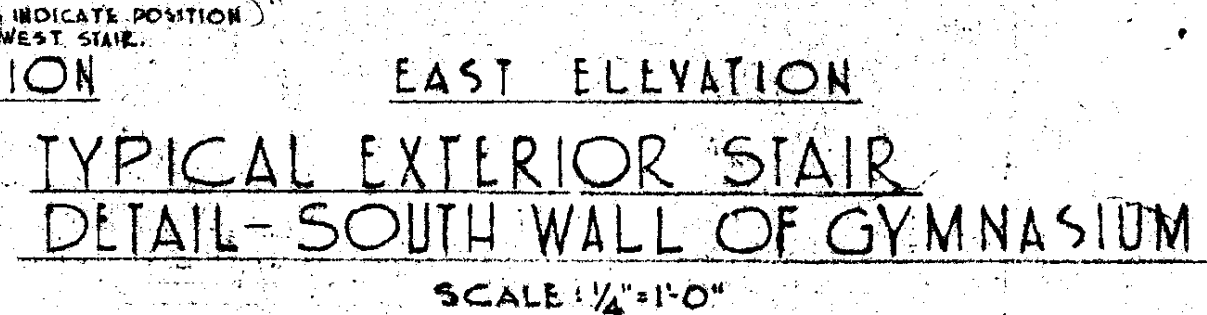
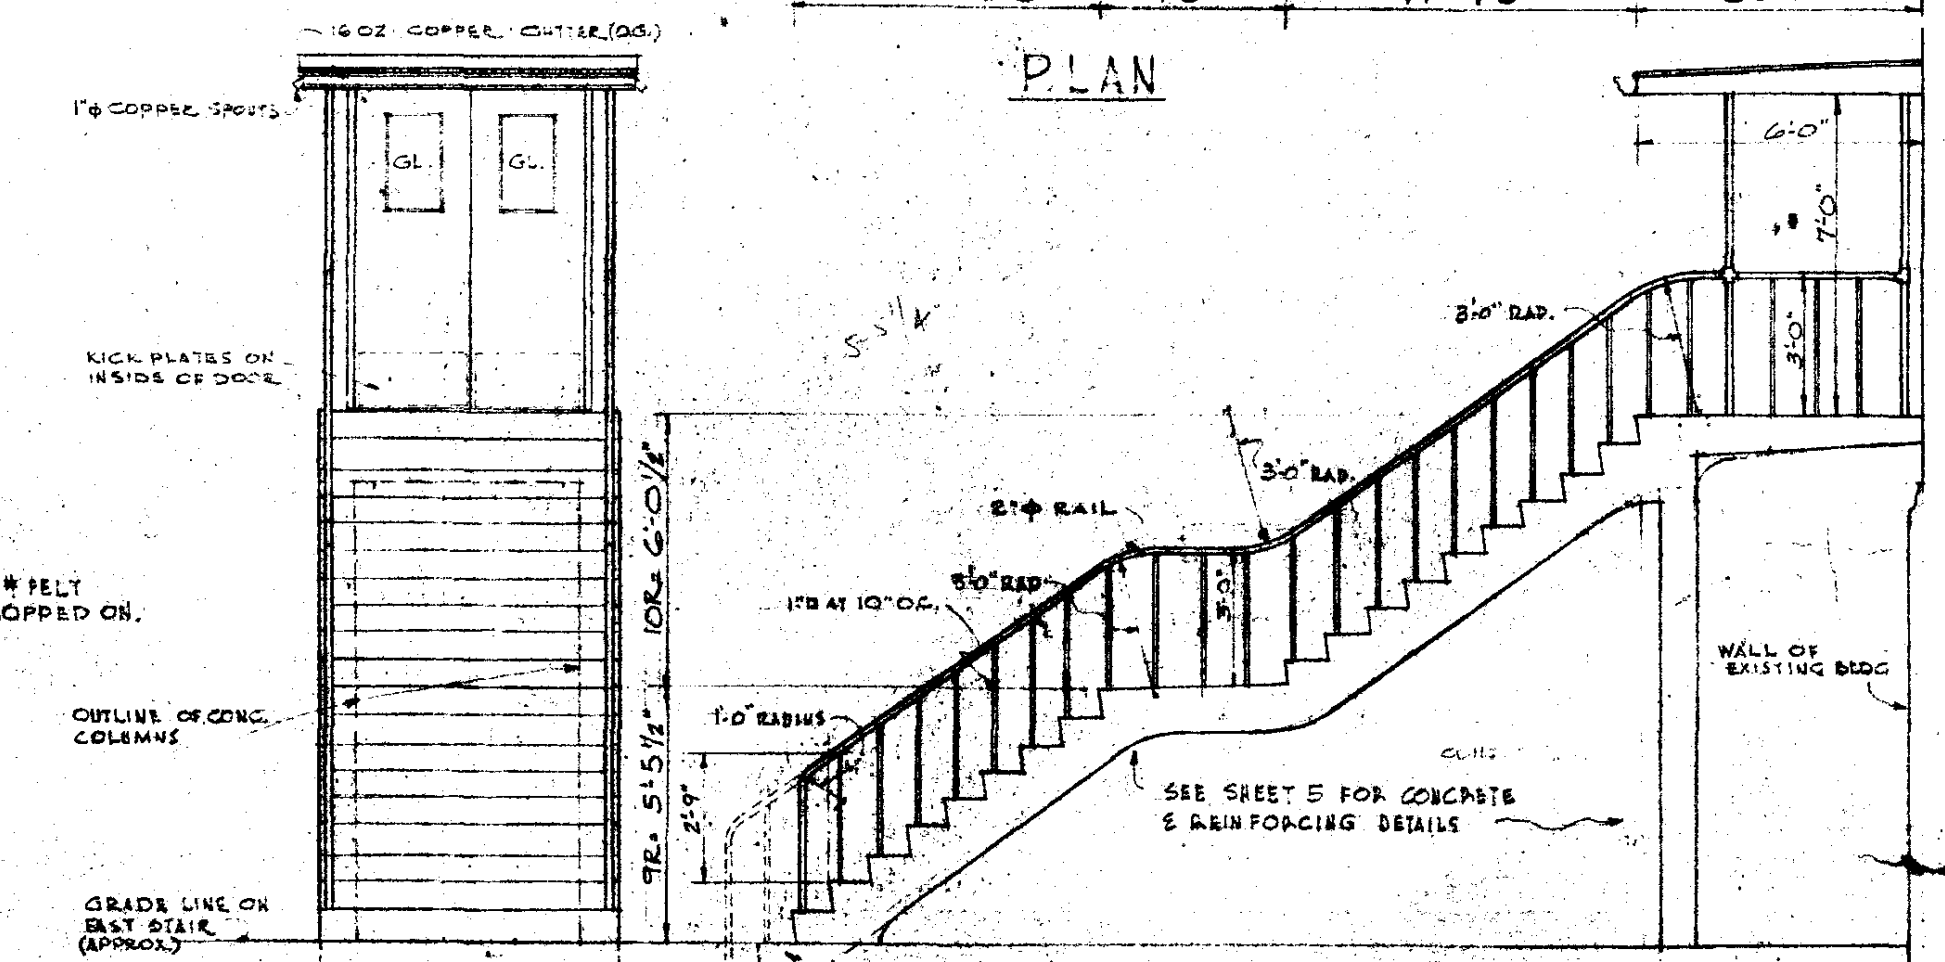
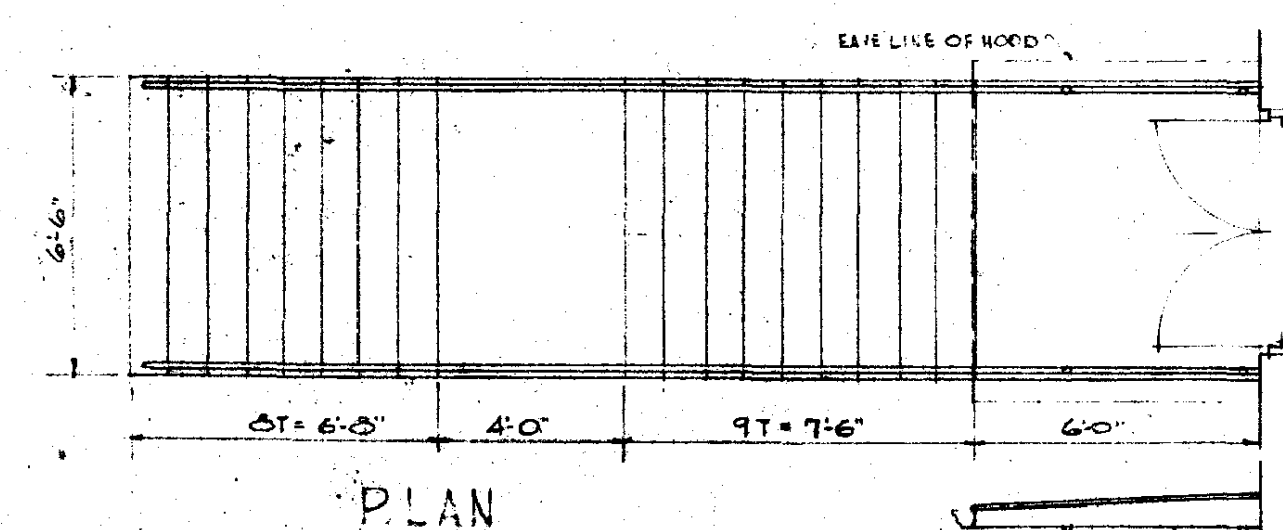
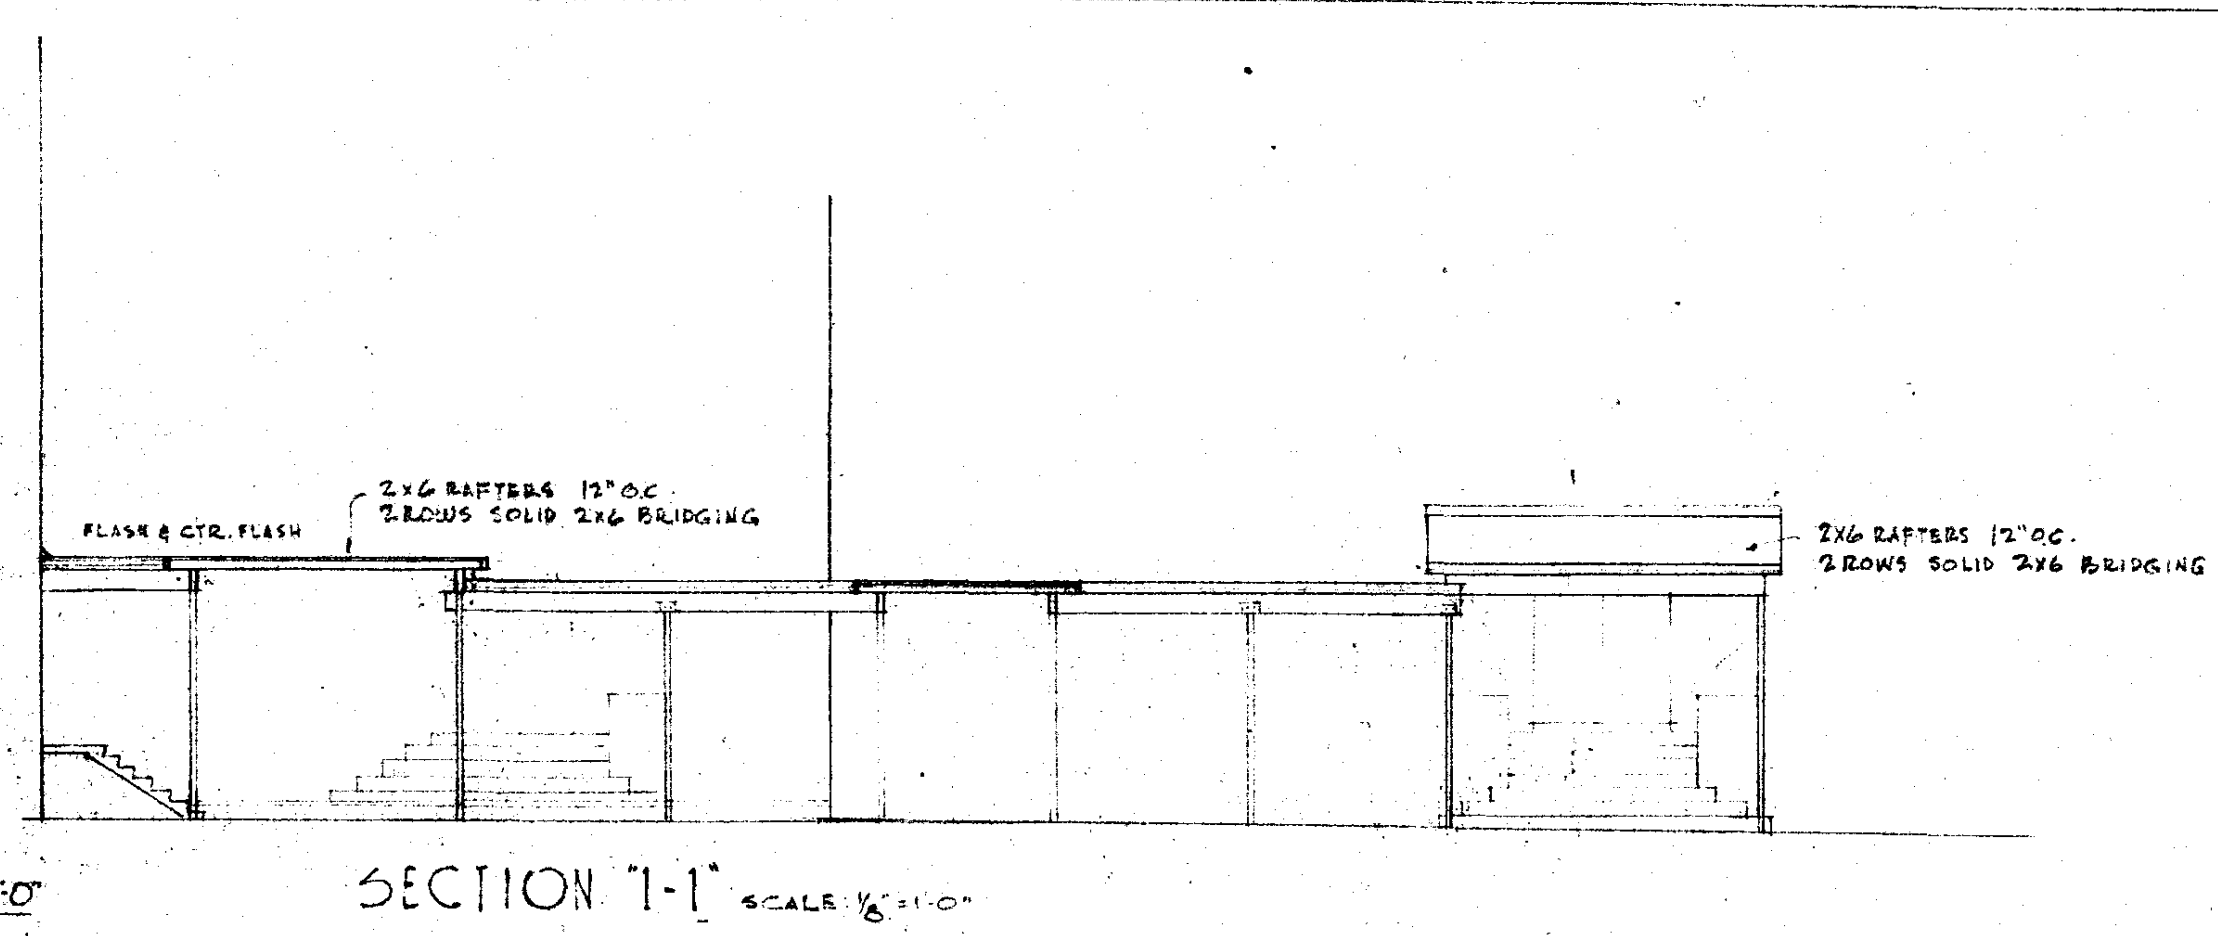
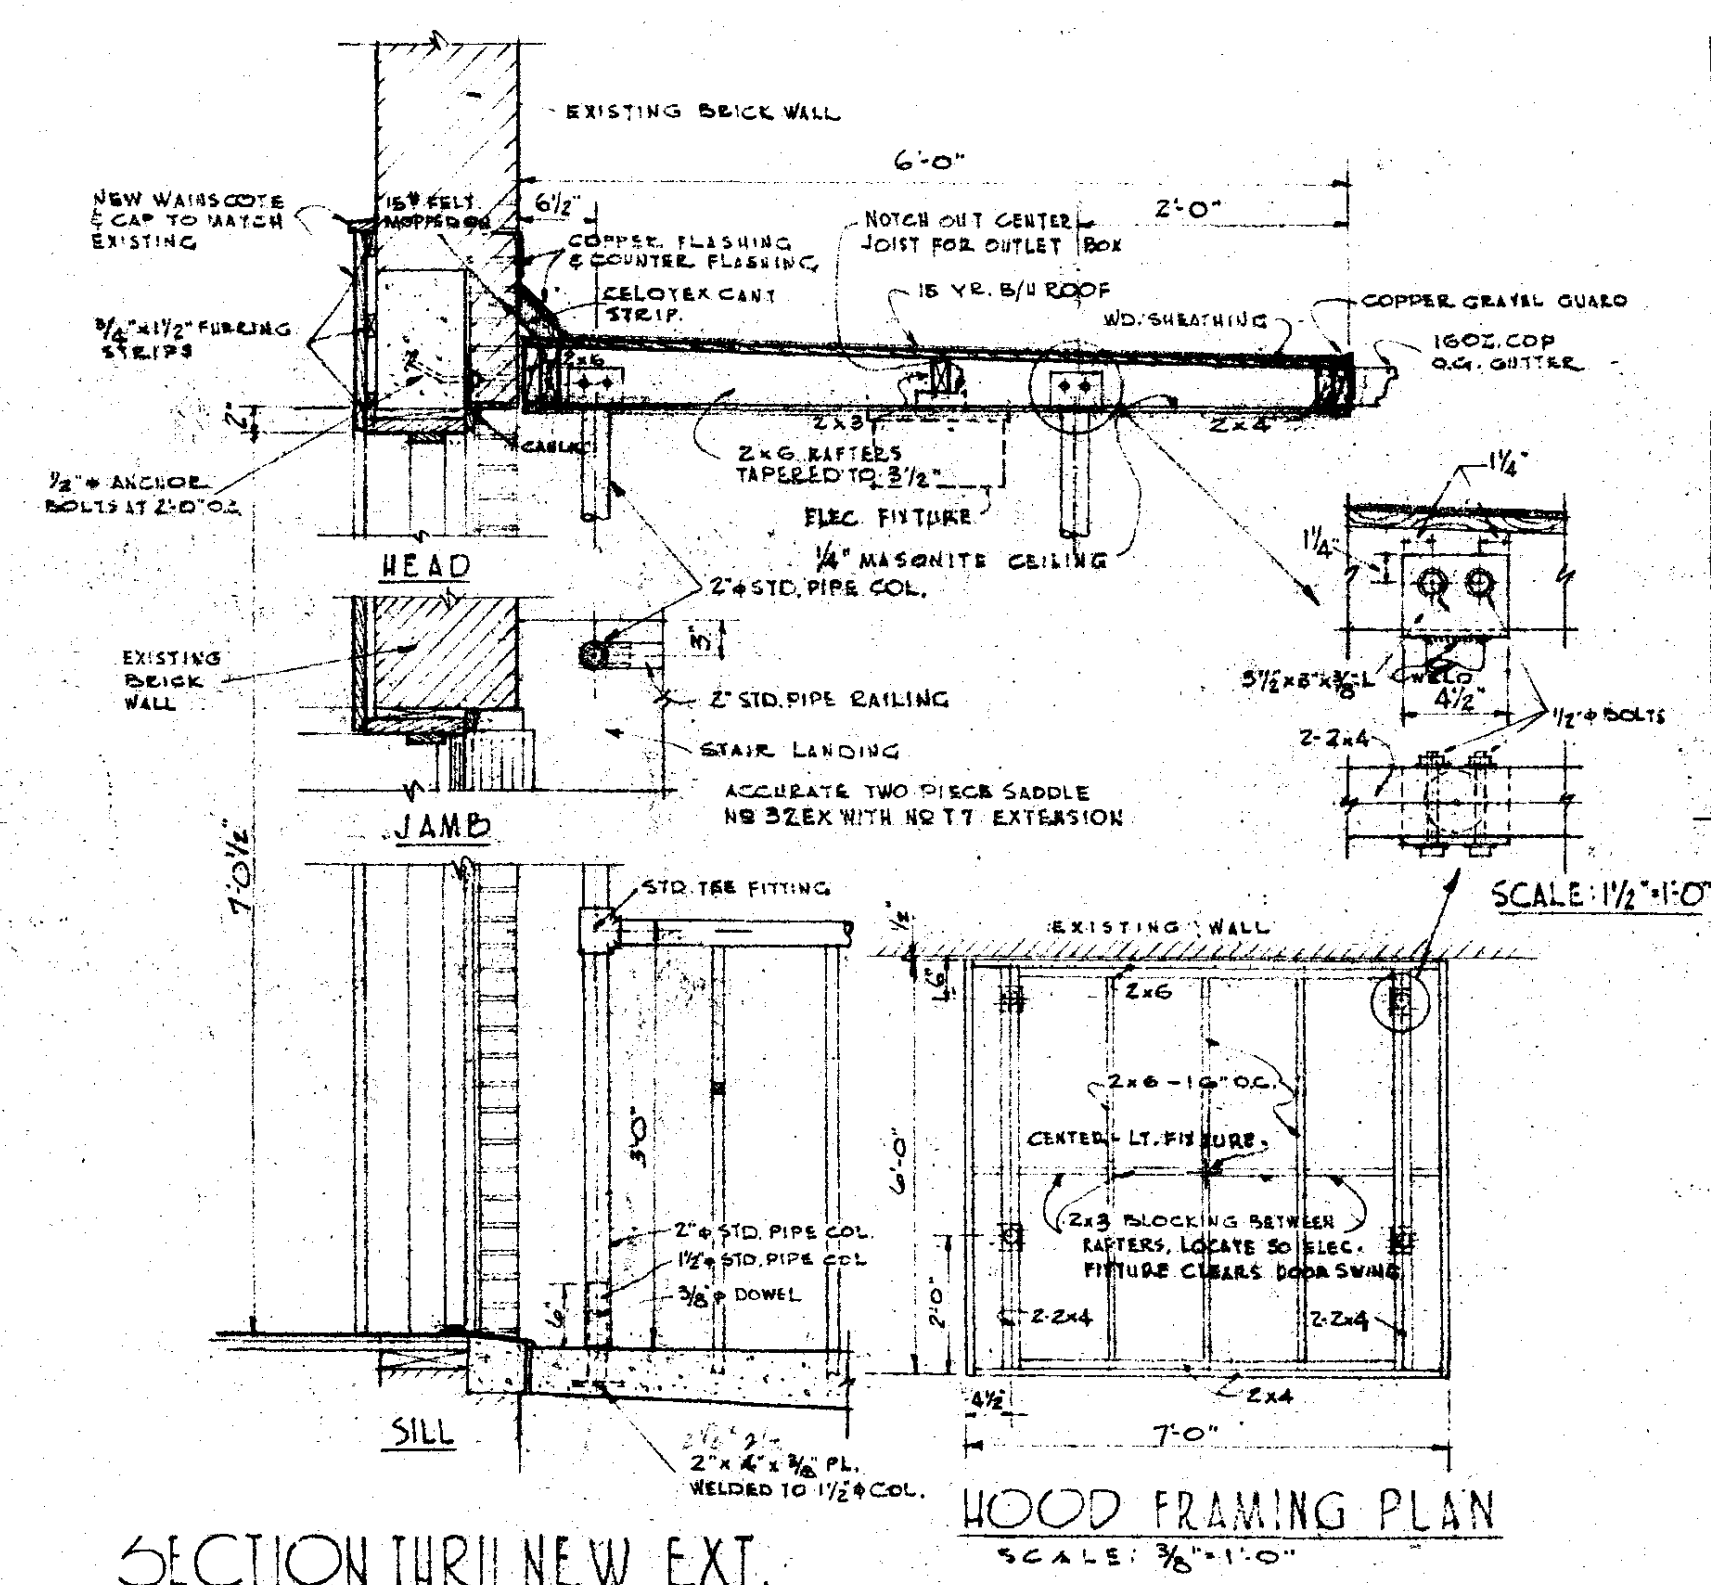
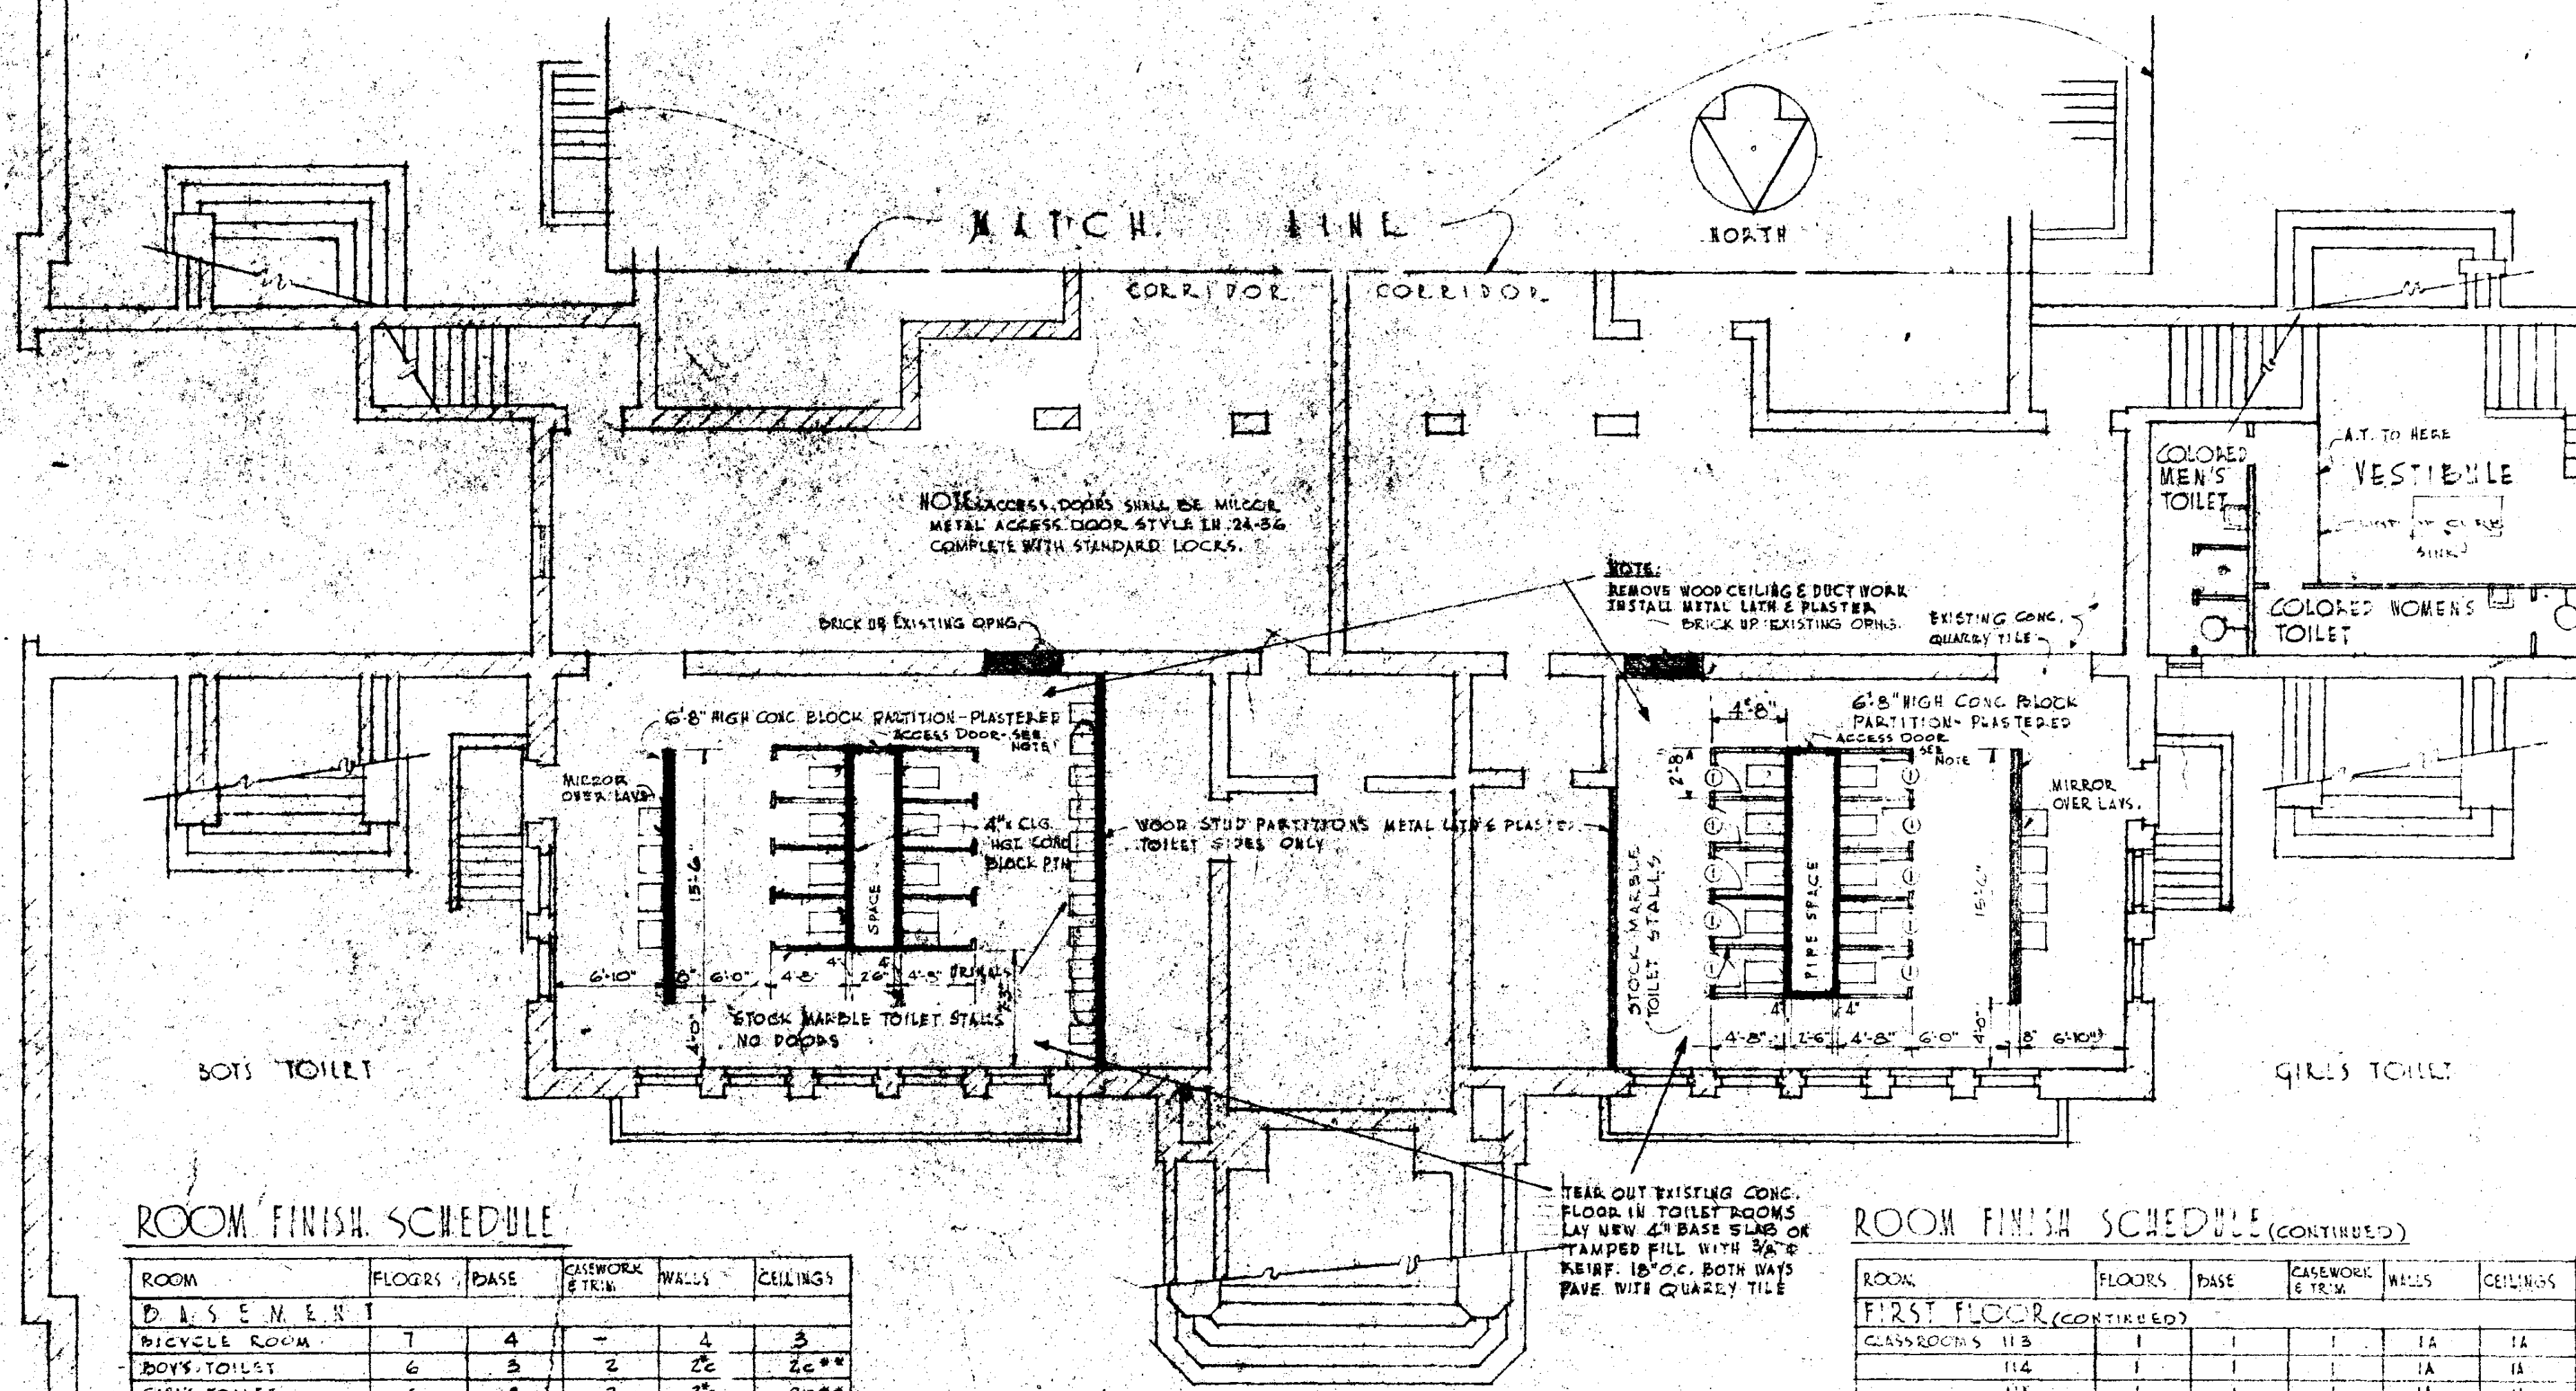


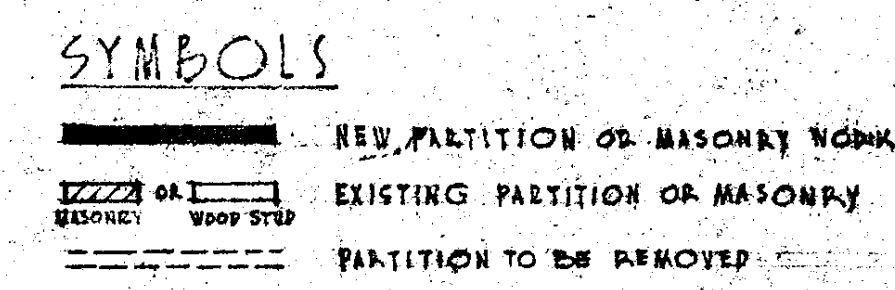

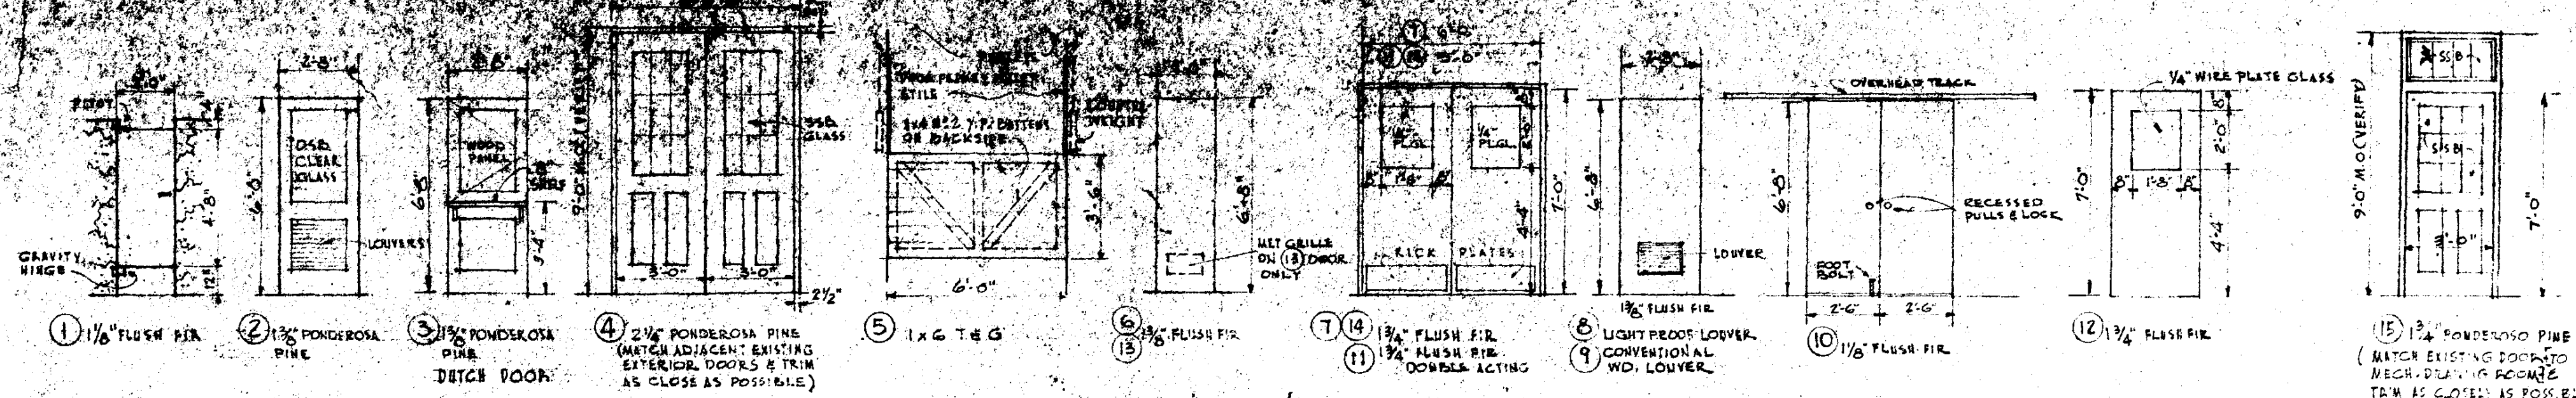

ROOM FINISH SCHEDULE

ROOM	FLOORS	BASE	CASEWORK & TRIM	WALLS	CEILING
BASEMENT					
BICYCLE ROOM	1	4	-	1	3
BOYS TOILET	6	3	2	2C	2C**
GIRLS TOILET	6	3	2	2C	2C**
COLORED MEN'S TOILET	4	4	2	C	C
COLORED WOMEN'S TOILET	4	4	2	C	C
OTHER WALLS	4	1	2	1C	1C
VESTIBULES	5	1	2	1C	1C
CLASSROOM 11	5	1	1	1A	1A
CLASSROOM 12	7	5	3	5	A
CAFETERIA	7	5	3	4	4
KITCHEN	7	5	3	4	4
STORAGE ROOM	7	5	3	4	4
BOYS GYM TOILET	6	3	2	2C	2C
BOYS GYM SHOWER	6	3	-	2C	2C
TECH LOCKER ROOM	4	1	2	2C	2C
LOCKER ROOM	7	5	3	4	4
GIRLS LOCKER ROOM	4	1	2	C	5
GIRLS SHOWER & TOILET	7	5	3	2C	5
MECH DRAWING ROOM	7	2	2	C	5
LIBRARY	7	4	4	D	5
UNASSIGNED	7	5	3	4	5
MUSIC ROOM	7	5	3	4	5
FIRST FLOOR					
GYMNASIUM	7	1	2	4	3
VESTIBULES & SIDE ROOMS	5	1	2	D	5
AUDITORIUM & STAGE	5	1	1	A	A
CLASSROOM 101	1	1	1	1A	1A
102	1	1	1	1A	1A
103	1	1	1	1A	1A
104	1	1	1	1A	1A
105	1	1	1	1A	1A
106	1	1	1	1A	1A
107	1	1	1	1A	1A
108	1	1	1	1A	1A
109	1	1	1	1A	1A
110	1	1	1	1A	1A
111	1	1	1	1A	1A
112	1	1	1	1A	1A

ROOM FINISH SCHEDULE (CONTINUED)

ROOM	FLOORS	BASE	CASEWORK & TRIM	WALLS	CEILING
FIRST FLOOR (CONTINUED)					
CLASSROOM 113	1	1	1	1A	1A
114	1	1	1	1A	1A
115	1	1	1	1A	1A
CENTRAL WING CORRIDORS	1	1	1	1A	1A
ALL OTHER CORRIDORS	1	1	1	1A	1A
ACTIVITIES ROOM	1	1	1	1A	1A
ADMINISTRATION ROOMS	1	1	1	1A	1A
NEW & EXISTING TOILETS	2	2	2	2C	1A
UNION CLOSETS	2	2	2	2C	1C
BOOK & STORAGE ROOMS	1	1	2	1B	1B
ACCOUPLED ELEC. RM.	1	1	2	1B	1B
CENTRAL ROOM	2	2	2	1B	1B
PRODUCTION ROOM	1	2	2	1B	1B
PHOTOGRAPHY ROOM	2	2	2	1A	1A
SECOND FLOOR					
CLASSROOM 201	1	1	1	1A	1A
202	1	1	1	1A	1A
203	1	1	1	1A	1A
204	2	1	2	1A	1A
205	1	1	1	1A	1A
206	2	1	2	1C	1B
207	1	1	1	1A	1A
208	1	1	1	1A	1A
209	1	1	1	1A	1A
210	1	1	1	1A	1A
211	1	1	1	1A	1A
212	1	1	1	1A	1A
213	1	1	1	1A	1A
214	1	1	2	1A	1A
215	1	1	1	1A	1A
CORRIDORS					
TEACHERS WORK ROOM	1	1	1	1A	1A
LIBRARY	1	1	1	1A	1A
LIBRARY	1	1	1	1A	1A
LIBRARY WORK ROOM	1	1	1	1A	1A
GIRLS TOILET	5	5	2	2C	2C
BOYS TOILET	5	5	2	2C	2C
UNITED	2	1	2	1C	1C
BOOK & STORAGE RM.	1	1	2	1B	1B

KEY TO ROOM FINISH SCHEDULE

- KEY NO. FLOORS**
1. FILL AND SMOOTH & INSTALL ASPHALT TILE
 2. FILL AND SMOOTH & INSTALL GRESSEPOOF ASPHALT TILE
 3. FILL AND SMOOTH & APPLY TWO COATS OF BARNISH
 4. PATCH CONCRETE FLOOR
 5. INSTALL CERAMIC TILE FLOOR ON THIN SETTING BED
 6. INSTALL CERAMIC TILE FLOOR ON SETTING BED ON NEW 4" CONCRETE SLAB
 7. LEAVE AS IS
 8. PATCH CONCRETE FLOOR & INSTALL ASPHALT TILE
- BASE**
1. PAINT EXISTING WOOD BASE SAME AS TRIM
 2. INSTALL NEW BASE & MOULD TO MATCH EXIST. PAINT
 3. G-CERAMIC TILE BASE
 4. NONE
 5. LEAVE AS IS
- CASEWORK & TRIM**
1. PAINT WITH SEMI-GLOSS PAINT
 2. PAINT WITH HIGH-GLOSS PAINT
 3. LEAVE AS IS
 4. UNPAINTED
- CEILING**
1. PATCH EXIST. PLASTER & PLASTER NEW CEILING WITH 5-COAT WHITE FINISH GYPSUM PLASTER OR METAL LATH
 2. SAME AS NO. 1 EXCEPT SMOOTH PORTLAND CEMENT PLASTER
 3. G-CERAMIC TILE CEILING
 4. LEAVE AS IS
 5. TOUCH UP EXISTING WALLS
 6. PAINT WITH FLAT WALL PAINT
 7. PAINT WITH SEMI-GLOSS WALL PAINT
 8. PAINT WITH HIGH-GLOSS WALL PAINT
 9. NEW VANDERBILT UNPAINTED

SECTION THRU BASEMENT WINDOW
SCALE 1/4" = 1'-0"

Mallett & Associates
Engineers & Architects Jackson, Miss.

JOHN M. MATTINGLY, A.L.A. Architect







ALTERATIONS & ADDITIONS
BROOKS JUNIOR HIGH SCHOOL JACKSON, MISS.

BASEMENT - NORTH SIDE


DRAWN BY JET JEB. INK. TRACED BY _____
REVISED

APRIL 21, 1951


SHEET NO. 2

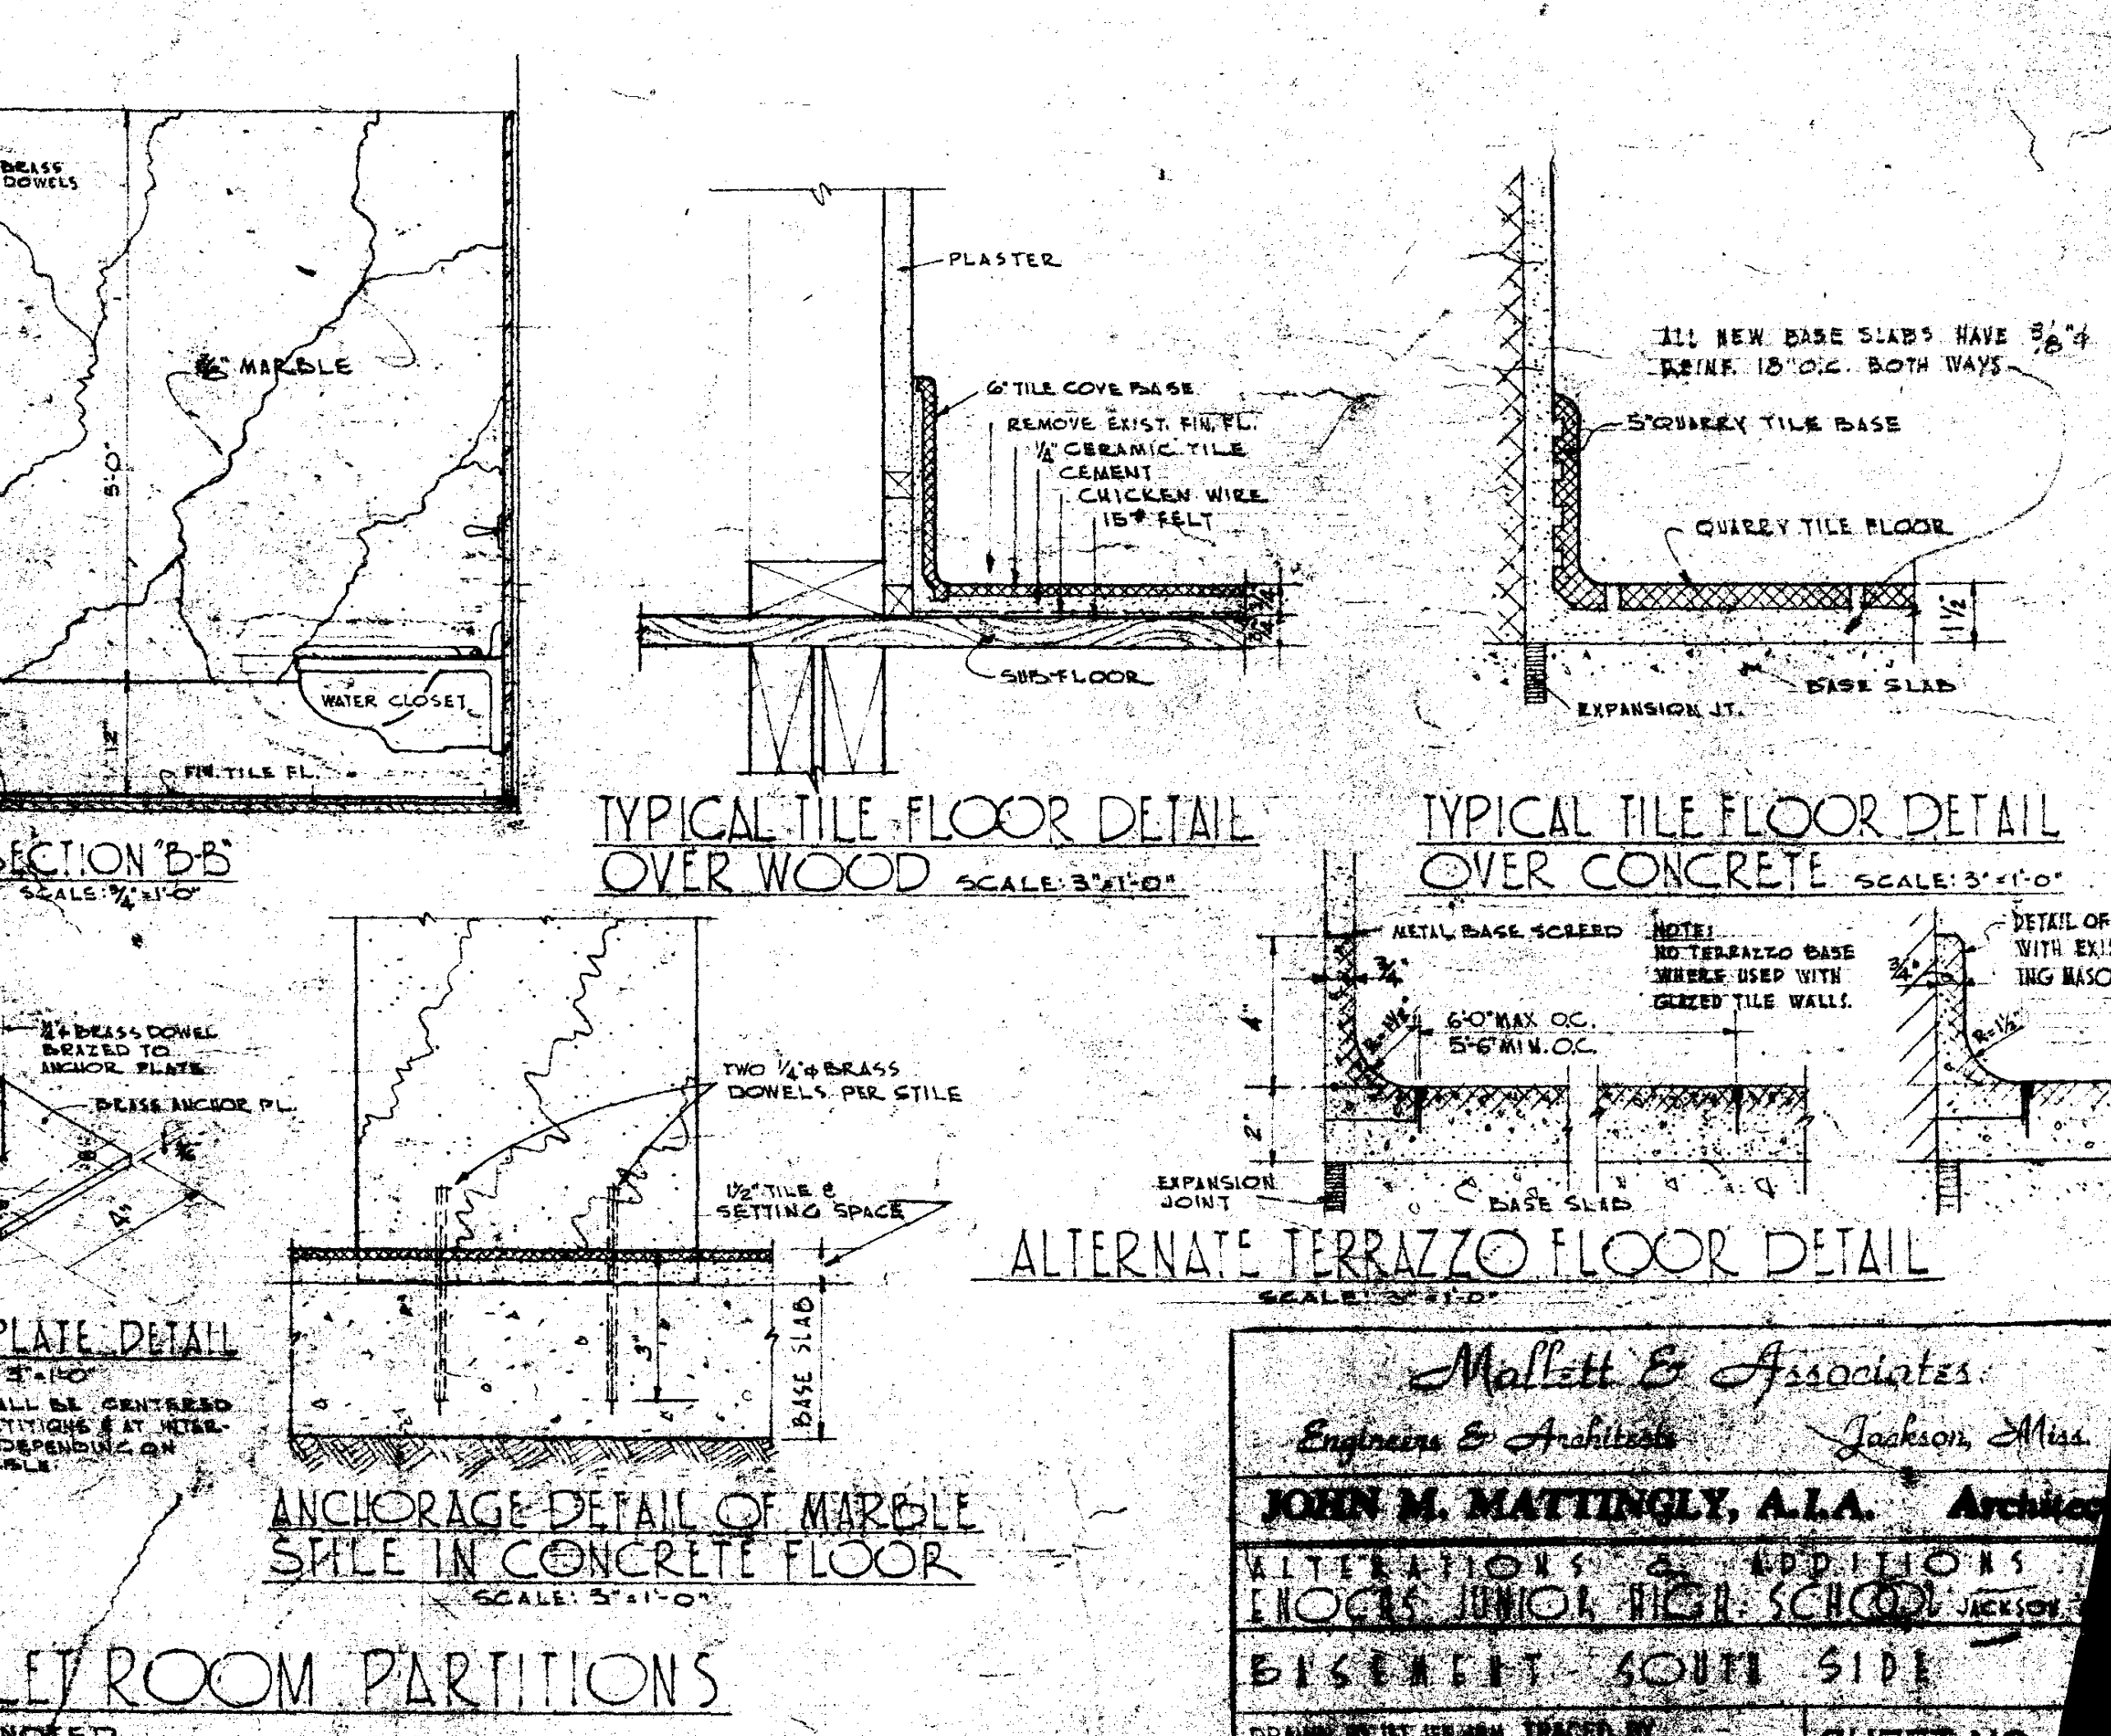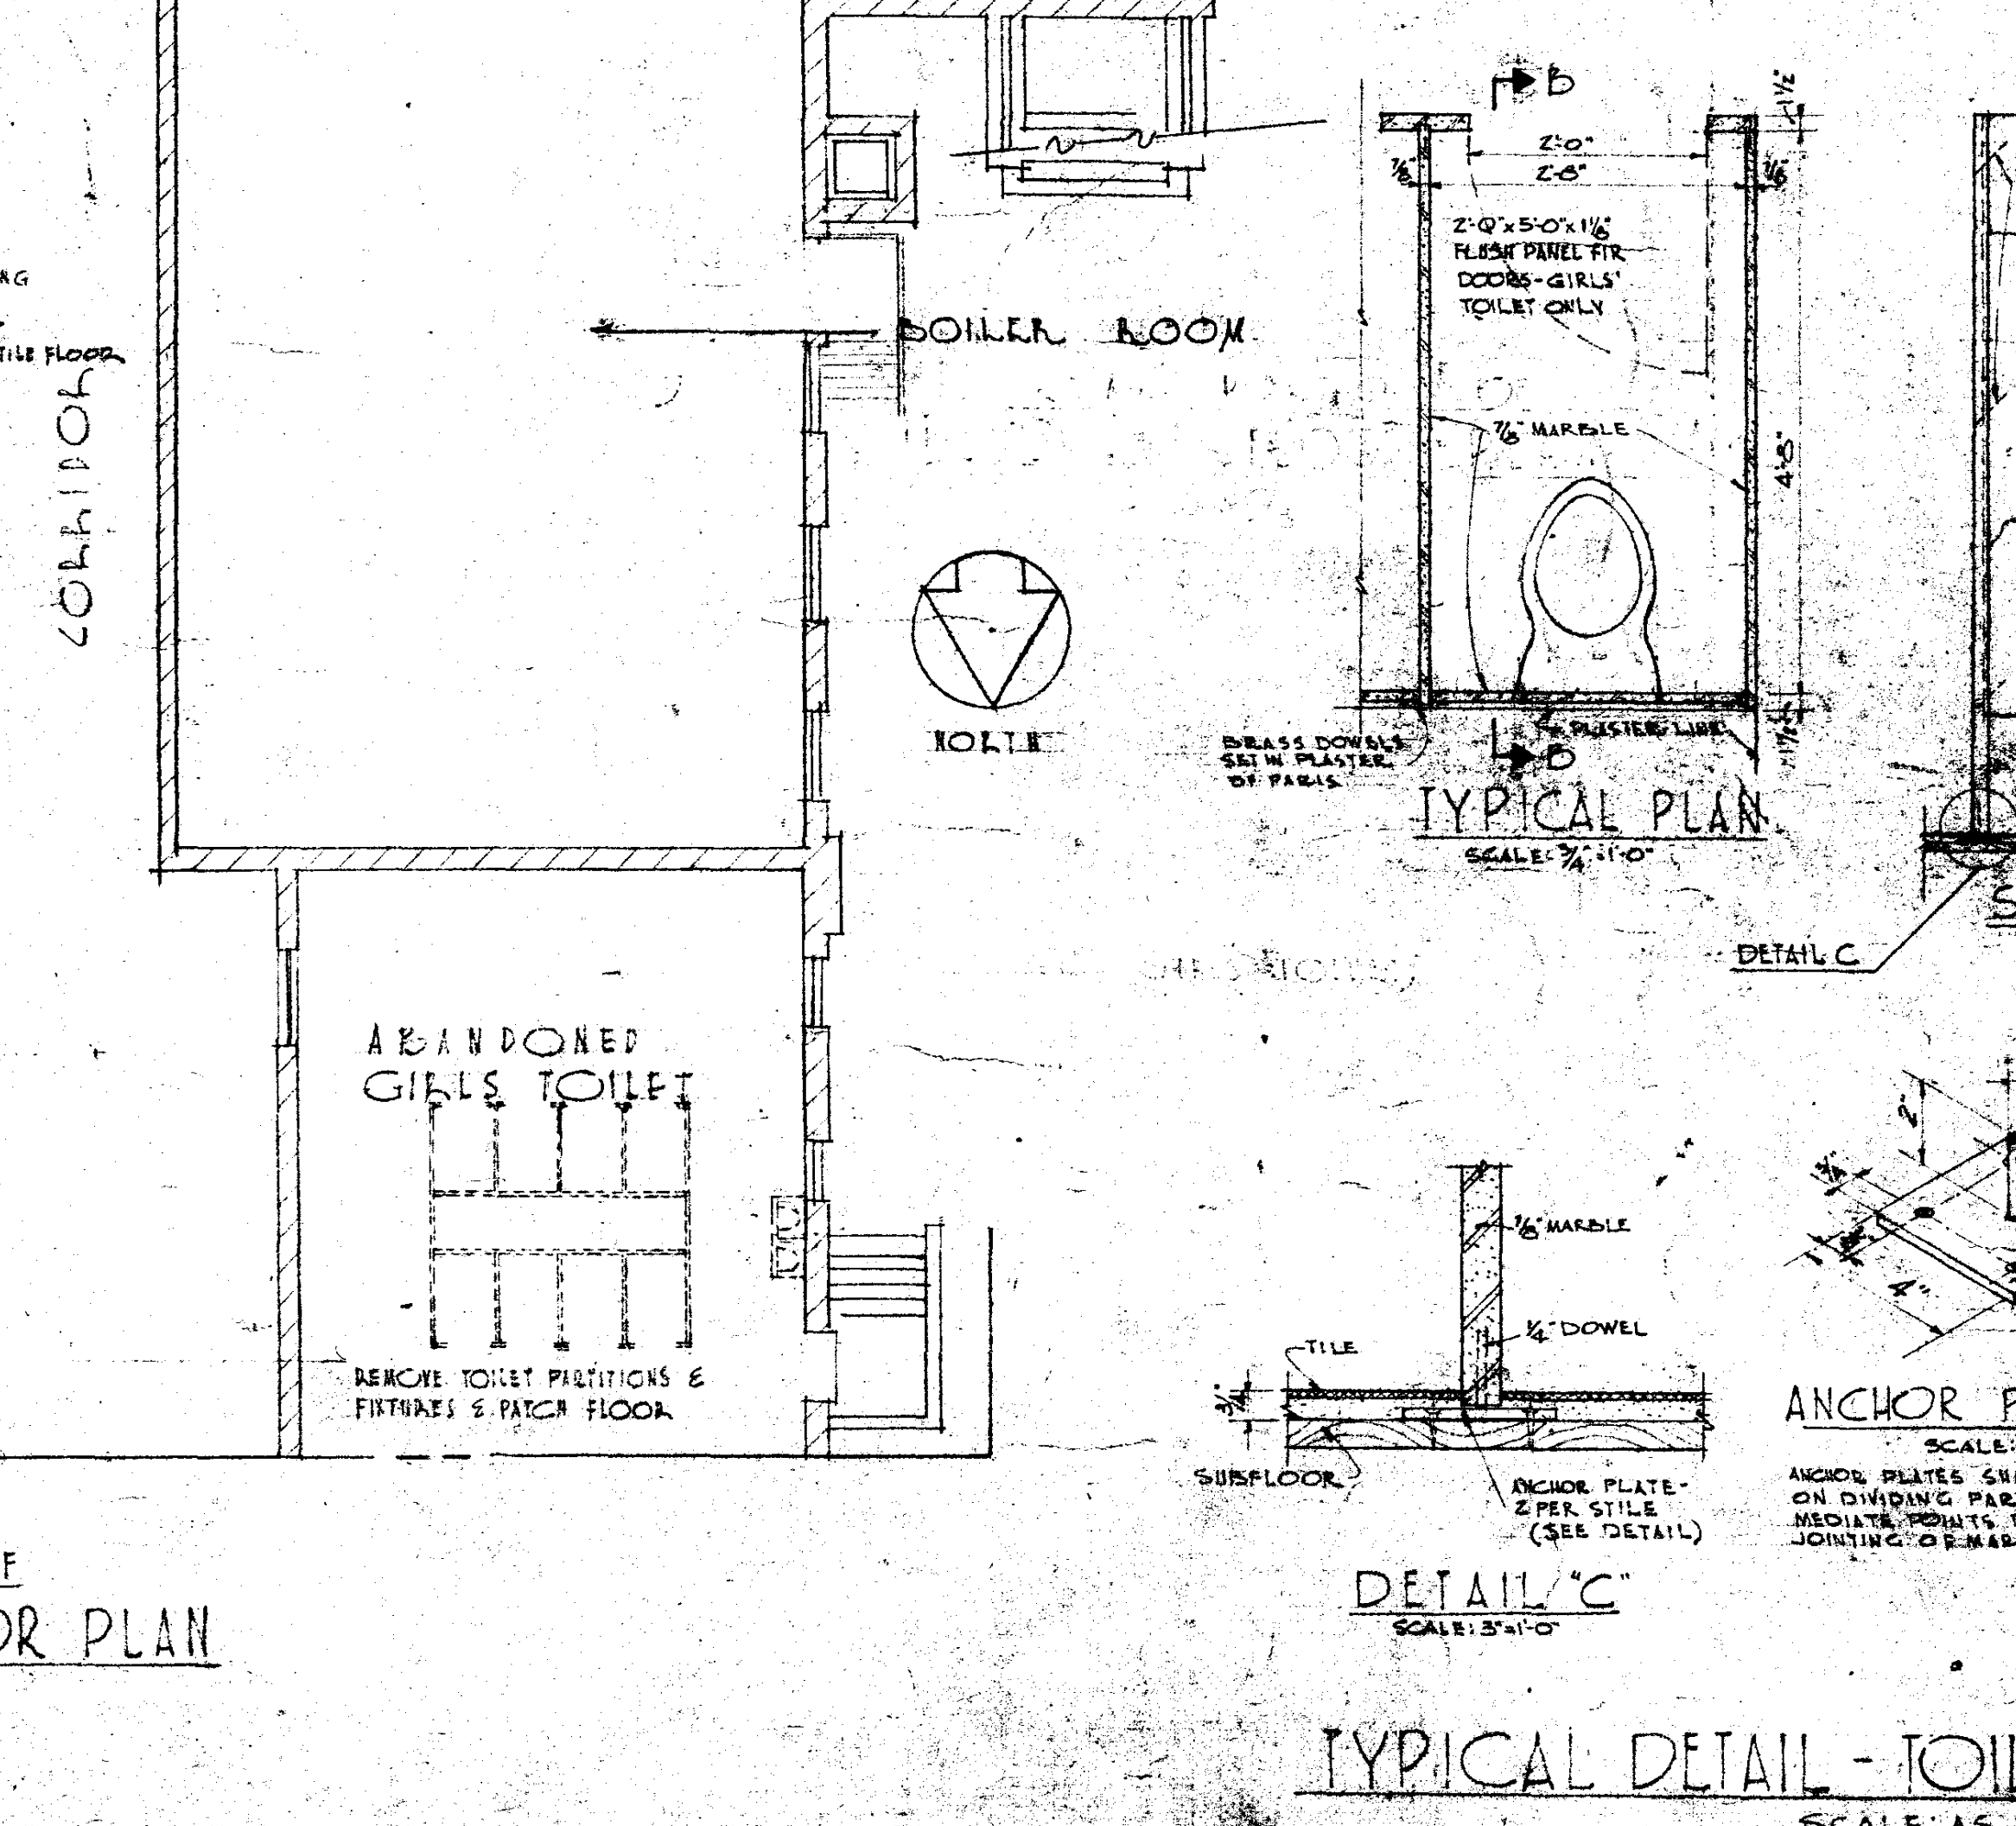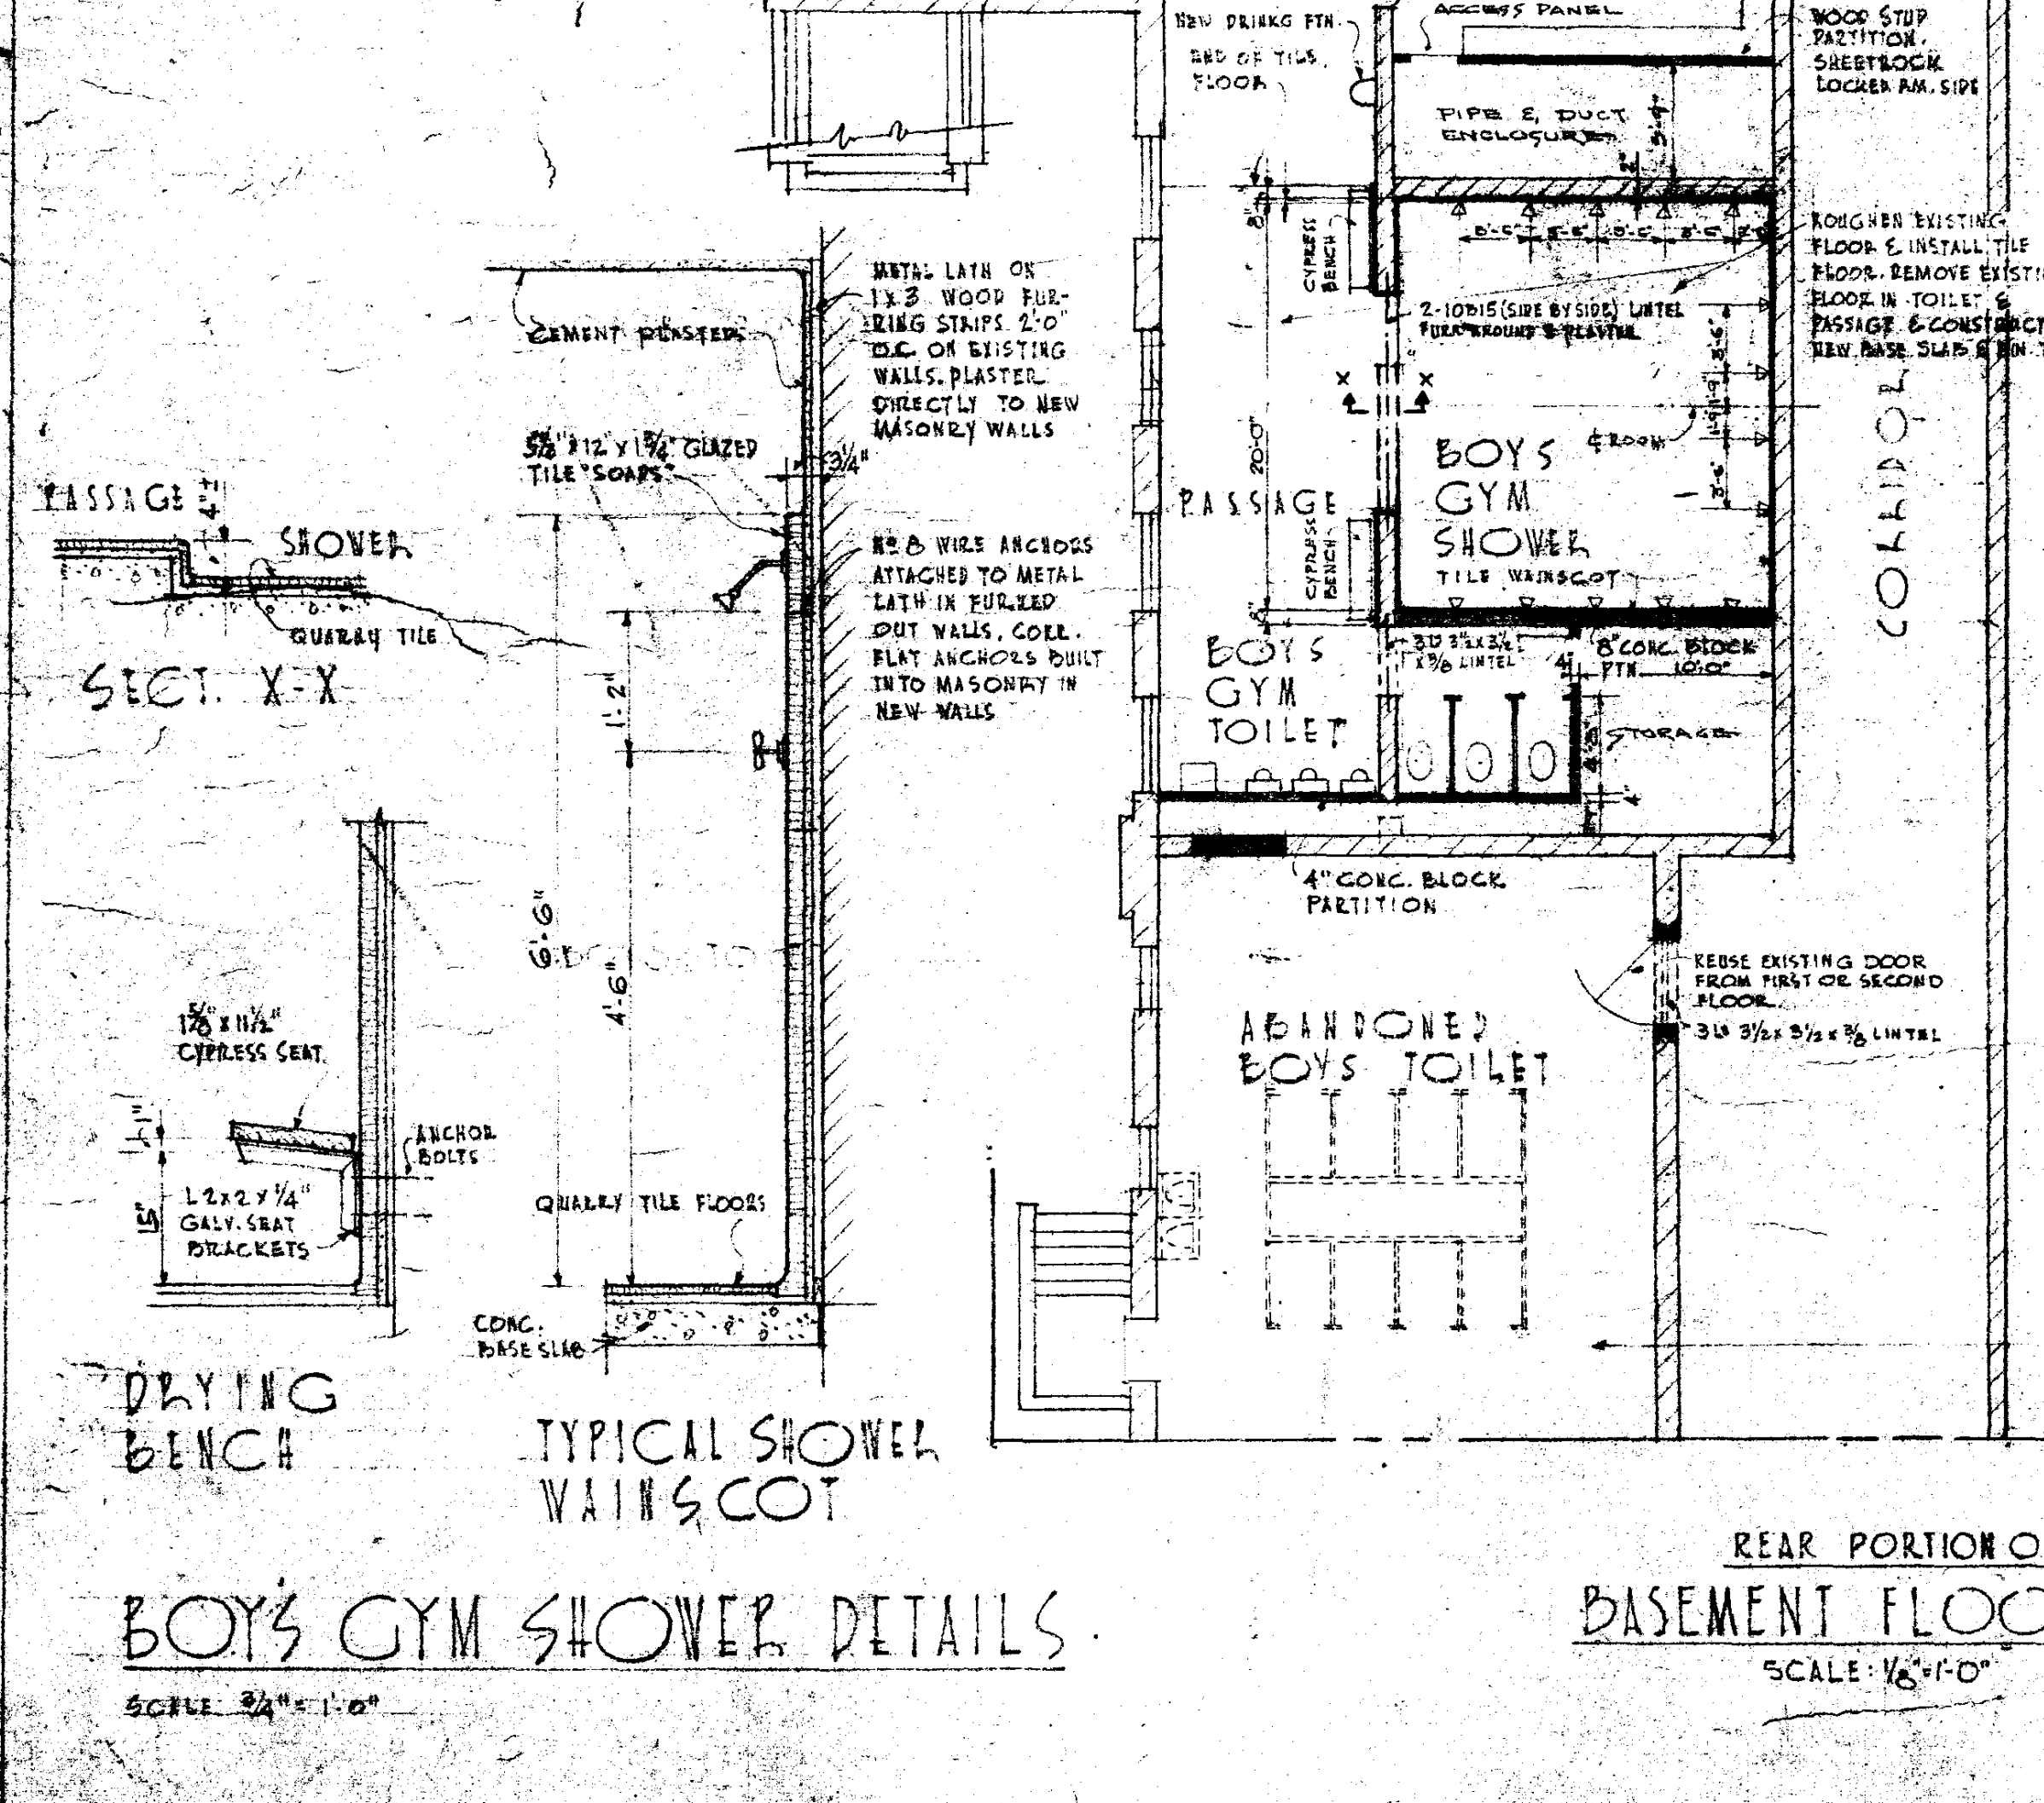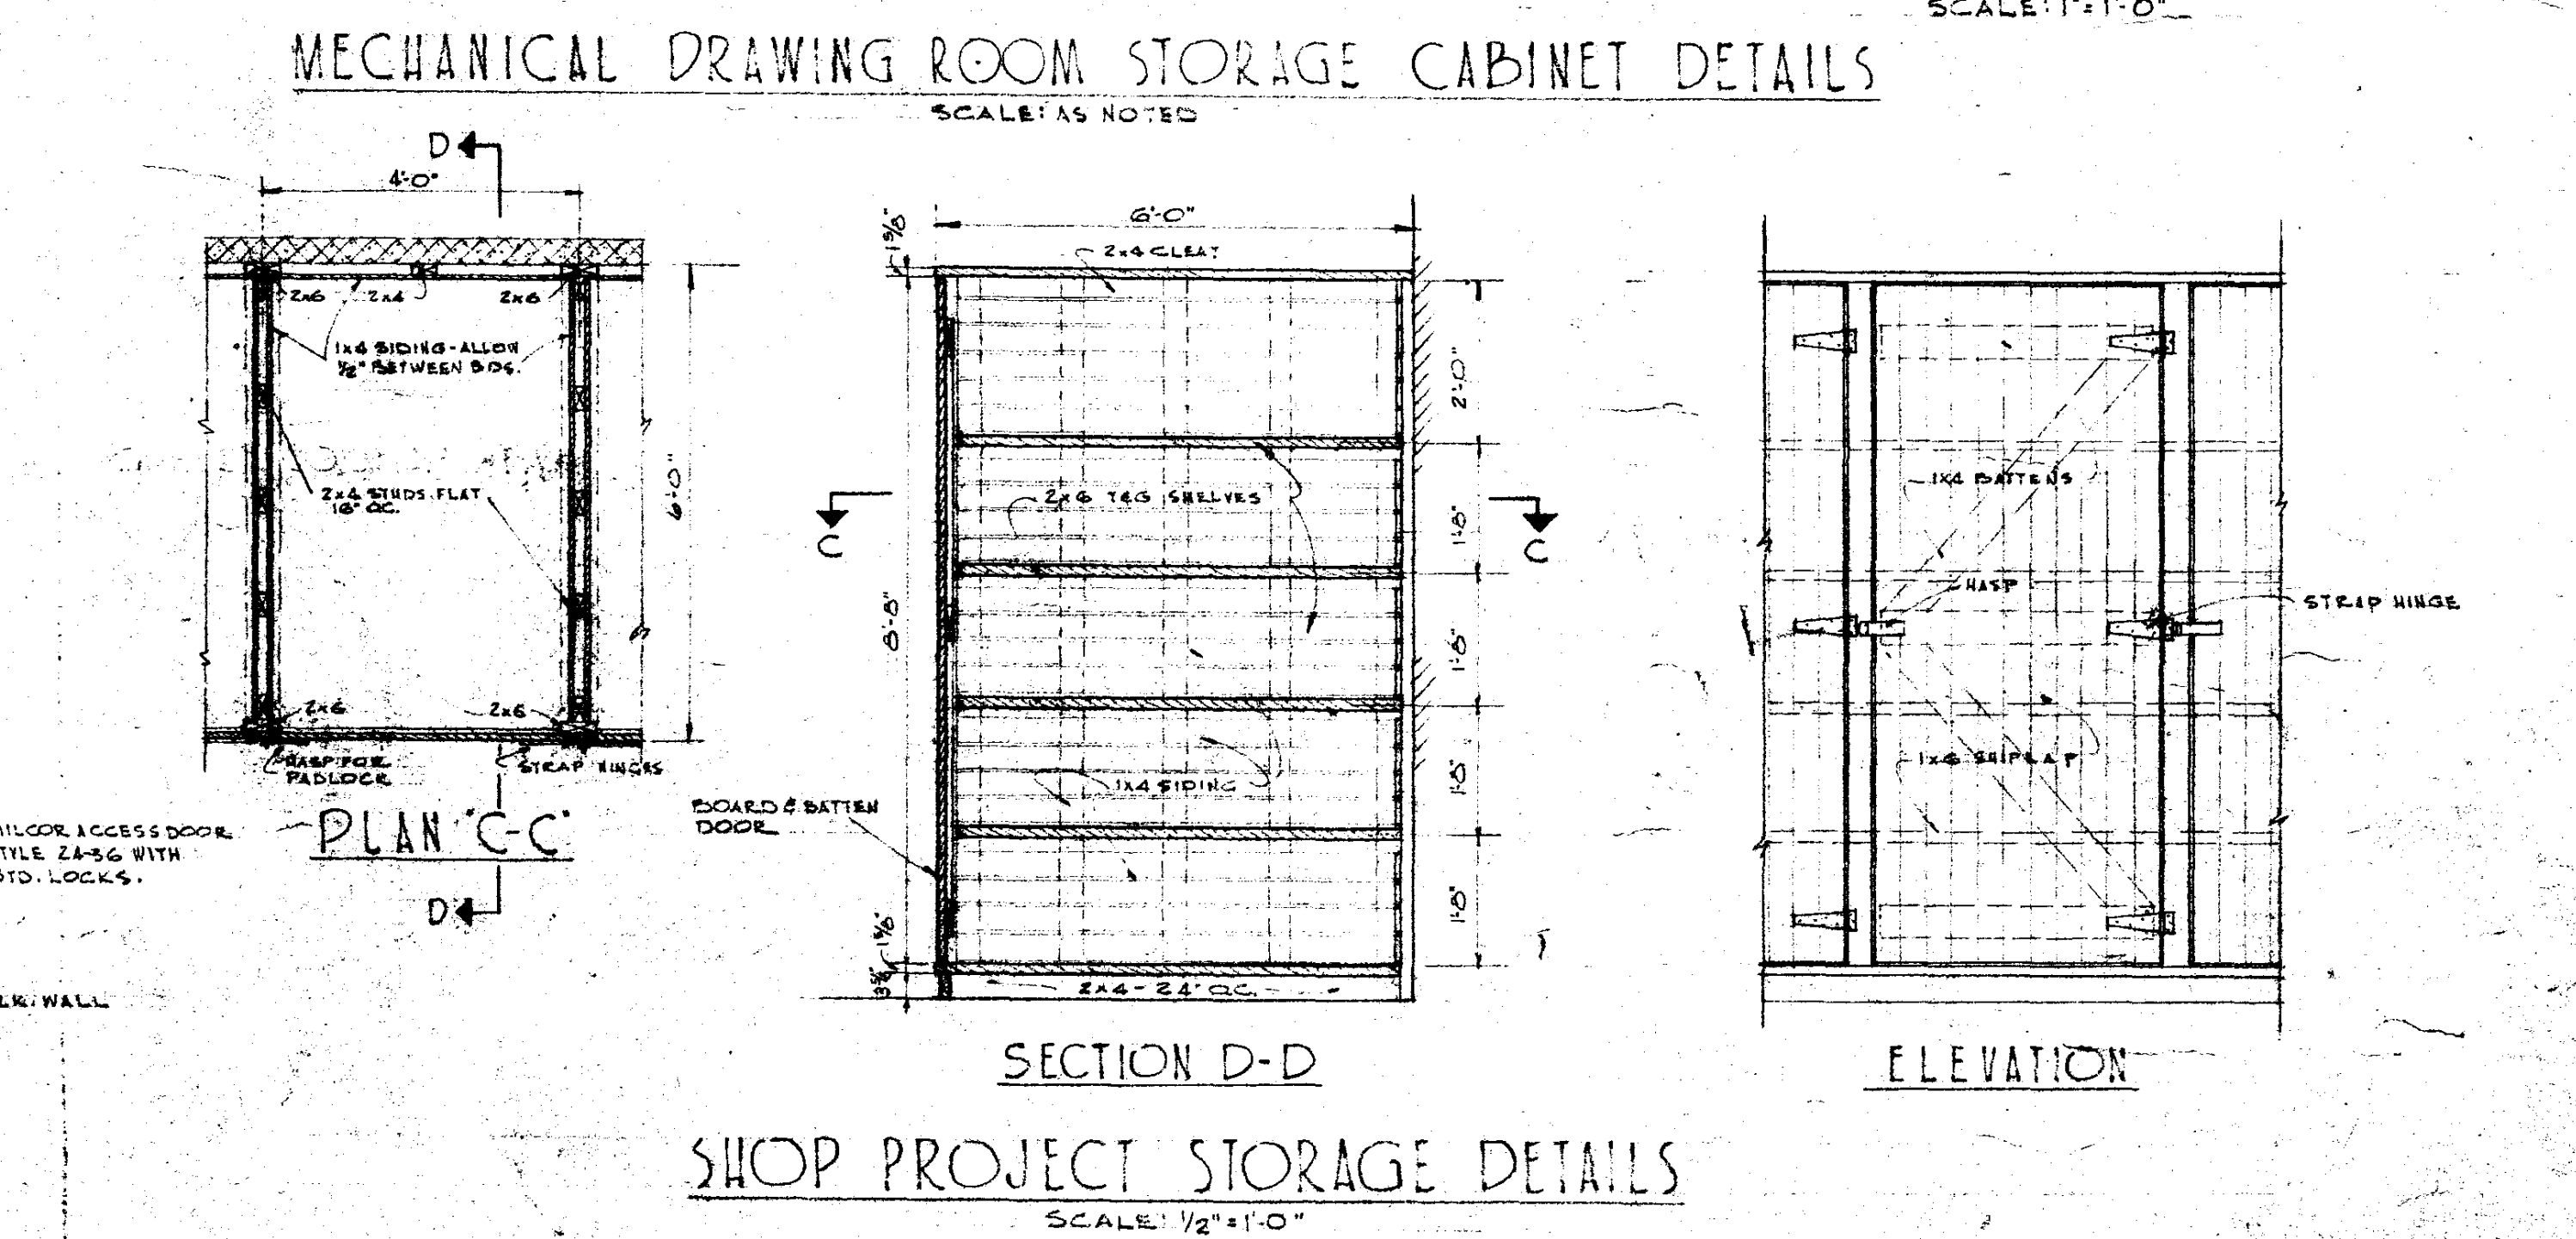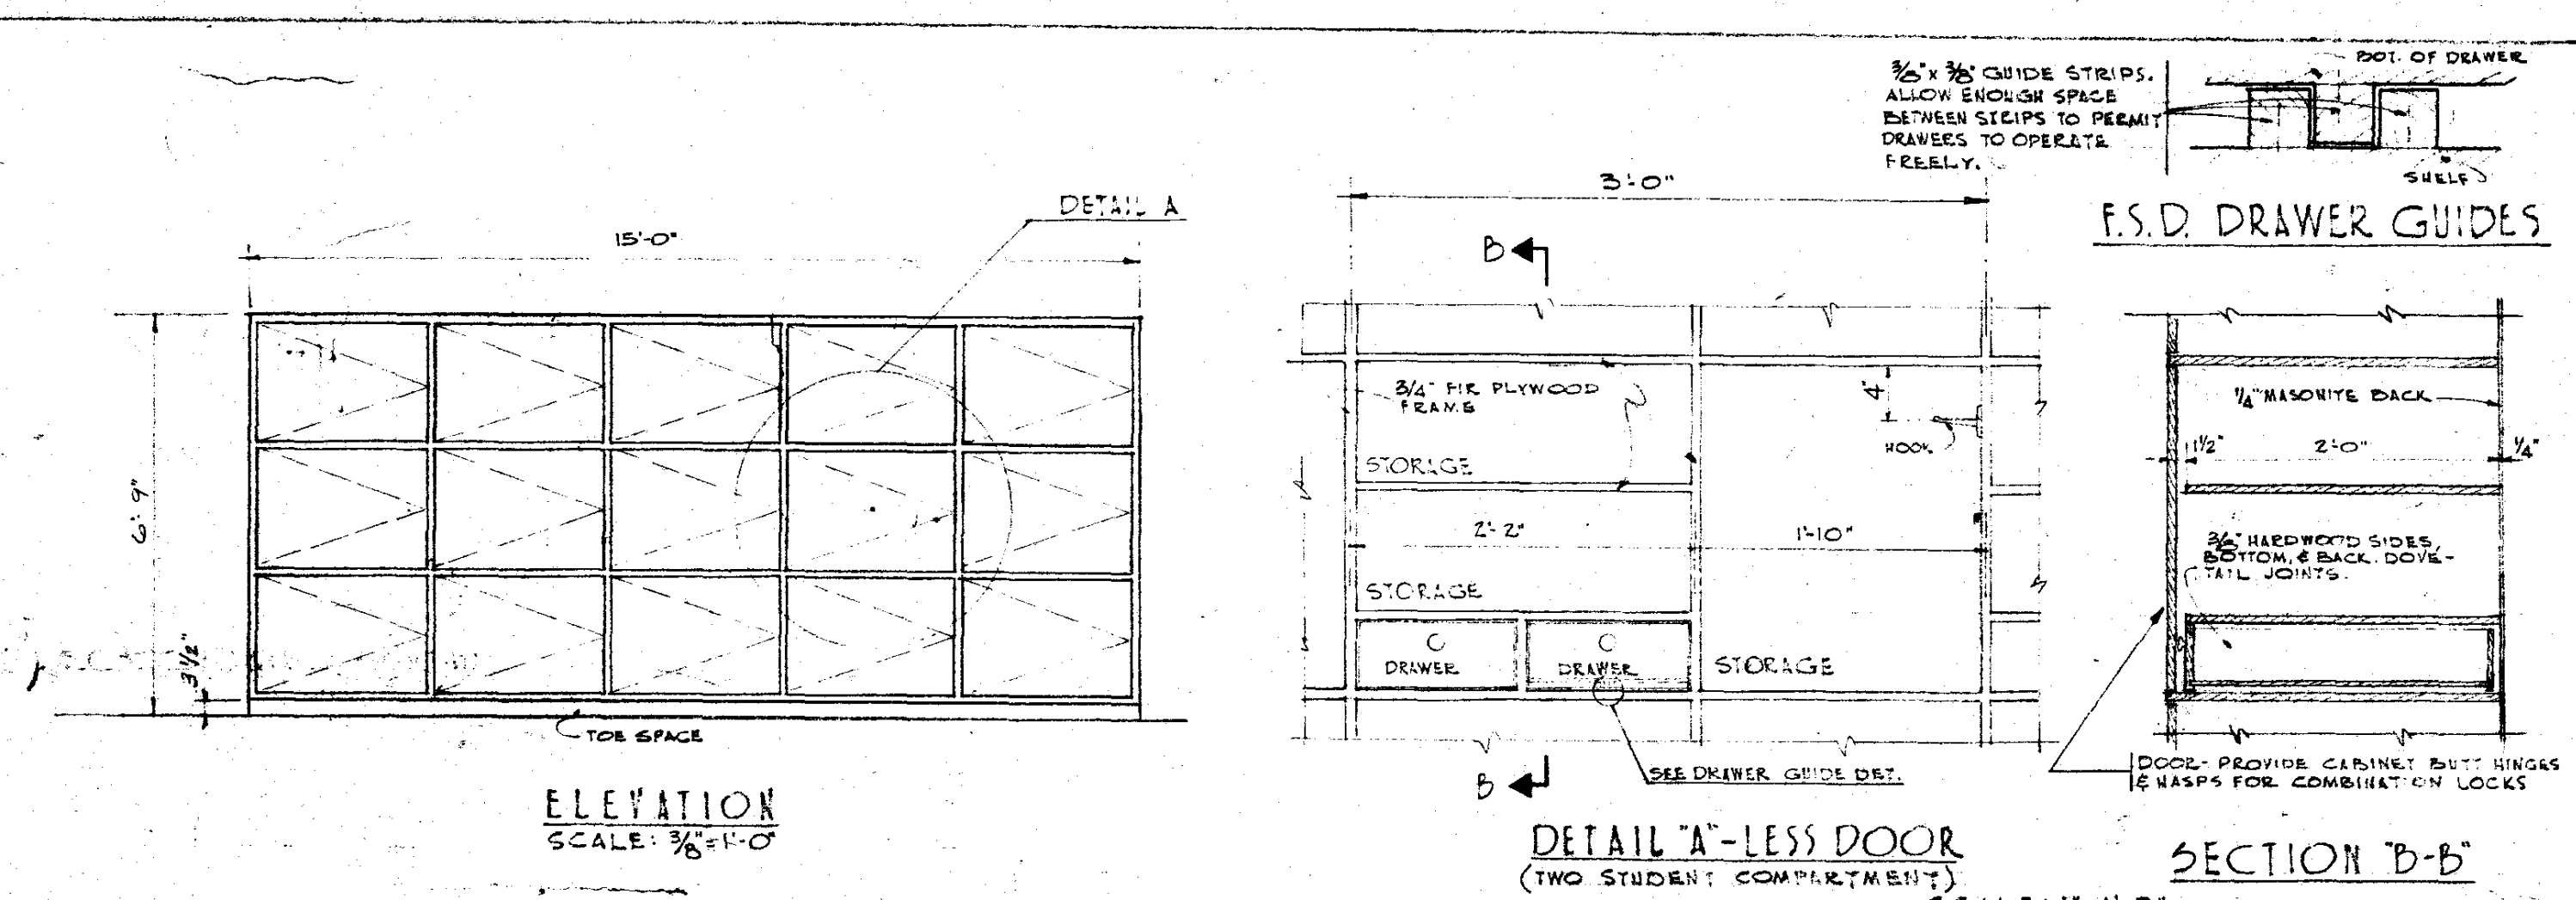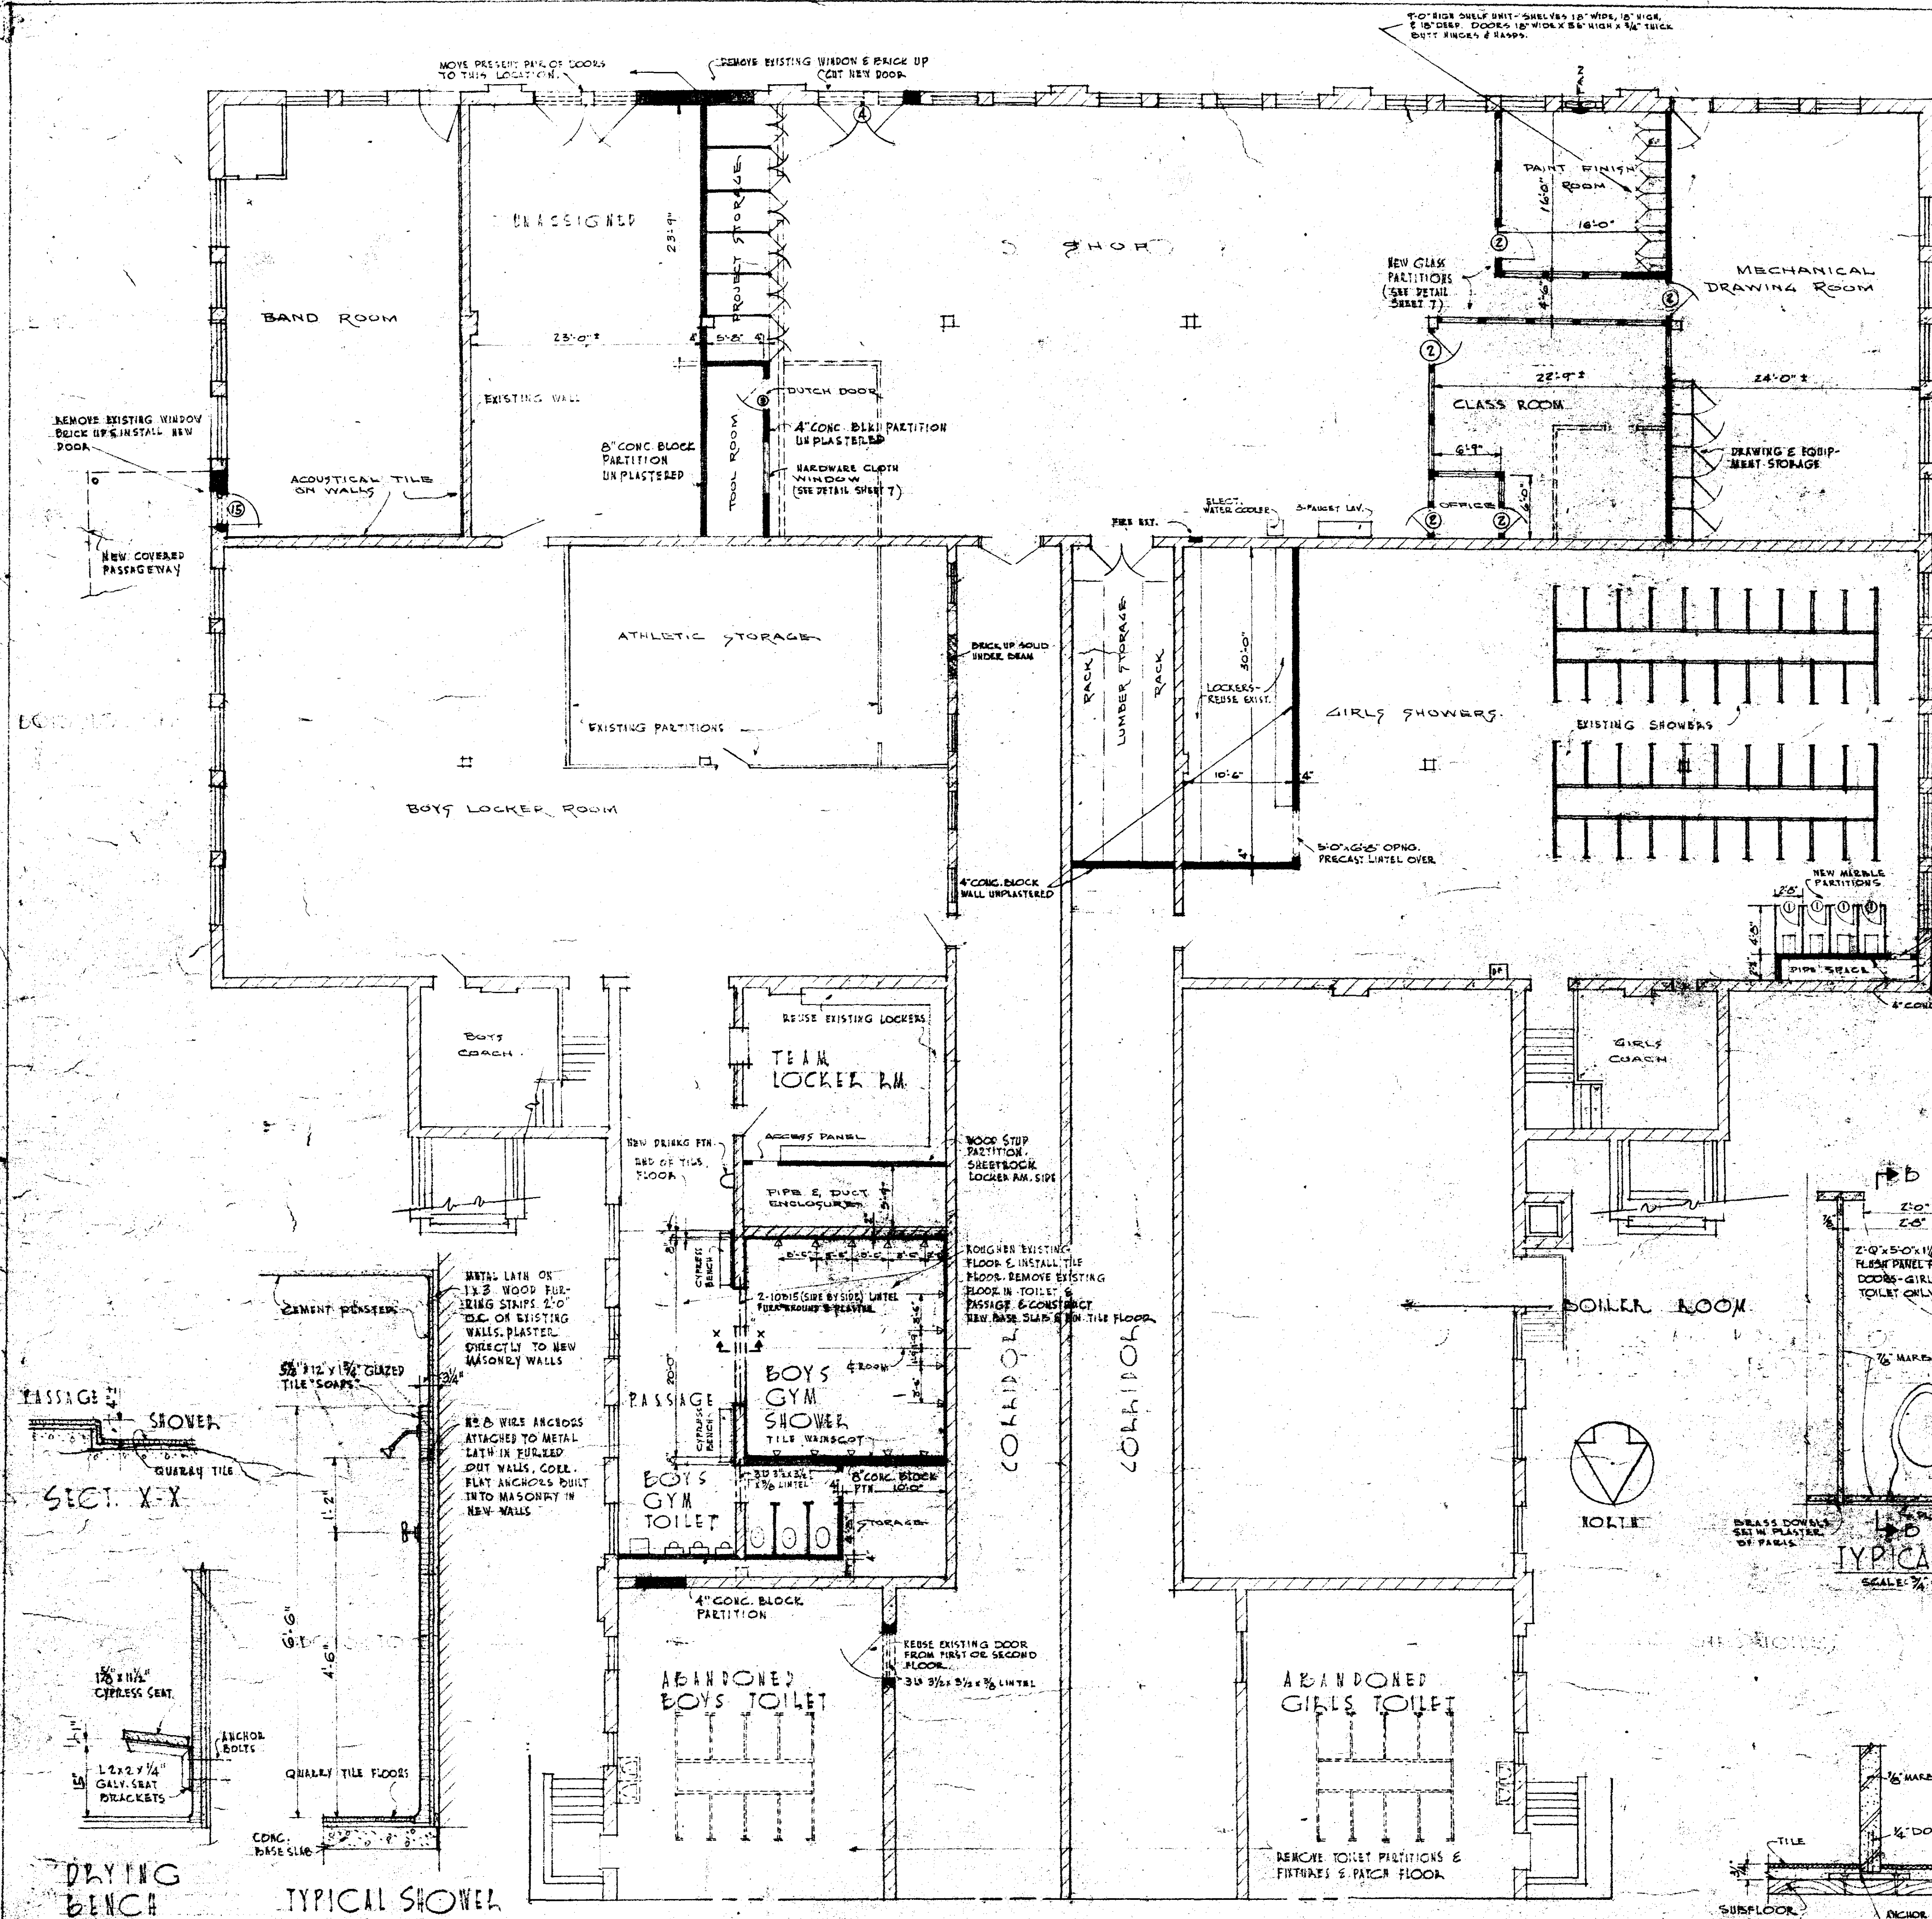

Mallott & Associates
Engineers & Architects
JOHN M. MATTINGLY, A.L.A. Architect
ATTORNEYS & ADDITIONS
LOCAL JUNIOR HIGH SCHOOL SECTION
BISSELL SOUTH SIDE
DRAWN BY: J. M. MATTINGLY
SHEET NO.

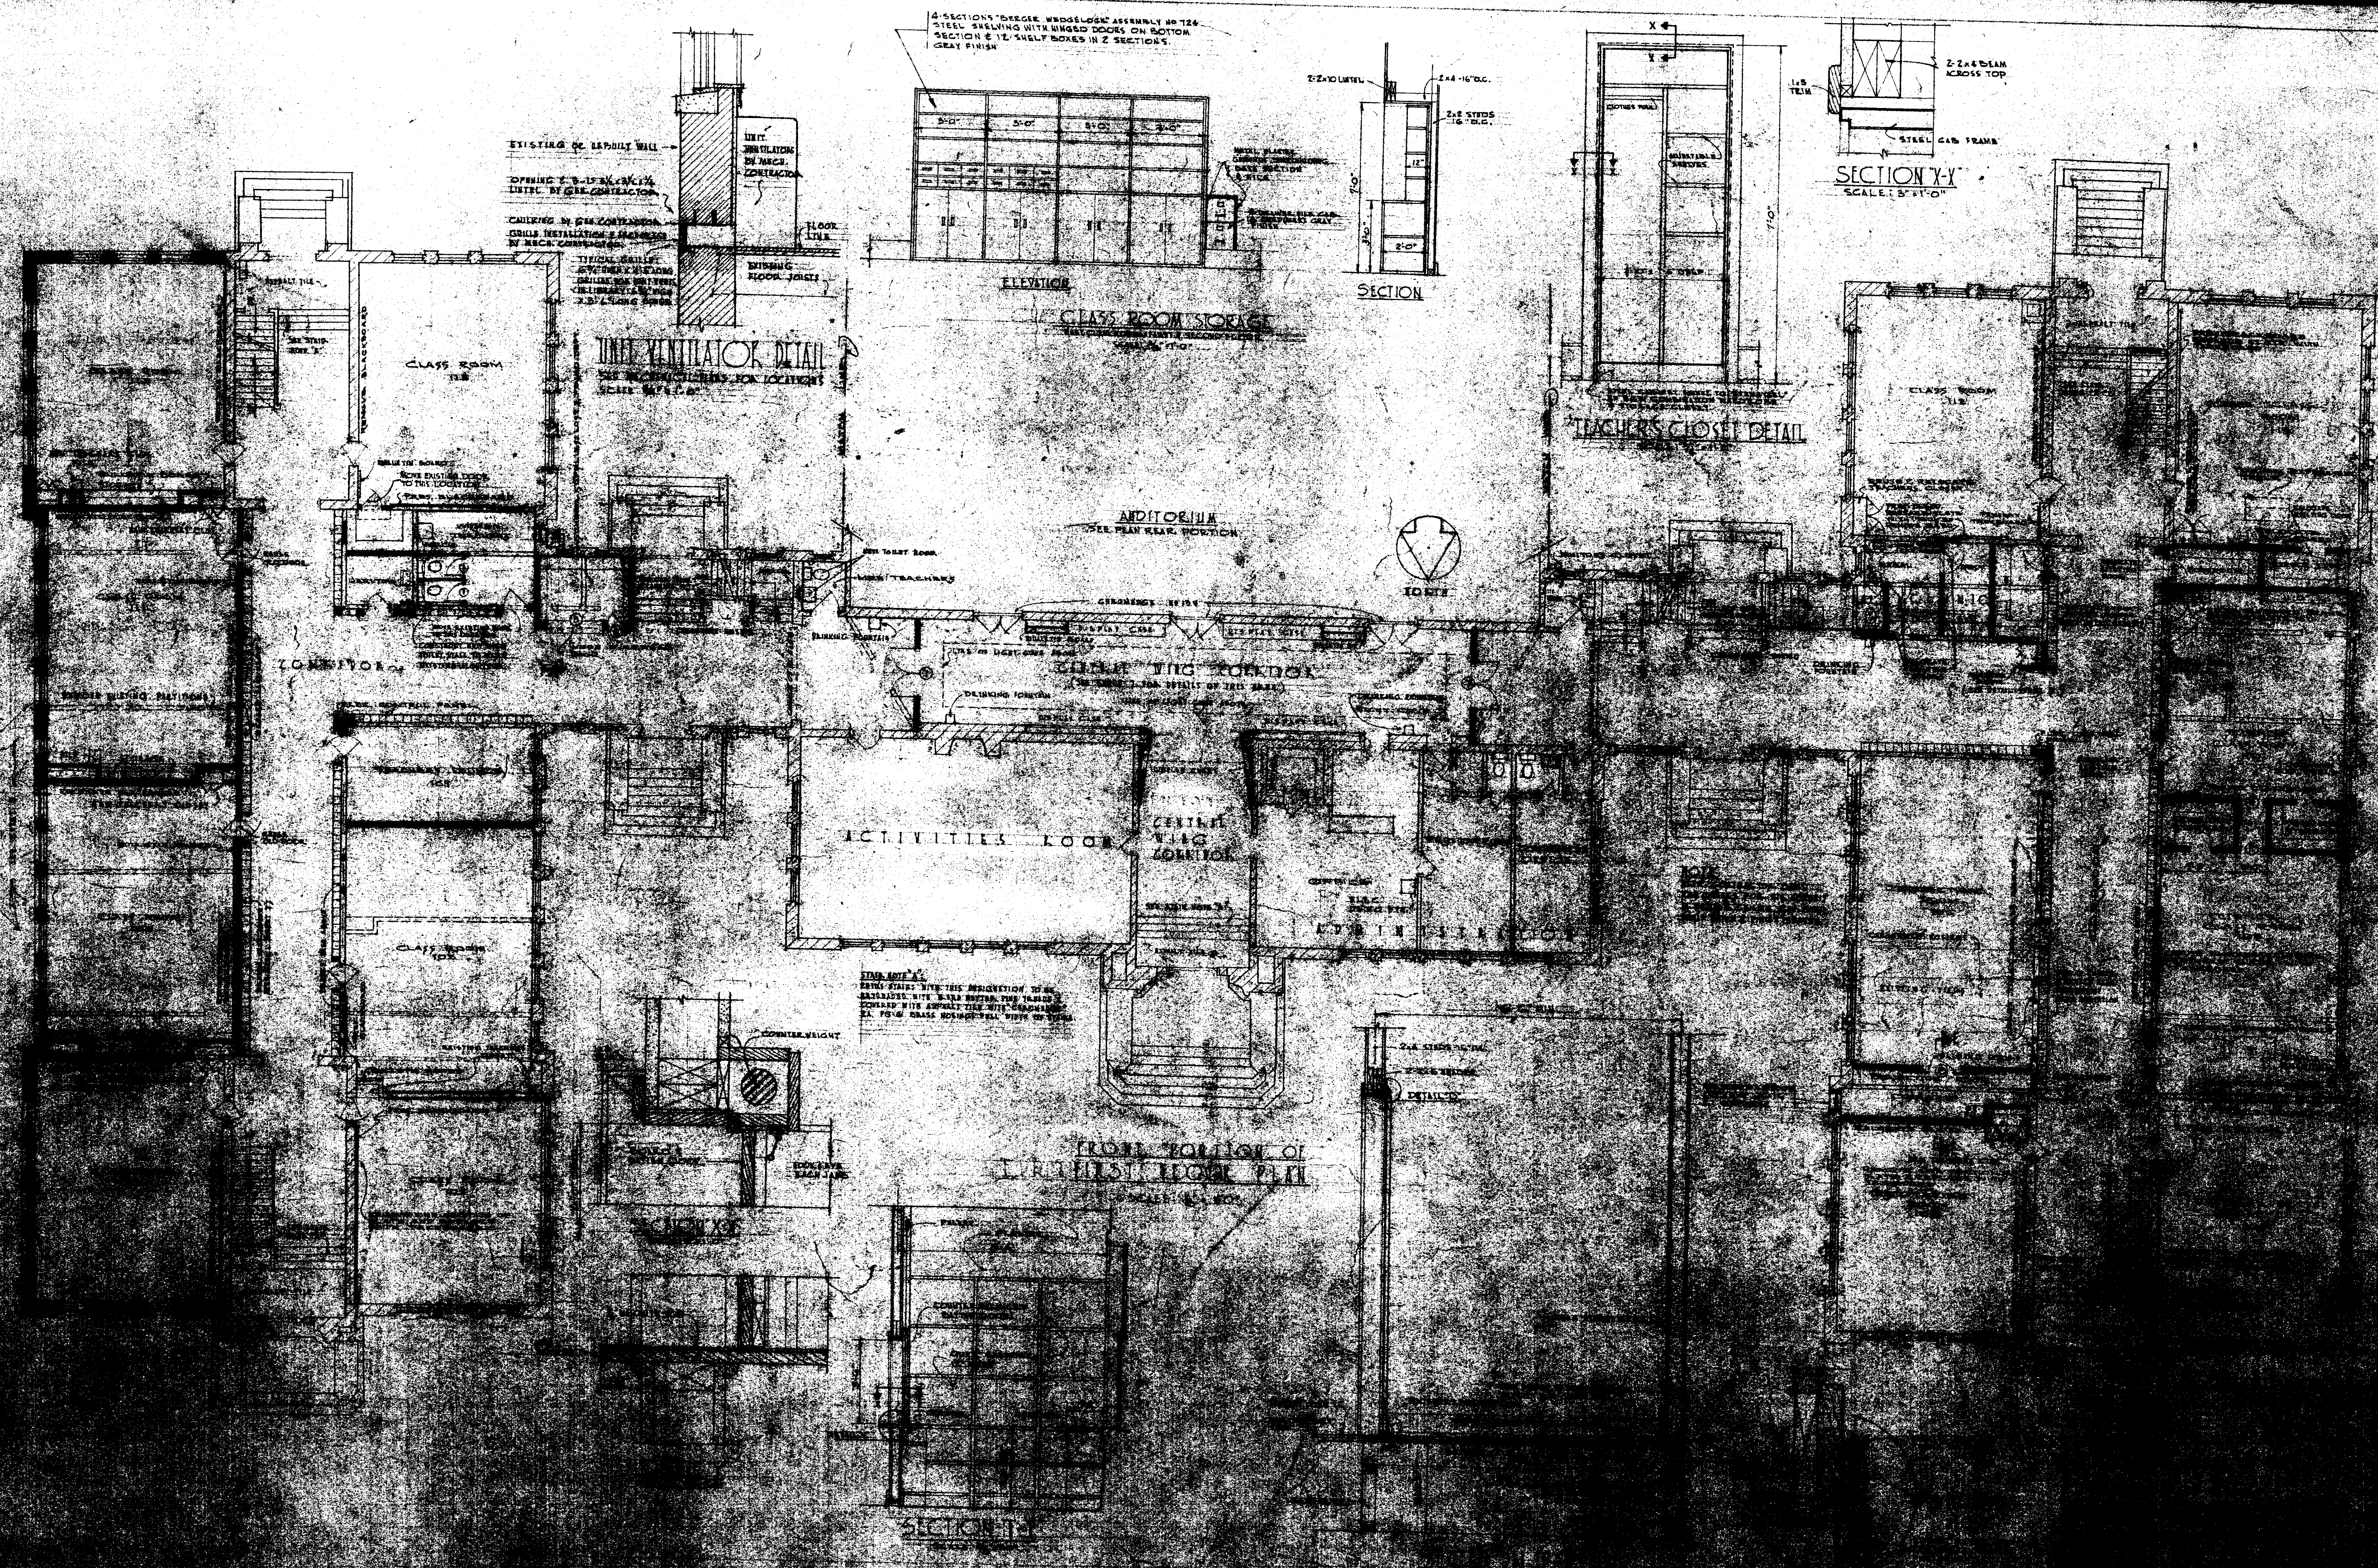

4-SECTIONS "BERGER WIDGES" ASSEMBLY NO 124
STEEL SKULLING WITH WINGED DOORS ON BOTTOM
SECTION & 1/2-SHELF BOXES IN 2 SECTIONS
GRAY FINISH

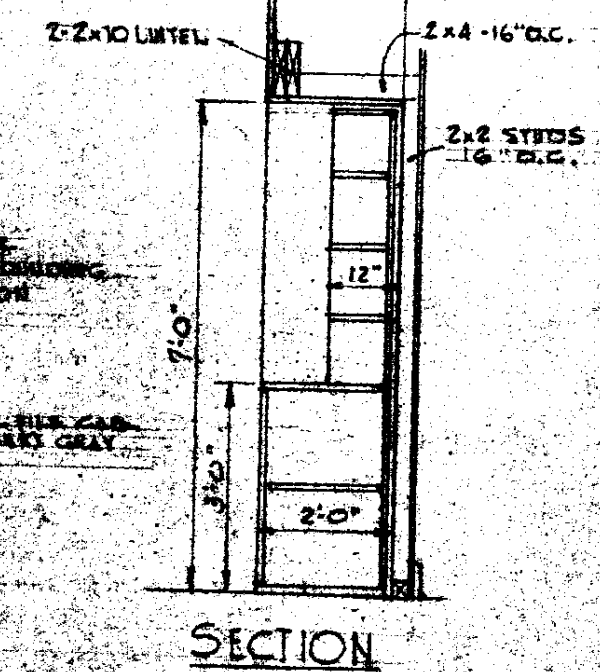


SECTION Y-Y
SCALE: 3/4"=1'-0"

ELEVATION
CLASS ROOM STORAGE
SCALE: 3/4"=1'-0"

TEACHERS CLOSET DETAIL
SCALE: 3/4"=1'-0"





AUDITORIUM
SEE PLAN REAR PORTION

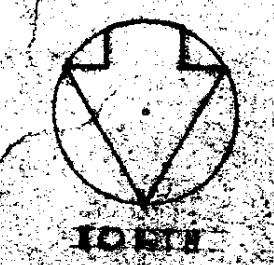

ACTIVITY ROOM
SCALE: 3/4"=1'-0"

FRONT PORTION OF
ACTIVITY ROOM PLAN
SCALE: 3/4"=1'-0"

SECTION Y-Y
SCALE: 3/4"=1'-0"

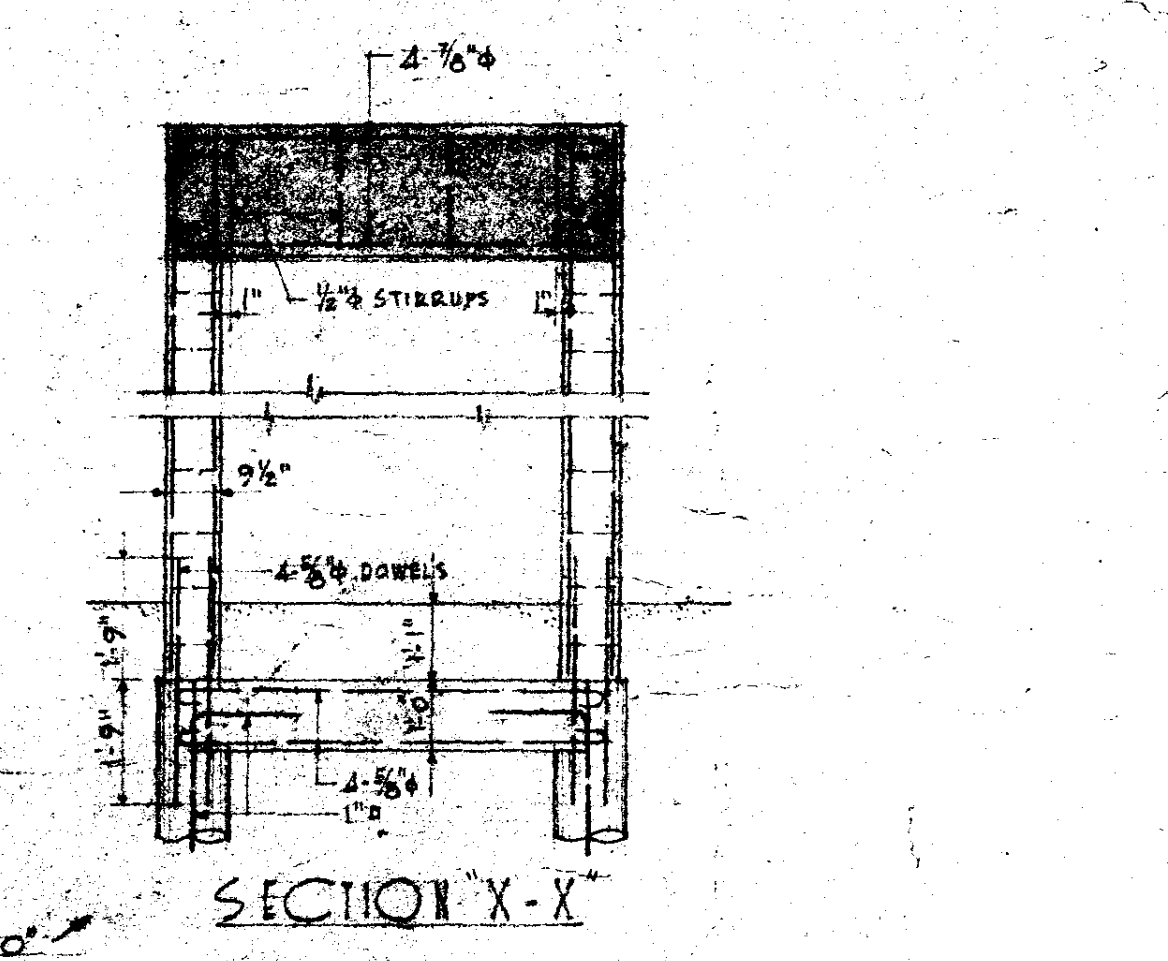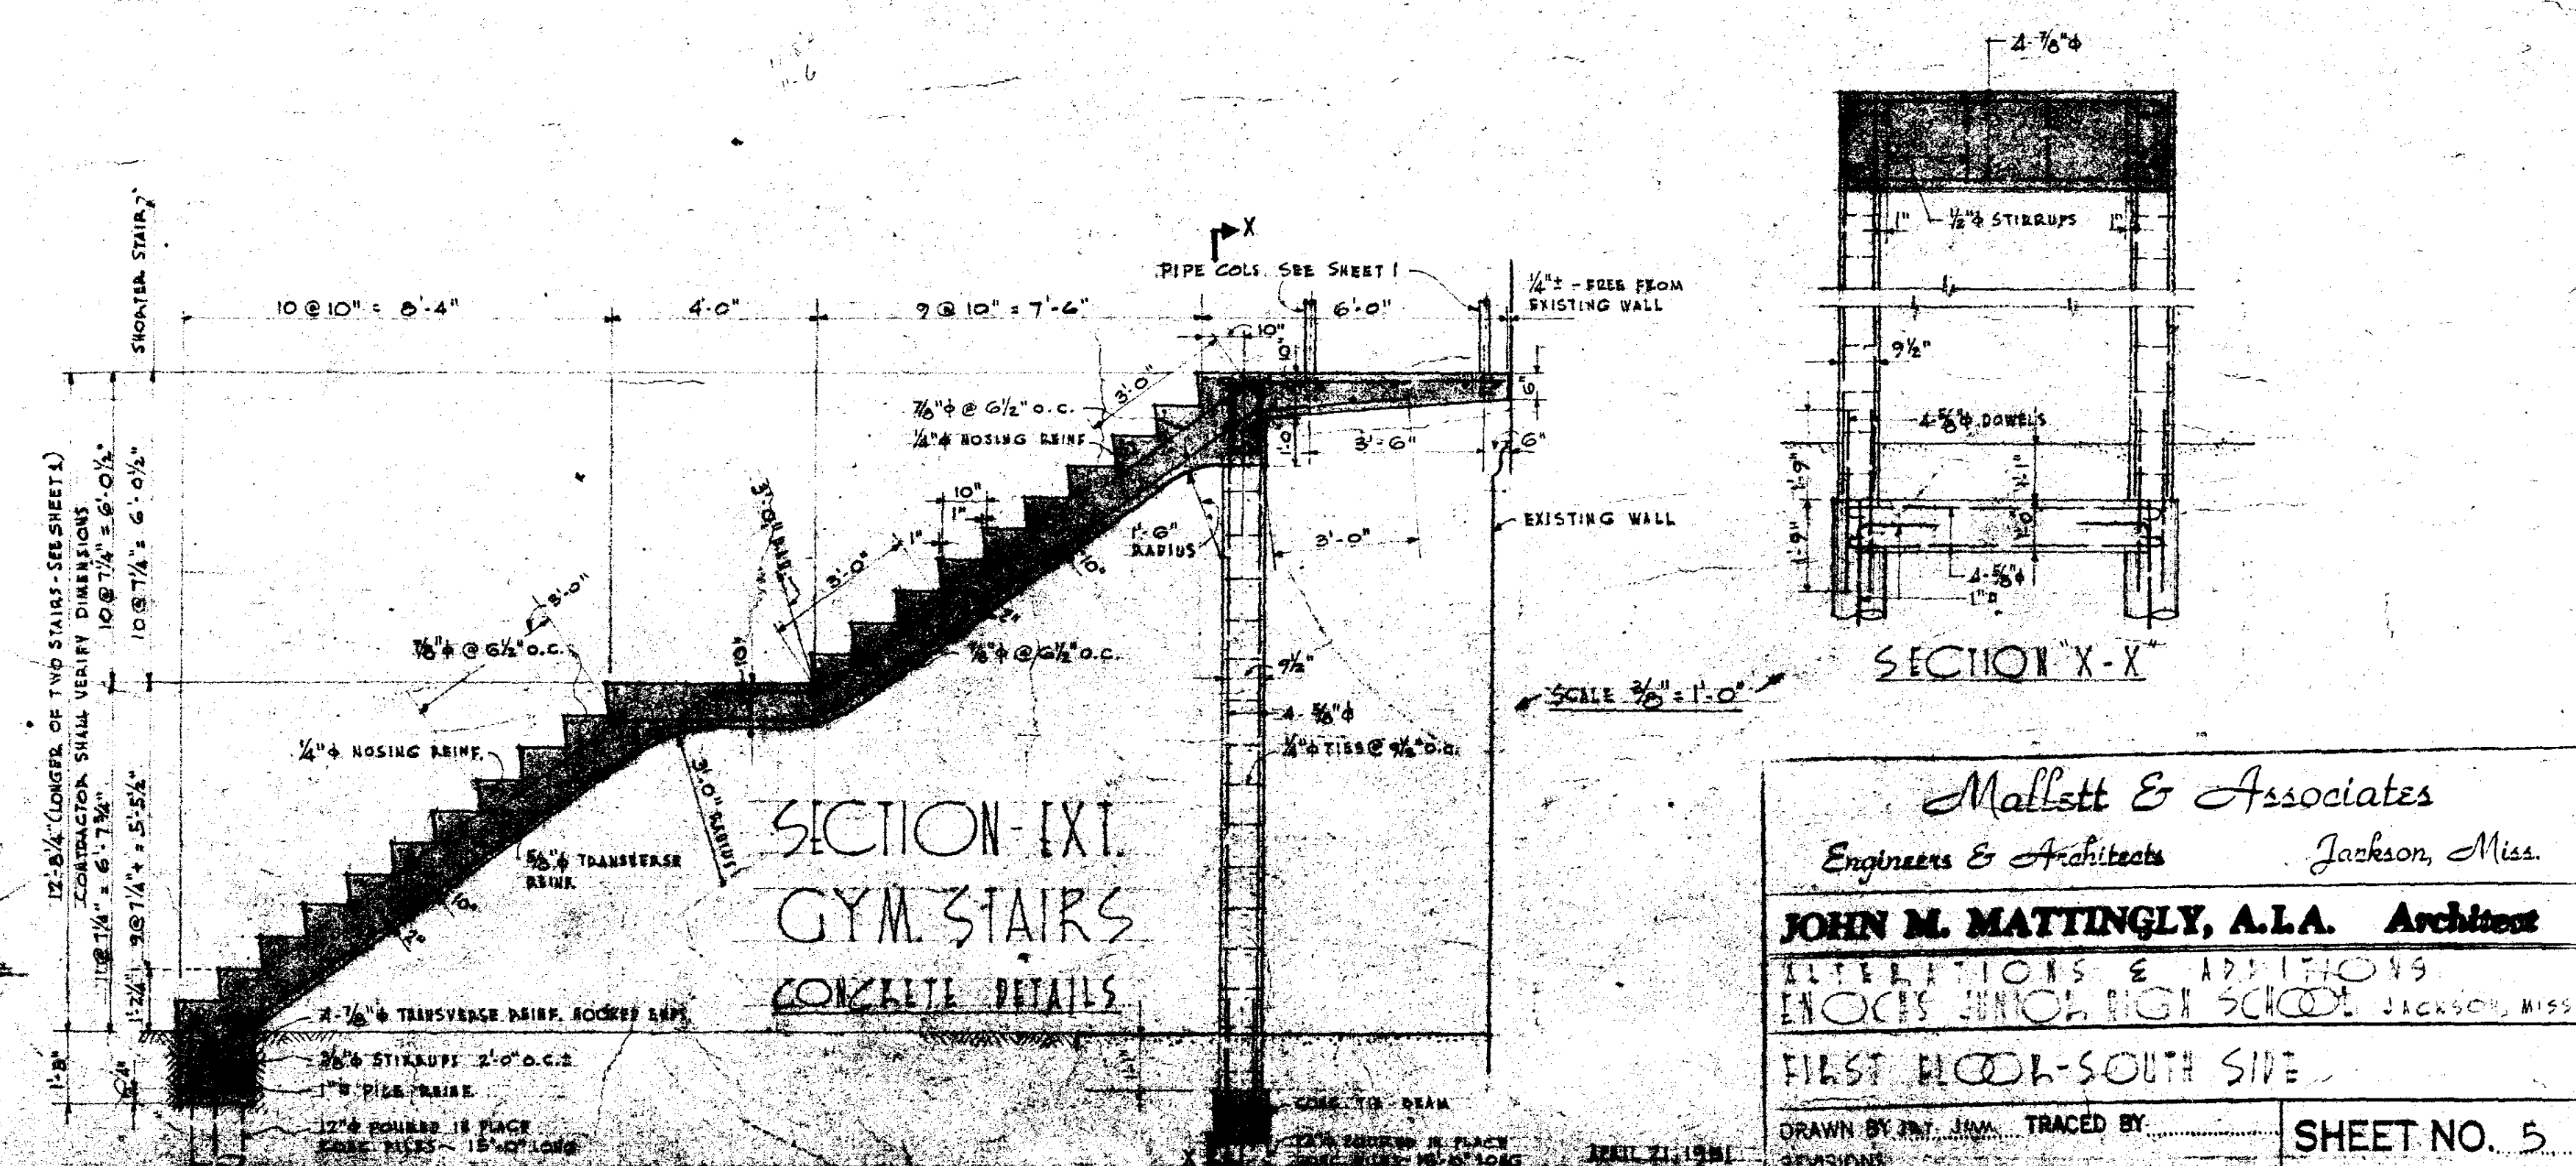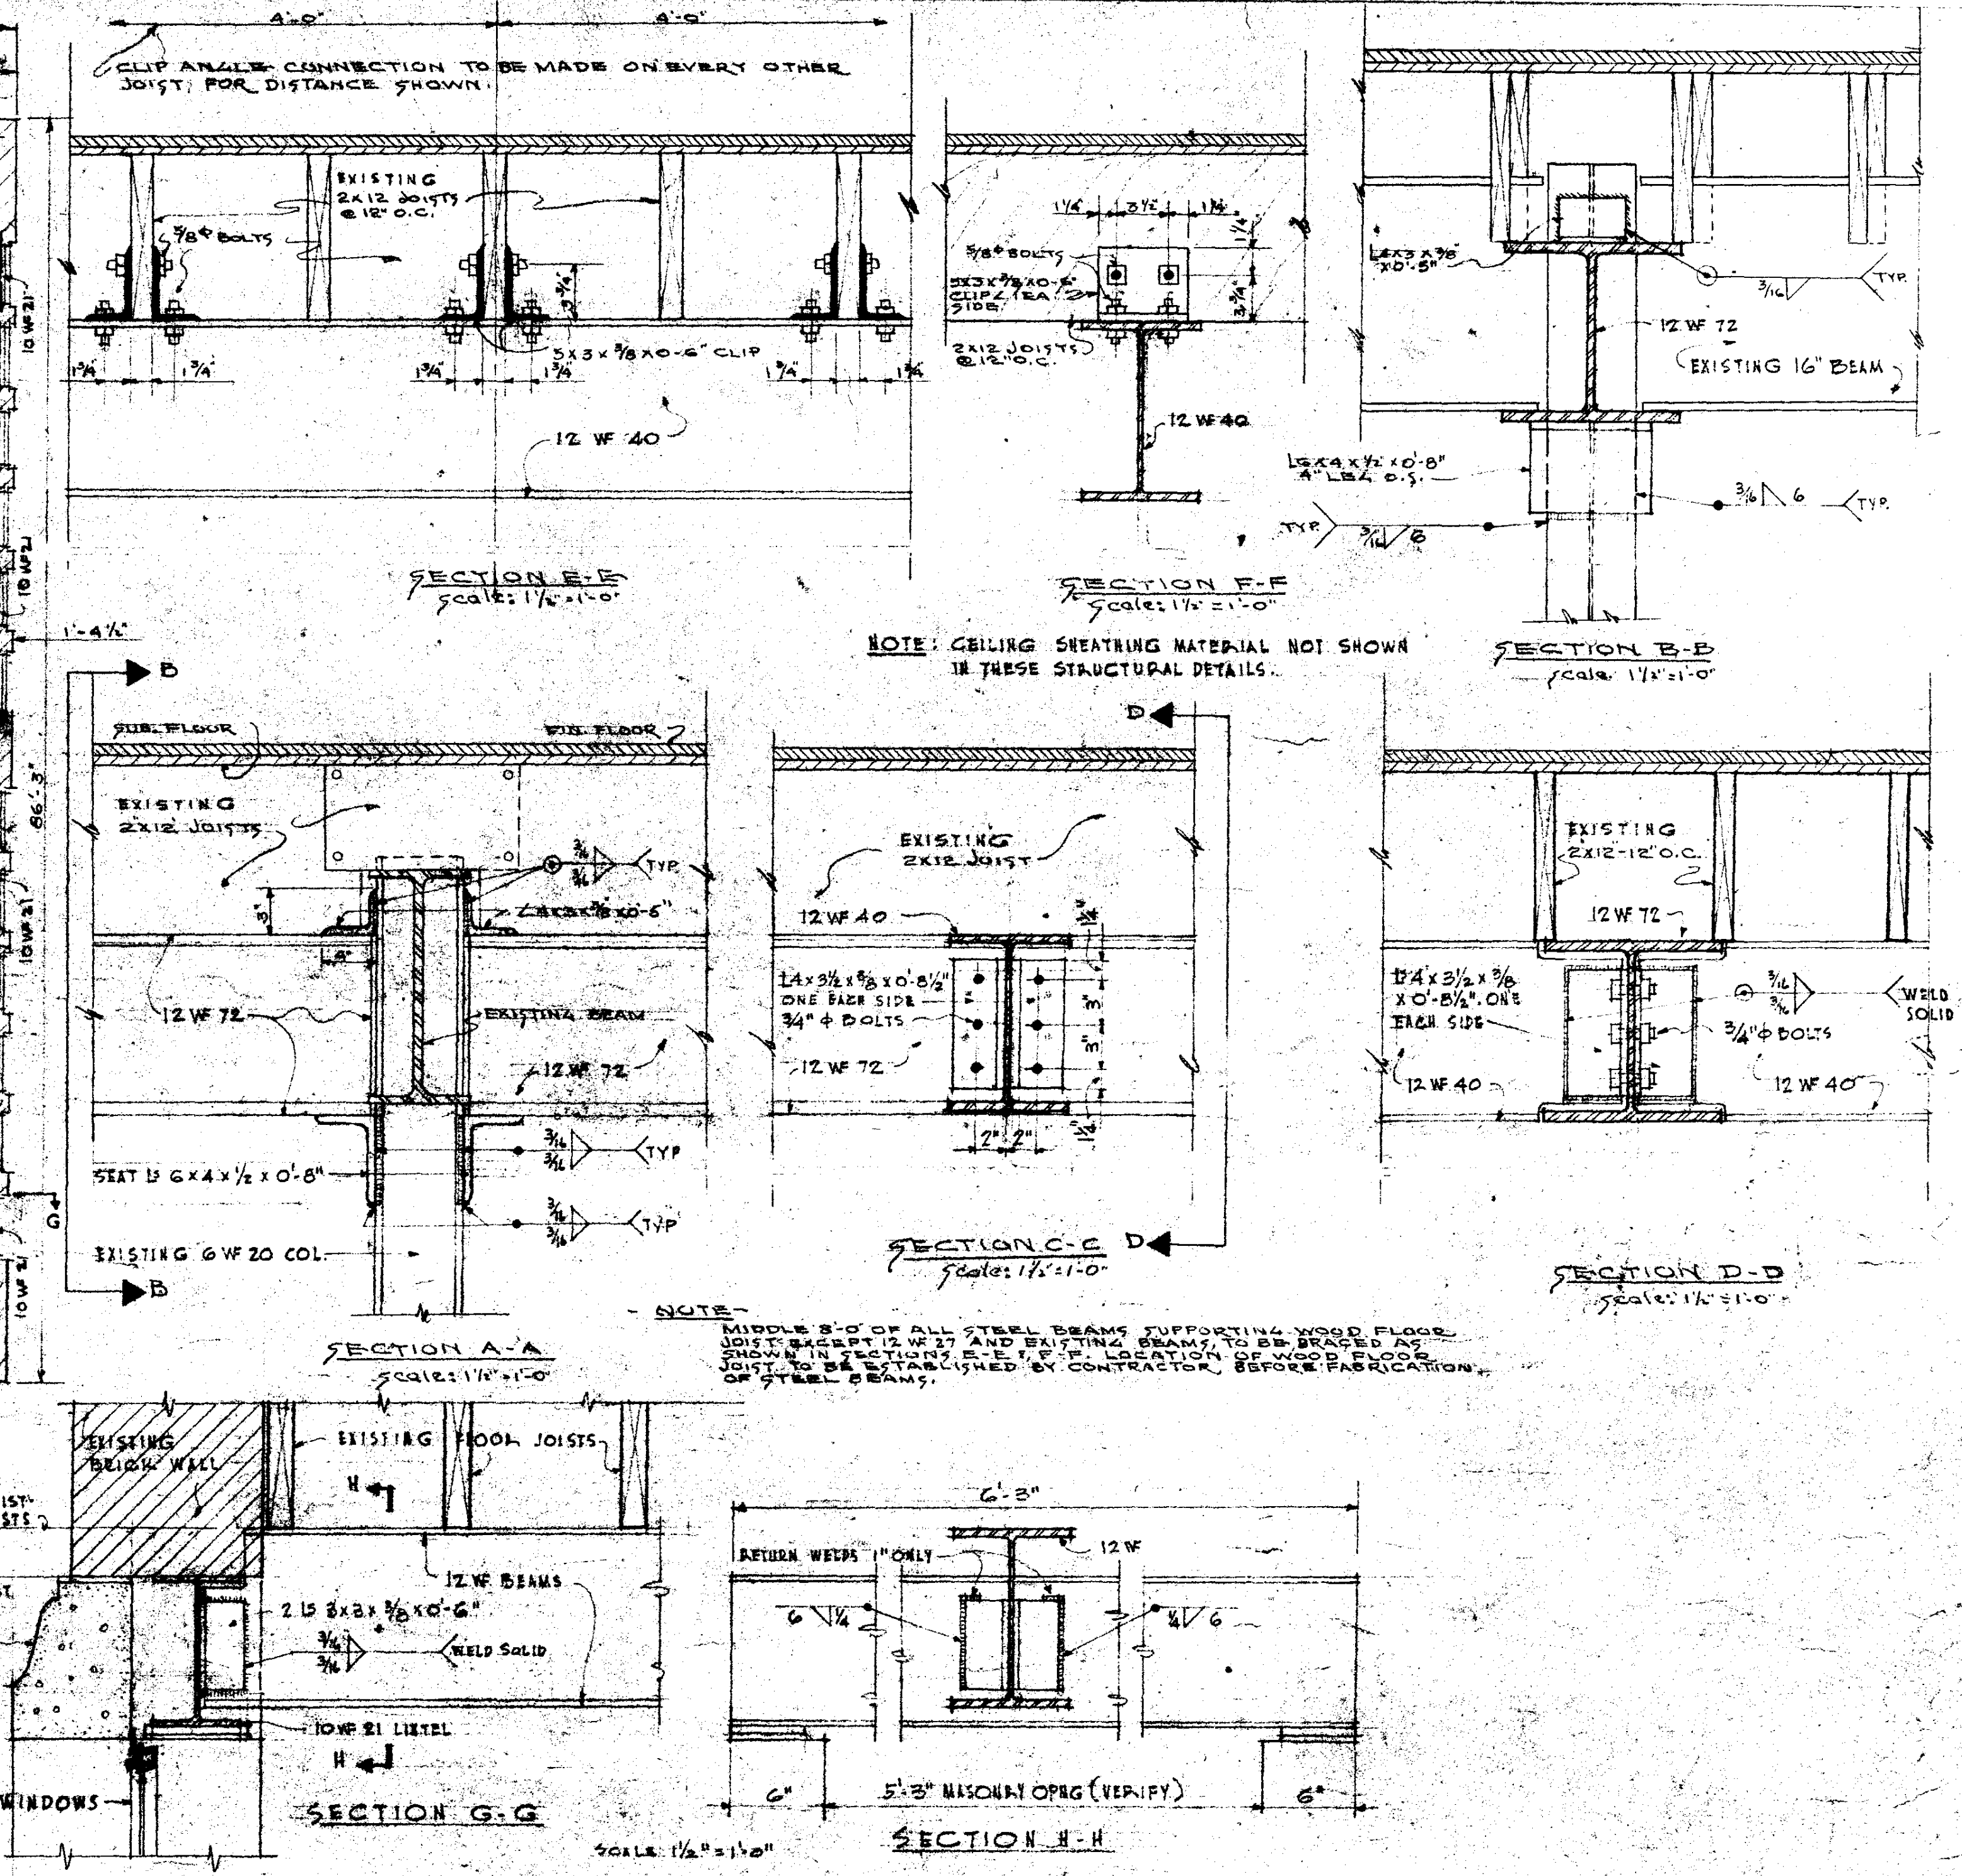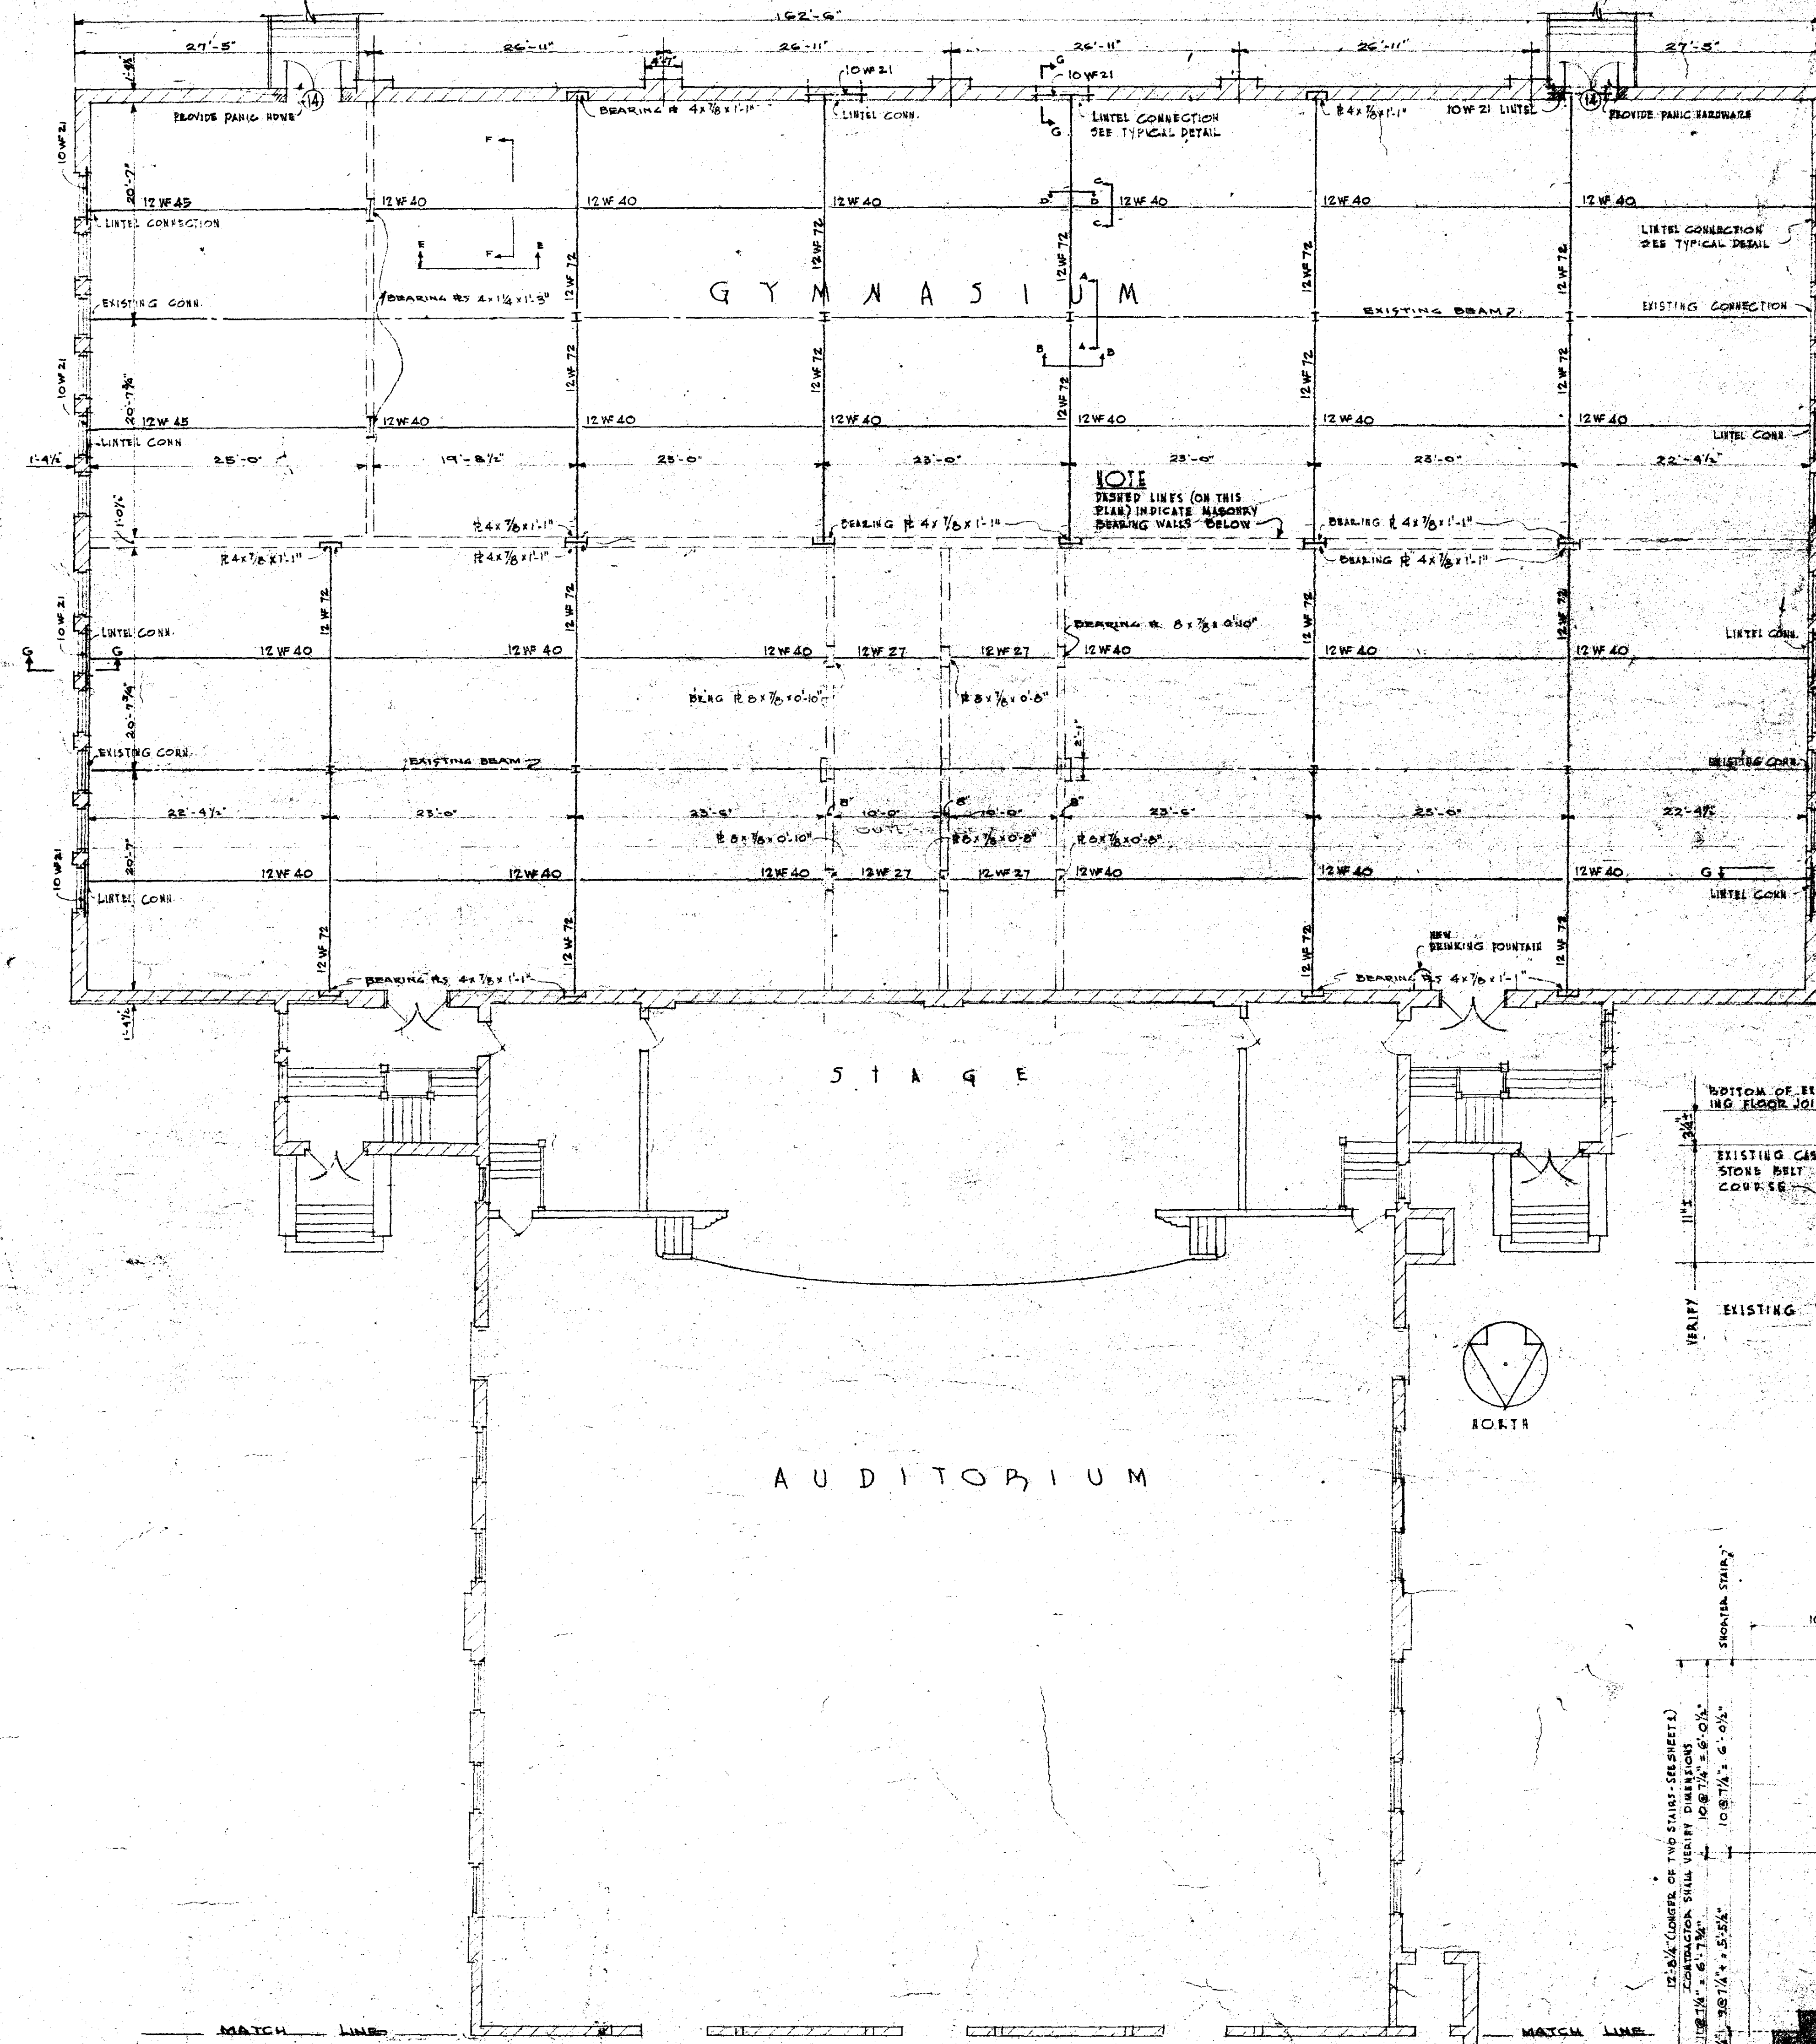

Mallott & Associates
Engineers & Architects
Jackson, Miss.


JOHN M. MATTINGLY, A.L.A. Architect

ALTERATIONS & ADDITIONS
INWOOD JUNIOR HIGH SCHOOL JACKSON, MISS.


FIRST FLOOR - SOUTH SIDE

DRAWN BY: J.M.M. TRACED BY: J.M.M.


SHEET NO. 5

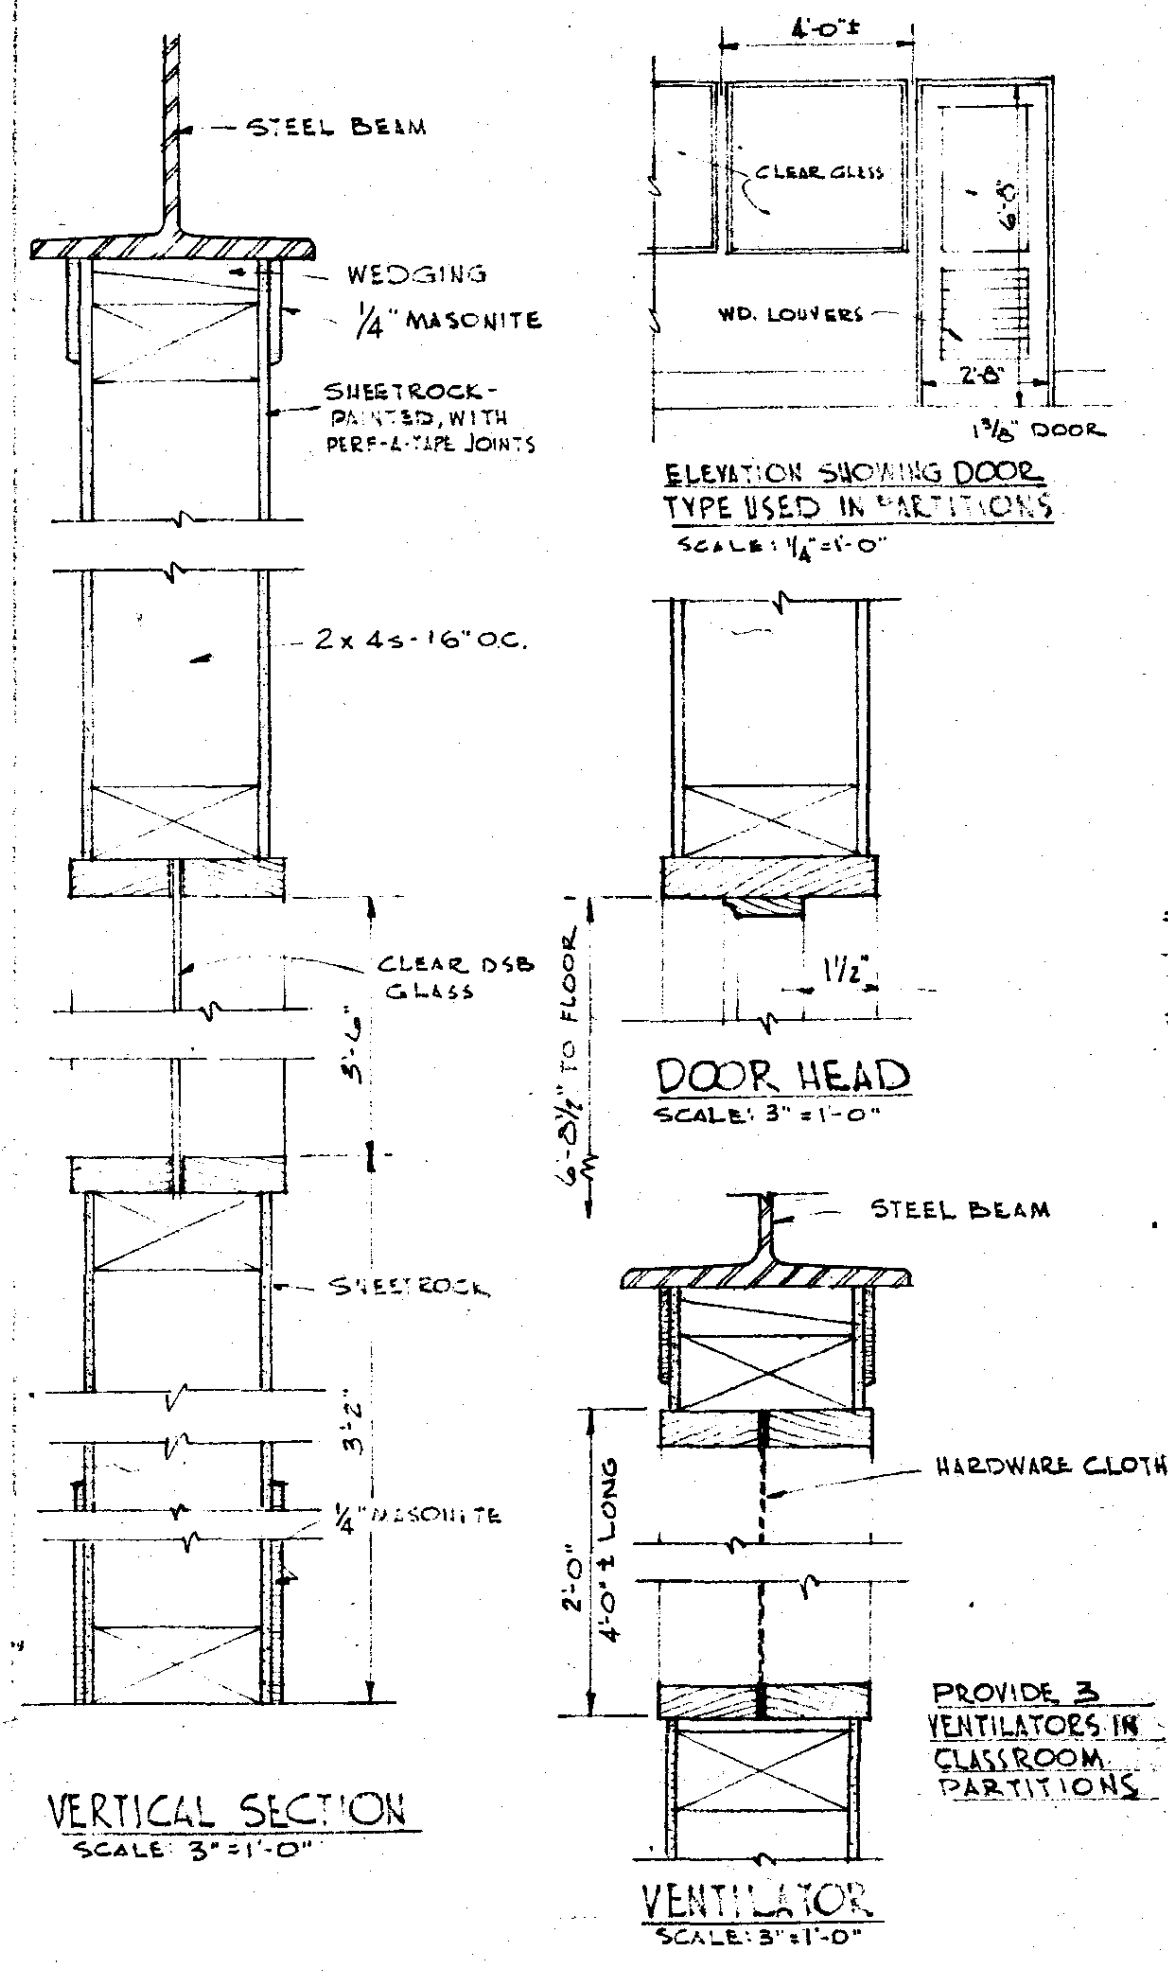


GLASS PARTITIONS IN SHOP
SCALE: AS NOTED

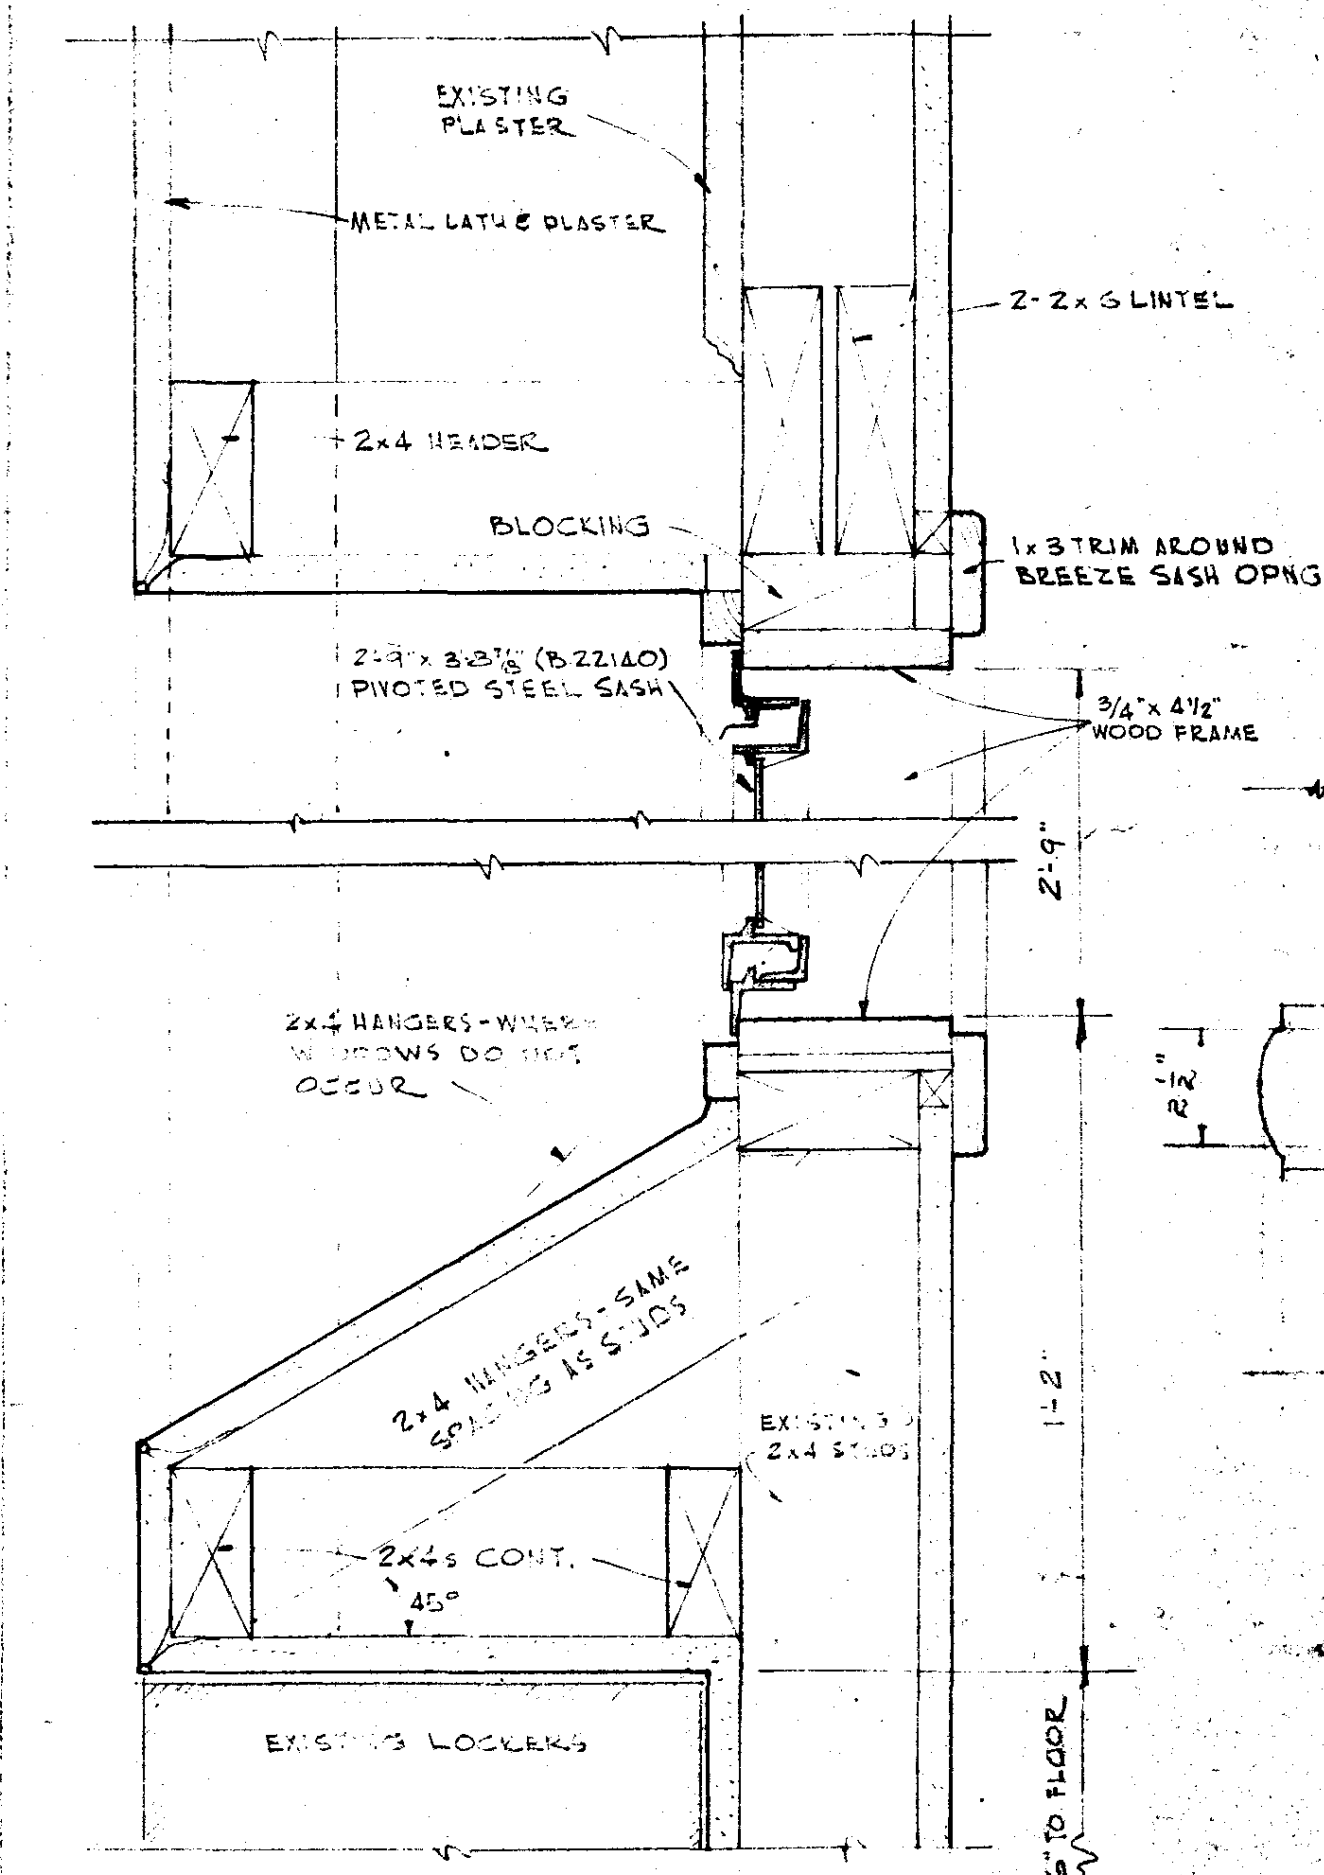


SECTION THRU BREEZE SASH
TWO PER INSIDE CLASSROOM
SCALE: 3/4" = 1'-0"

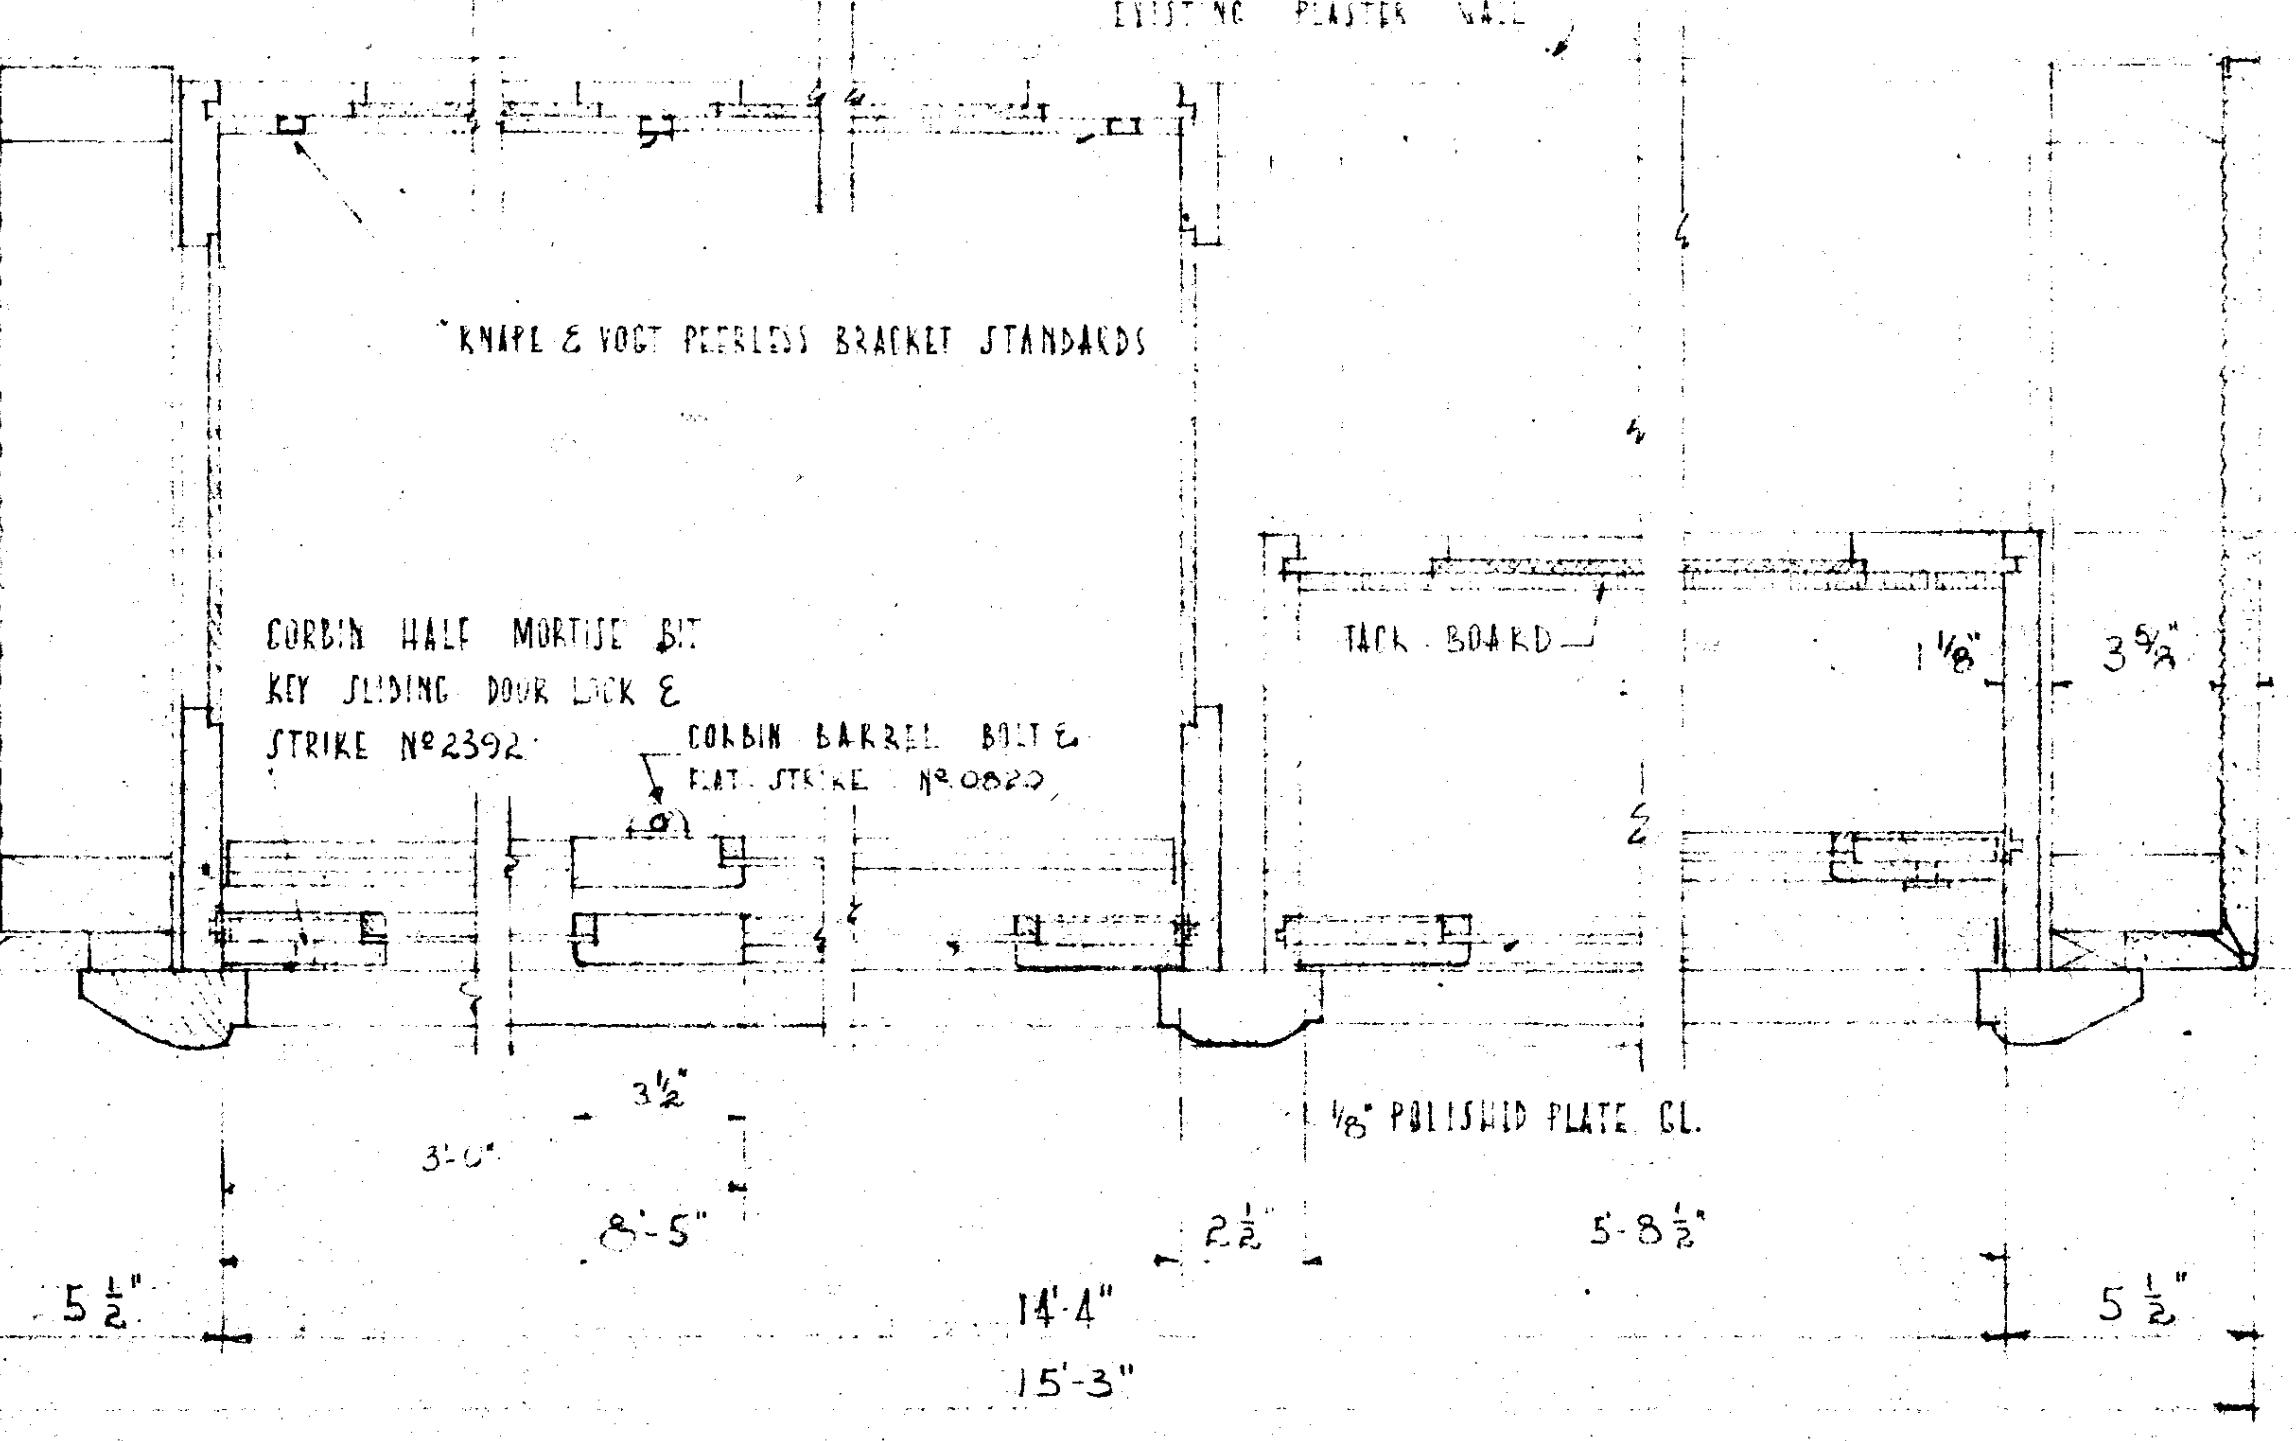


SECTION E-E
SCALE: 3" = 1'-0"

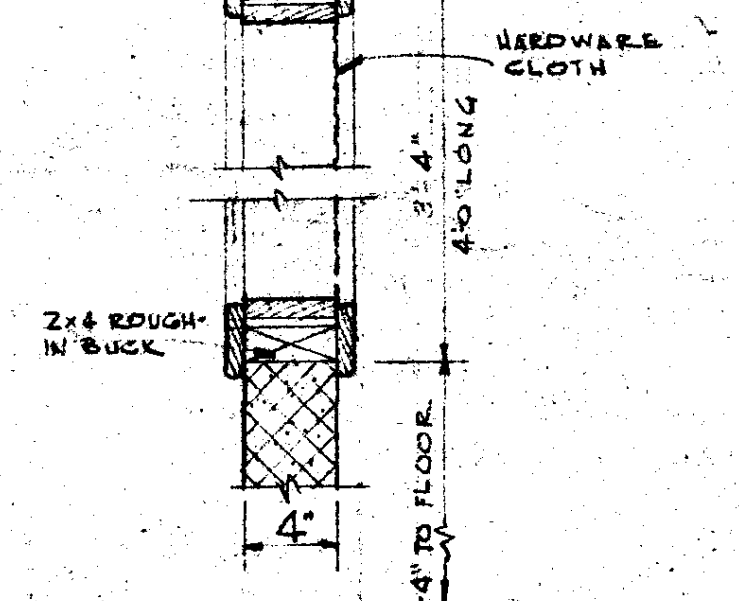



DETAIL TOOL ROOM WINDOW
SCALE: 1/4" = 1'-0"

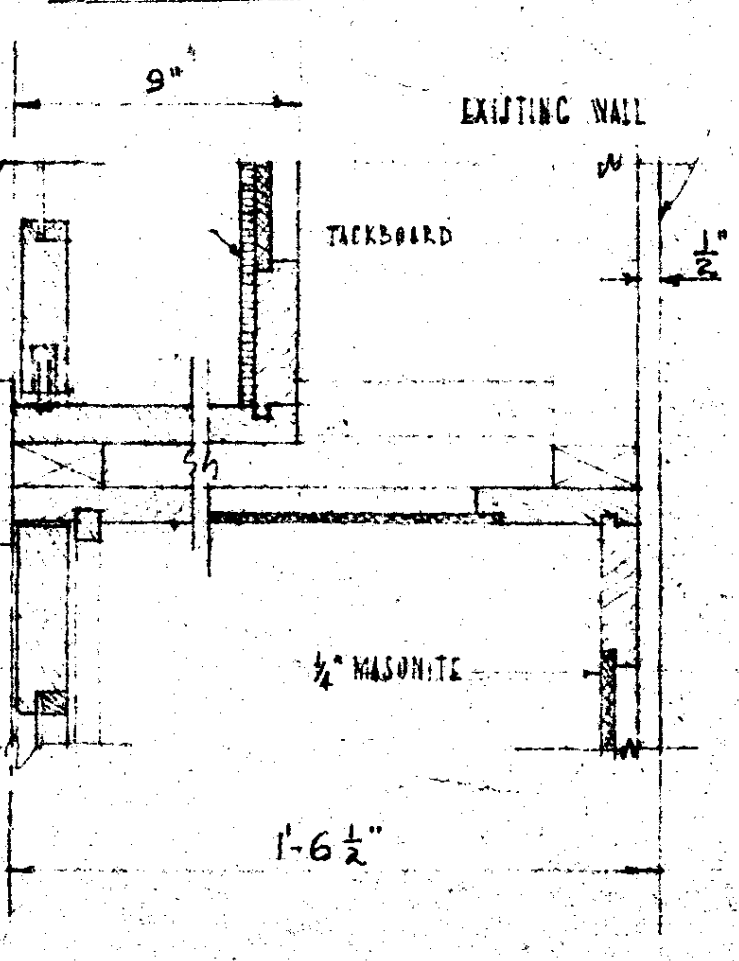


SECTION F-F
SCALE: 3" = 1'-0"

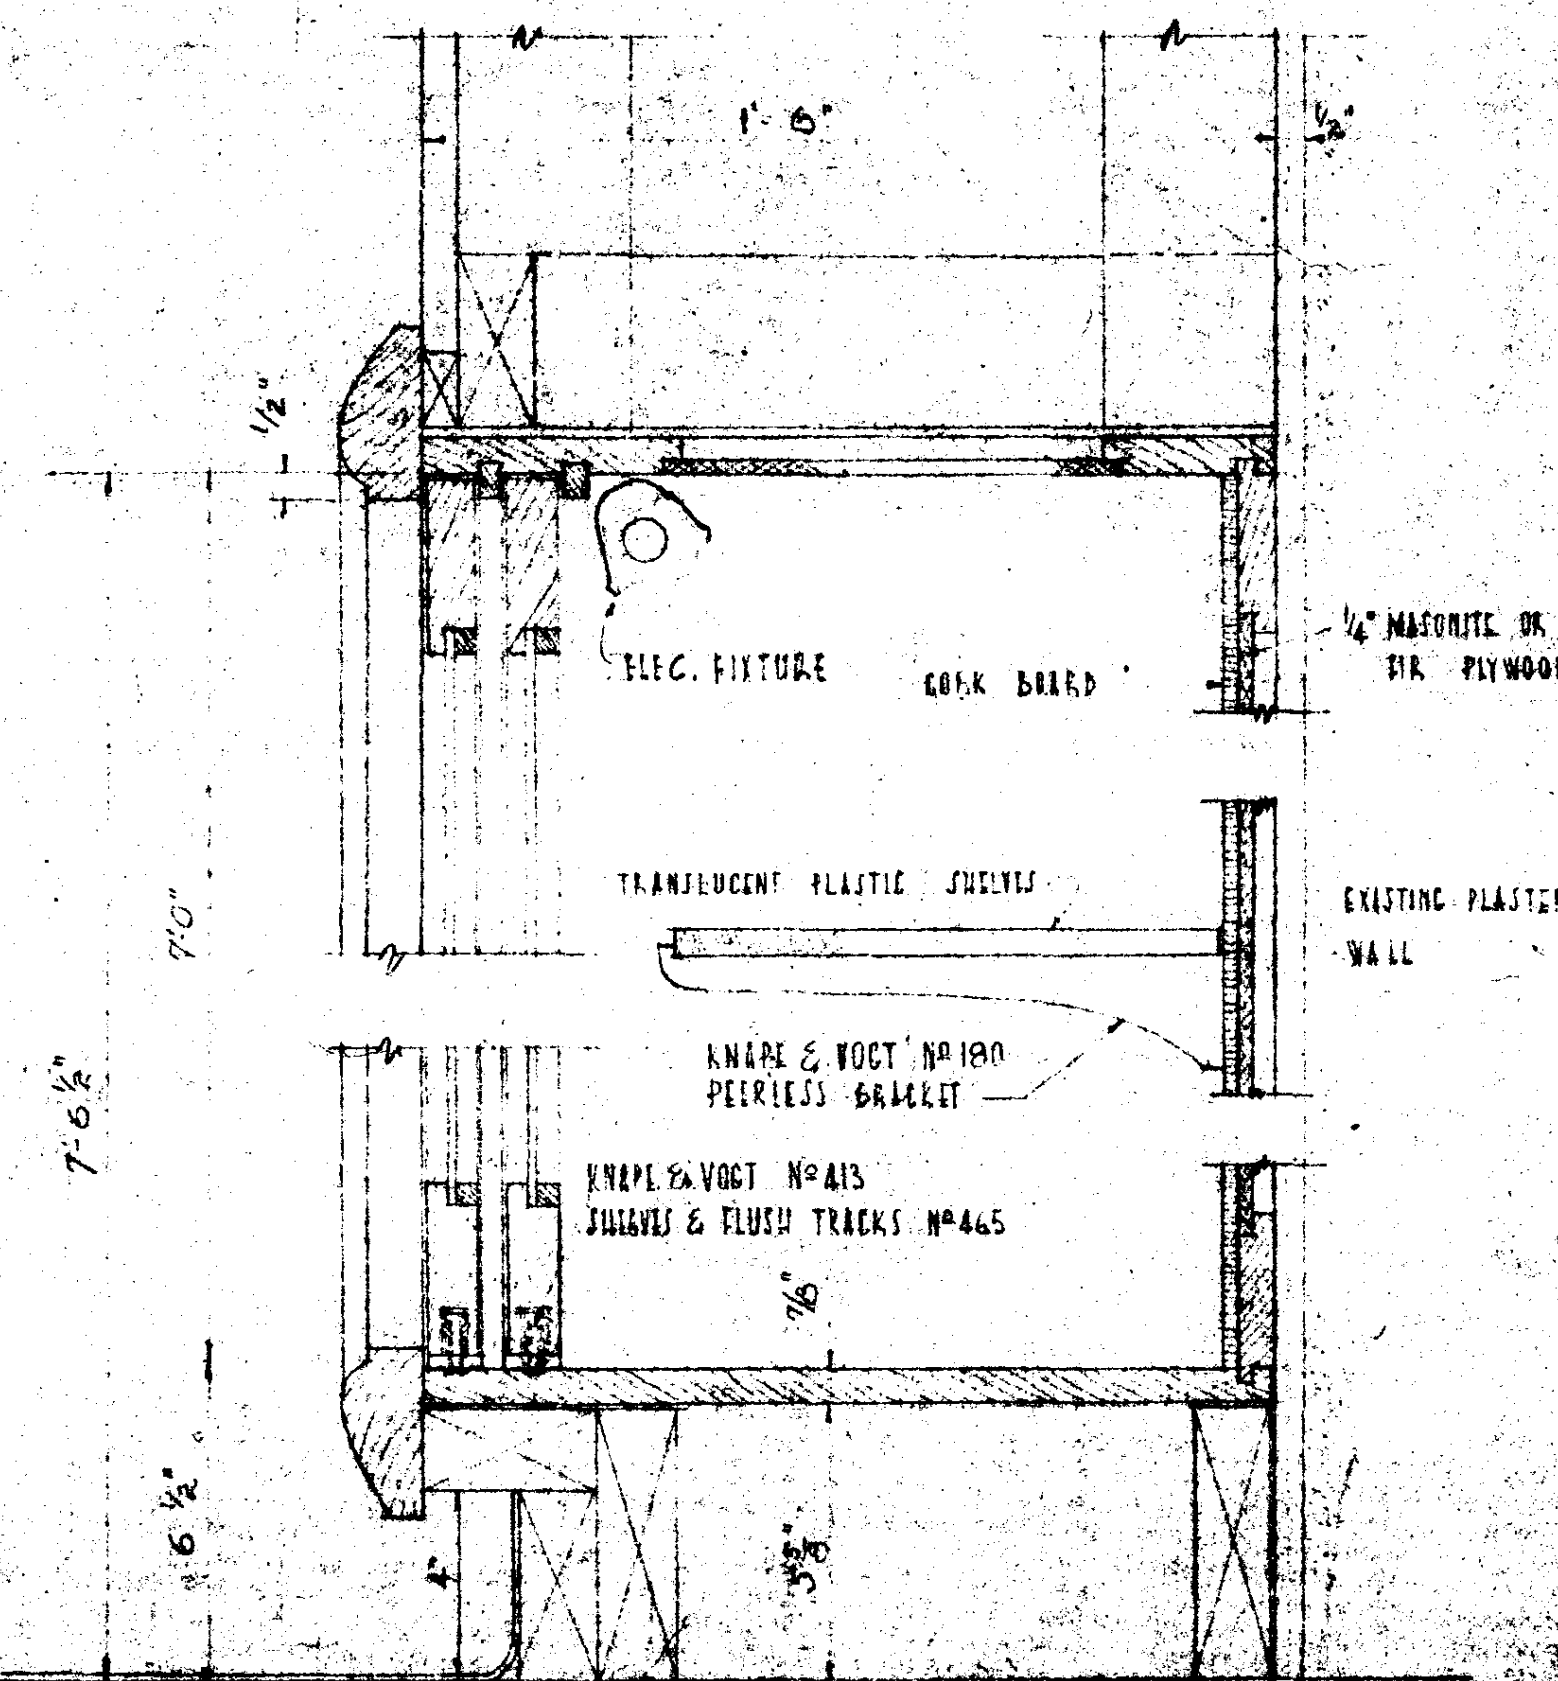




SECTION D-D
SCALE: 3" = 1'-0"

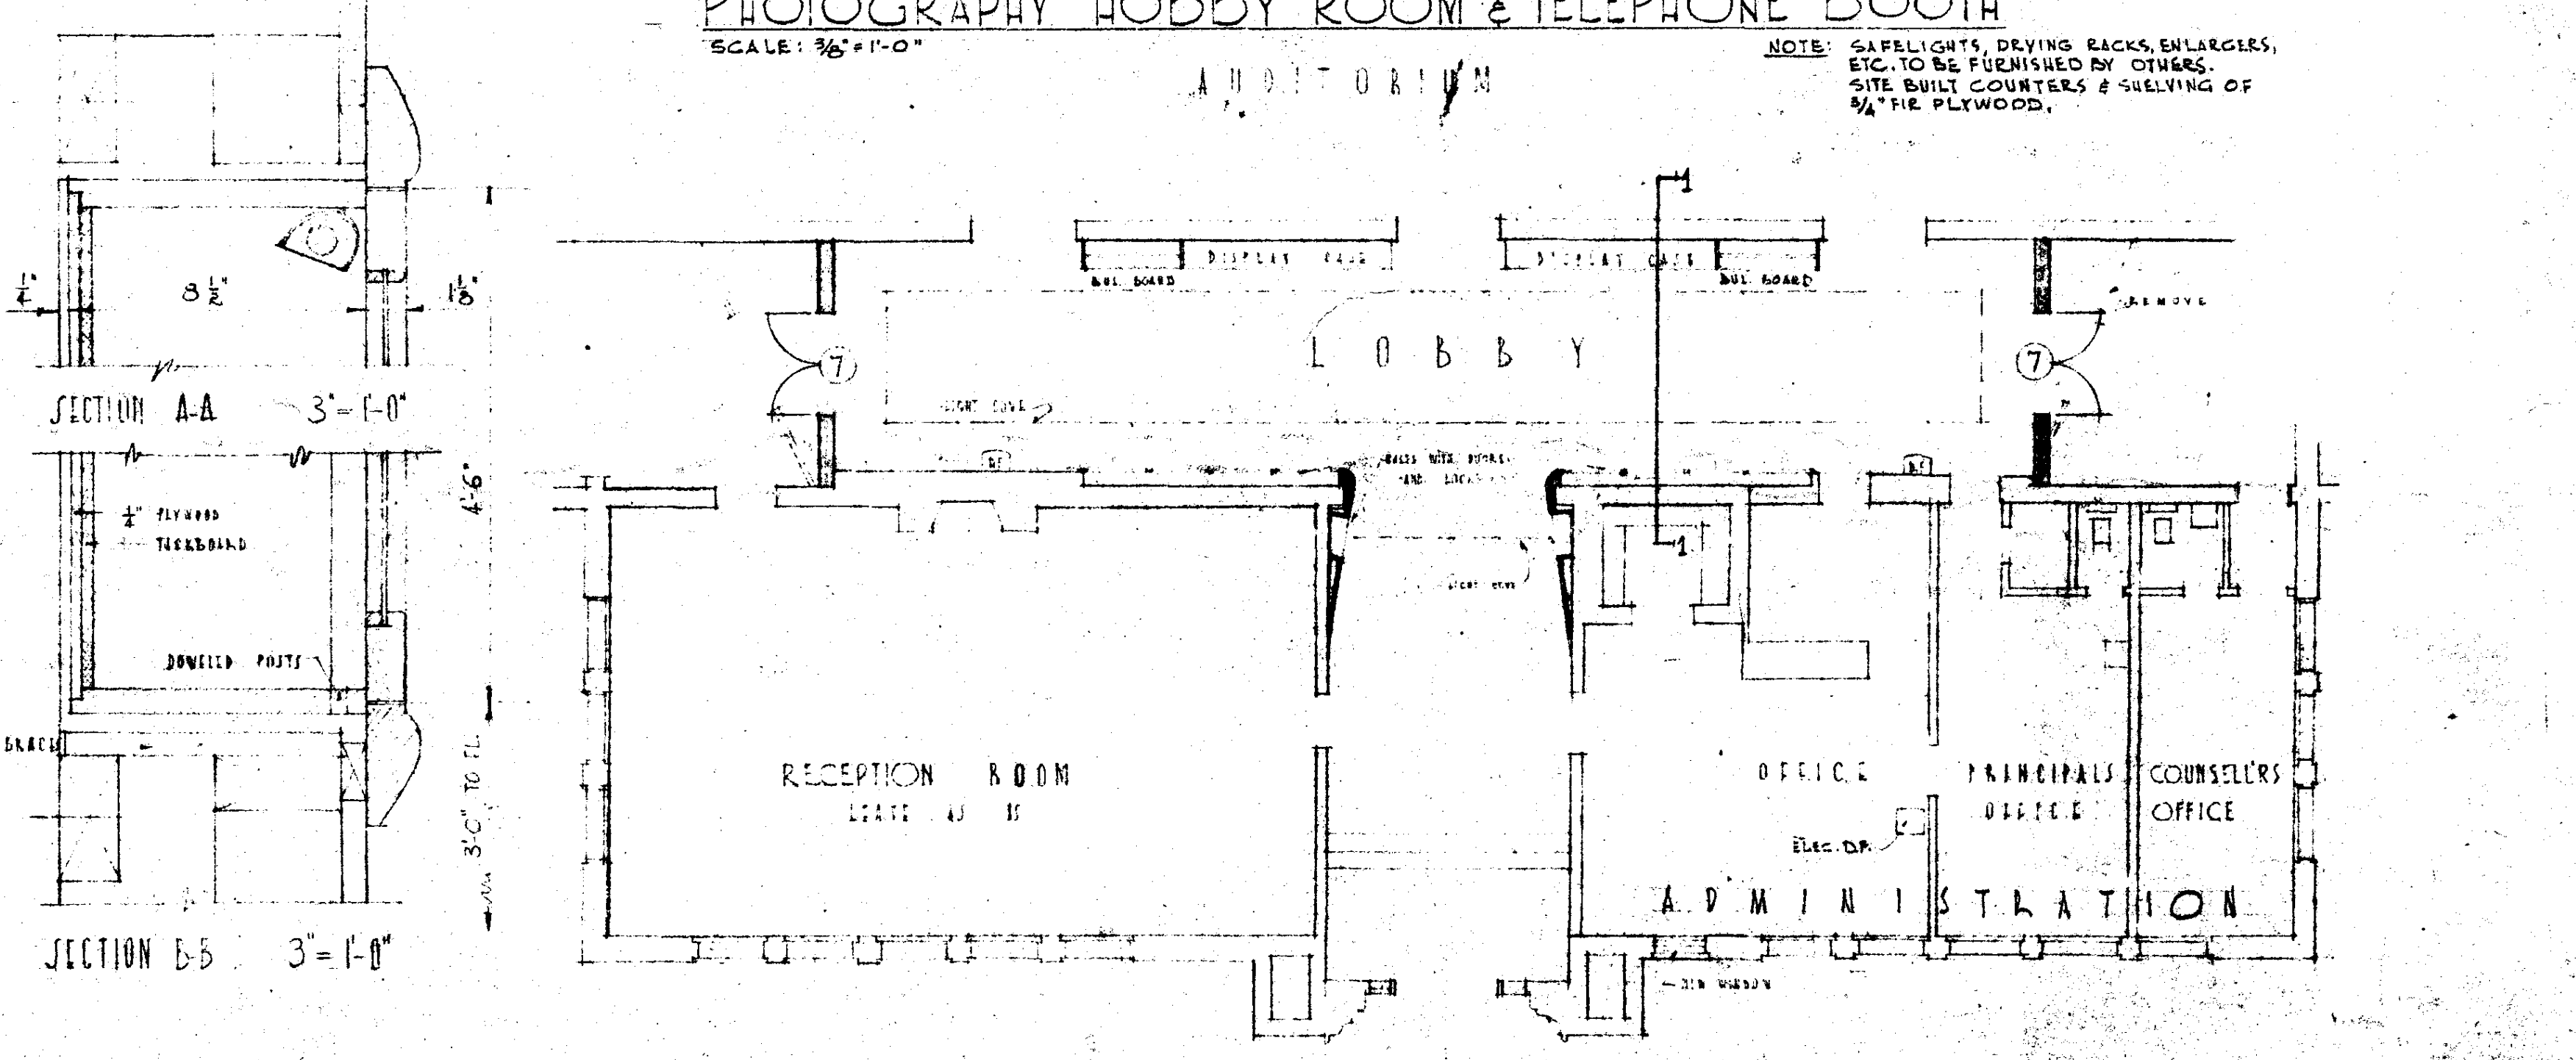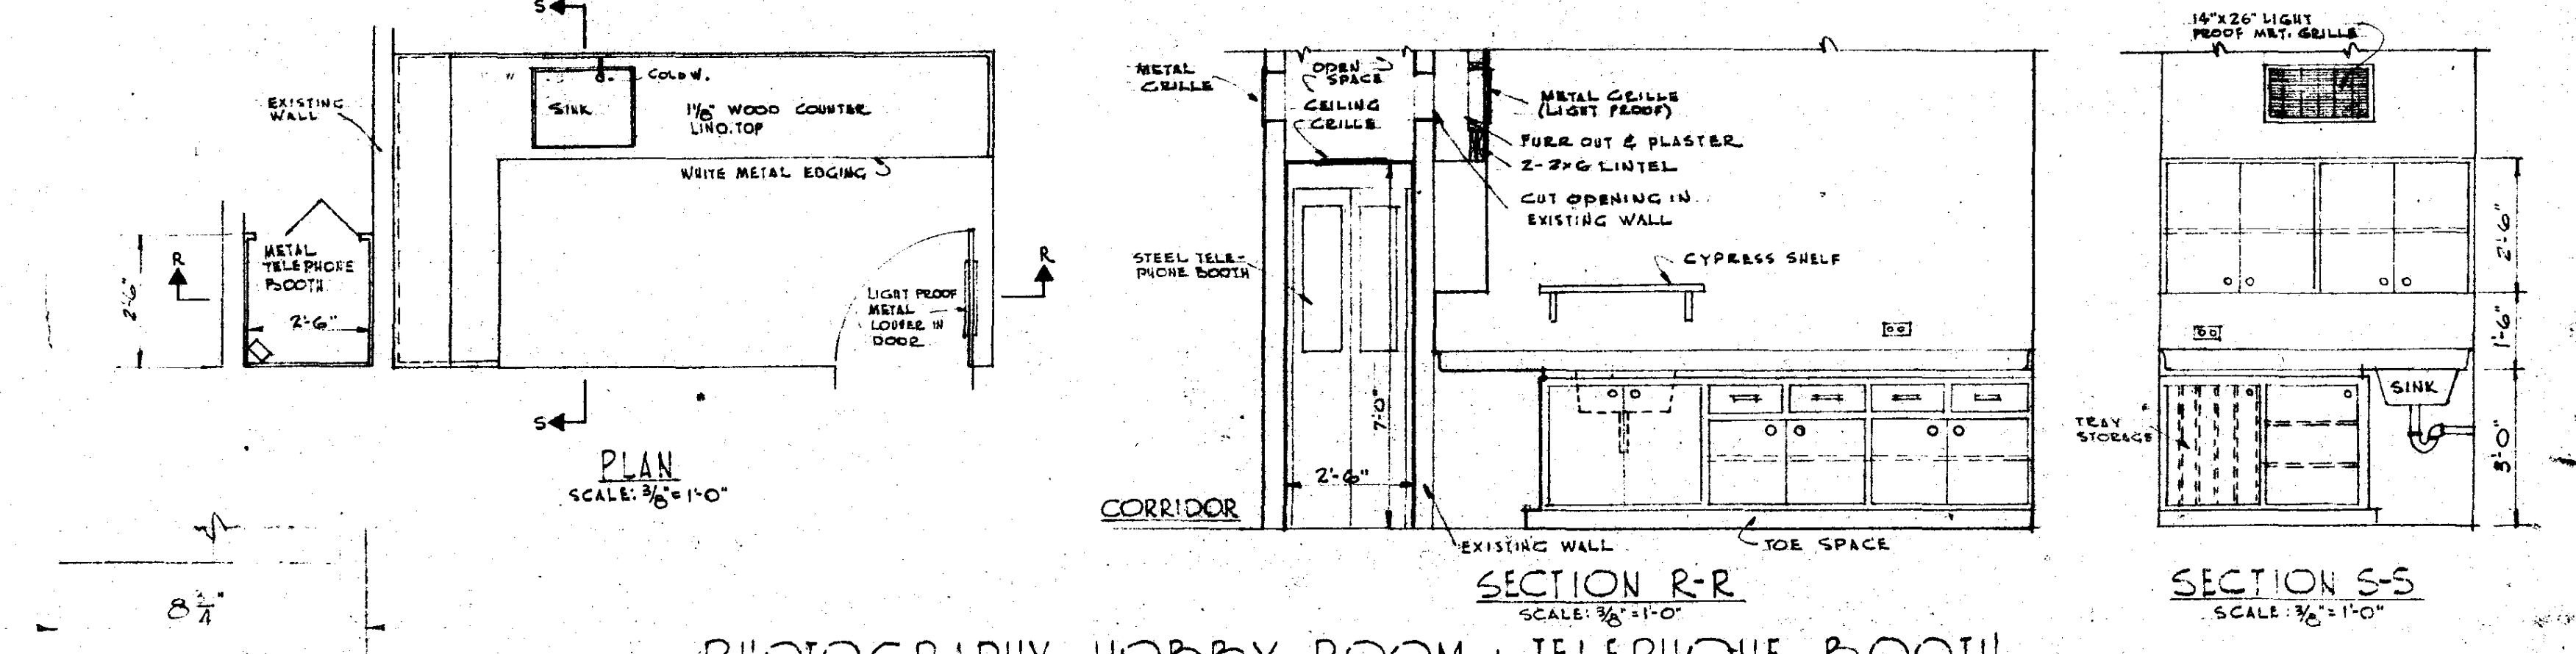

PLAN OF ADMINISTRATION WING
SCALE: 1/8" = 1'-0"



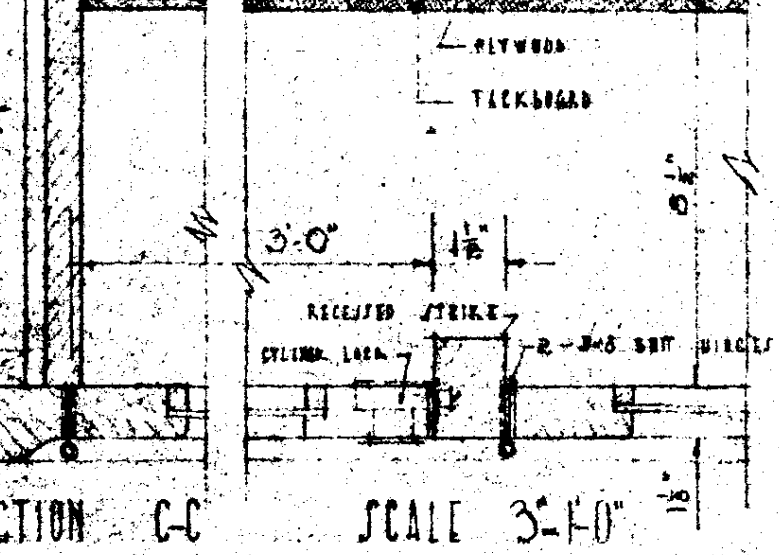


SECTION C-C
SCALE: 3" = 1'-0"

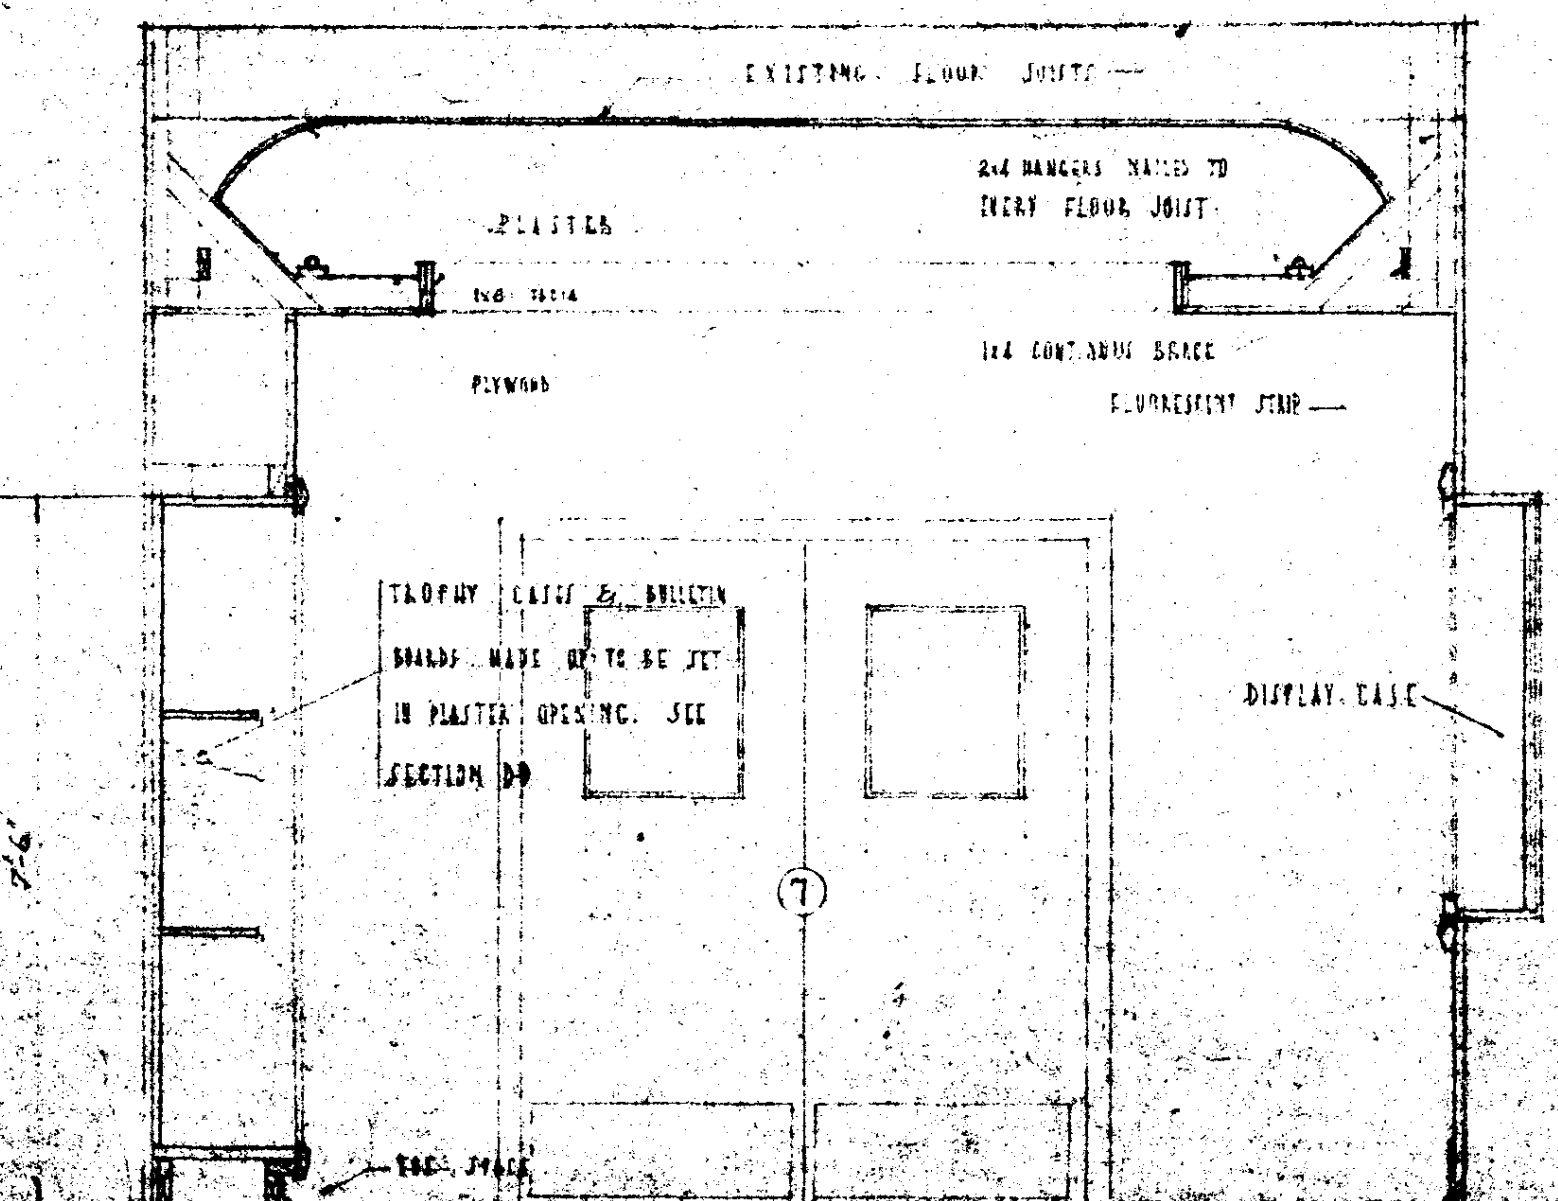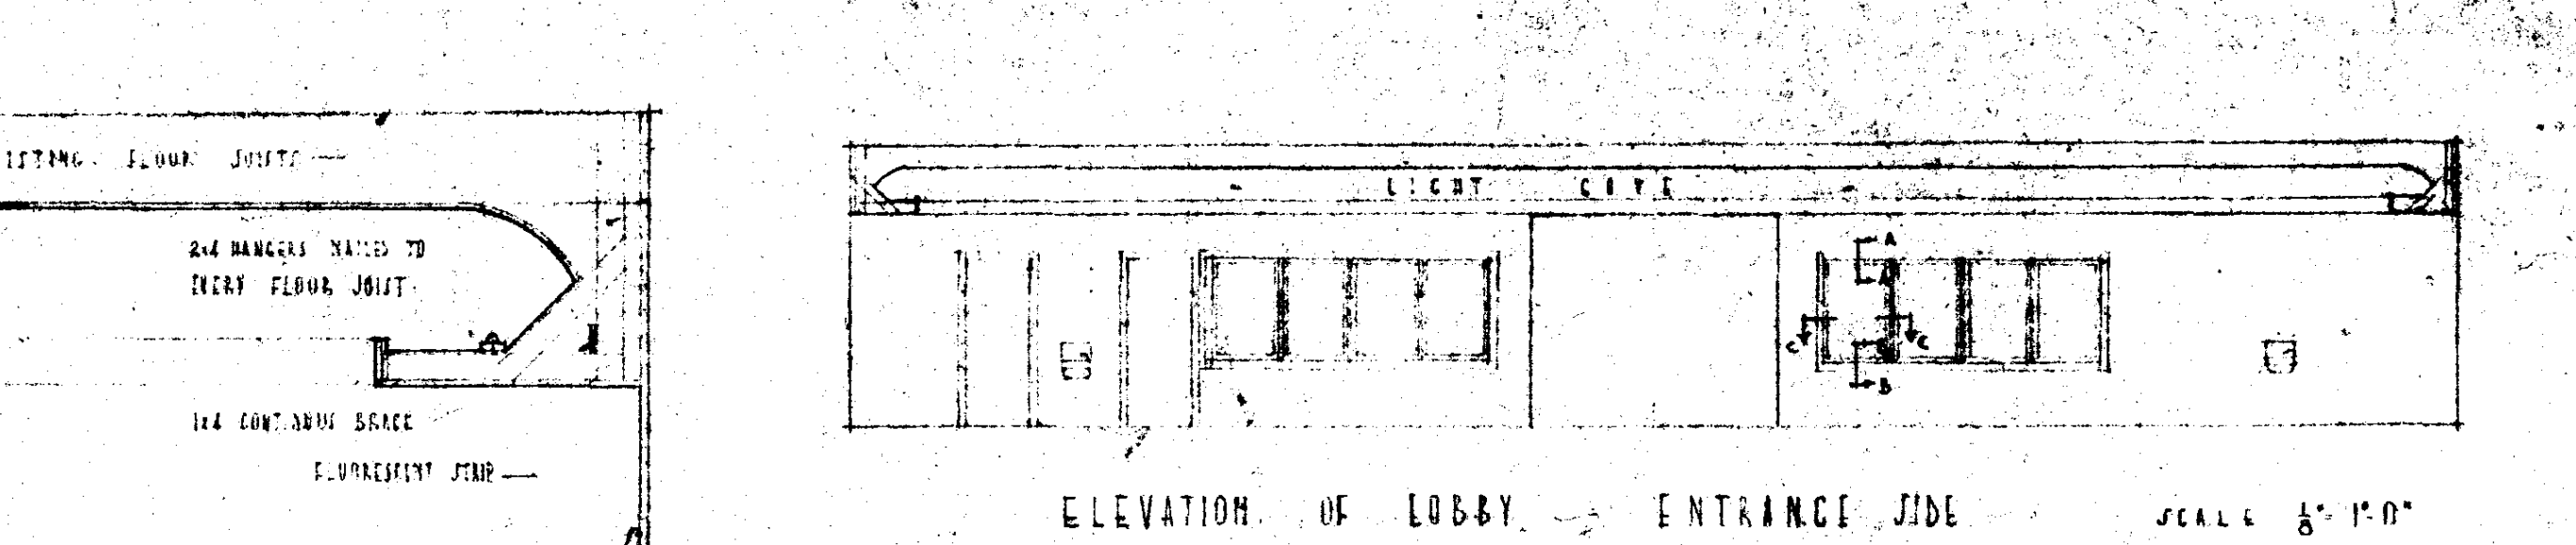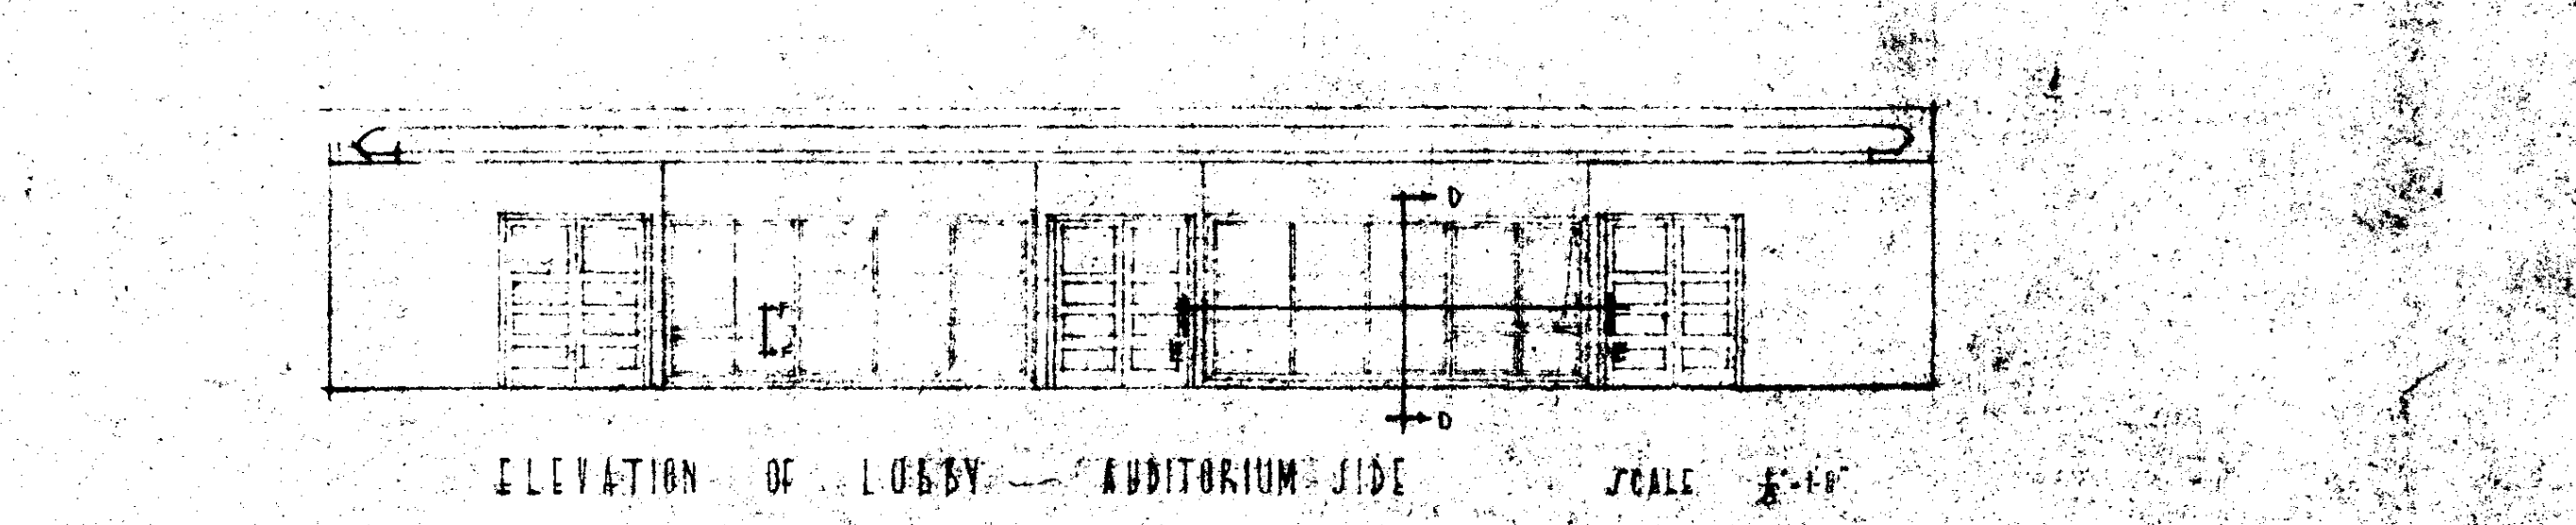










SECTION I-I
SCALE: 3" = 1'-0"

Mallett & Associates
Engineers & Architects
JOHN M. MATTINGLY, A.I.A. Architect
ILLUSTRATIONS BY J. P. HILL, C.E.S.
HOCK, WICK, HILL, HILL, HILL
ADMINISTRATION WING & MISC. DETAILS
SHEET NO. 7

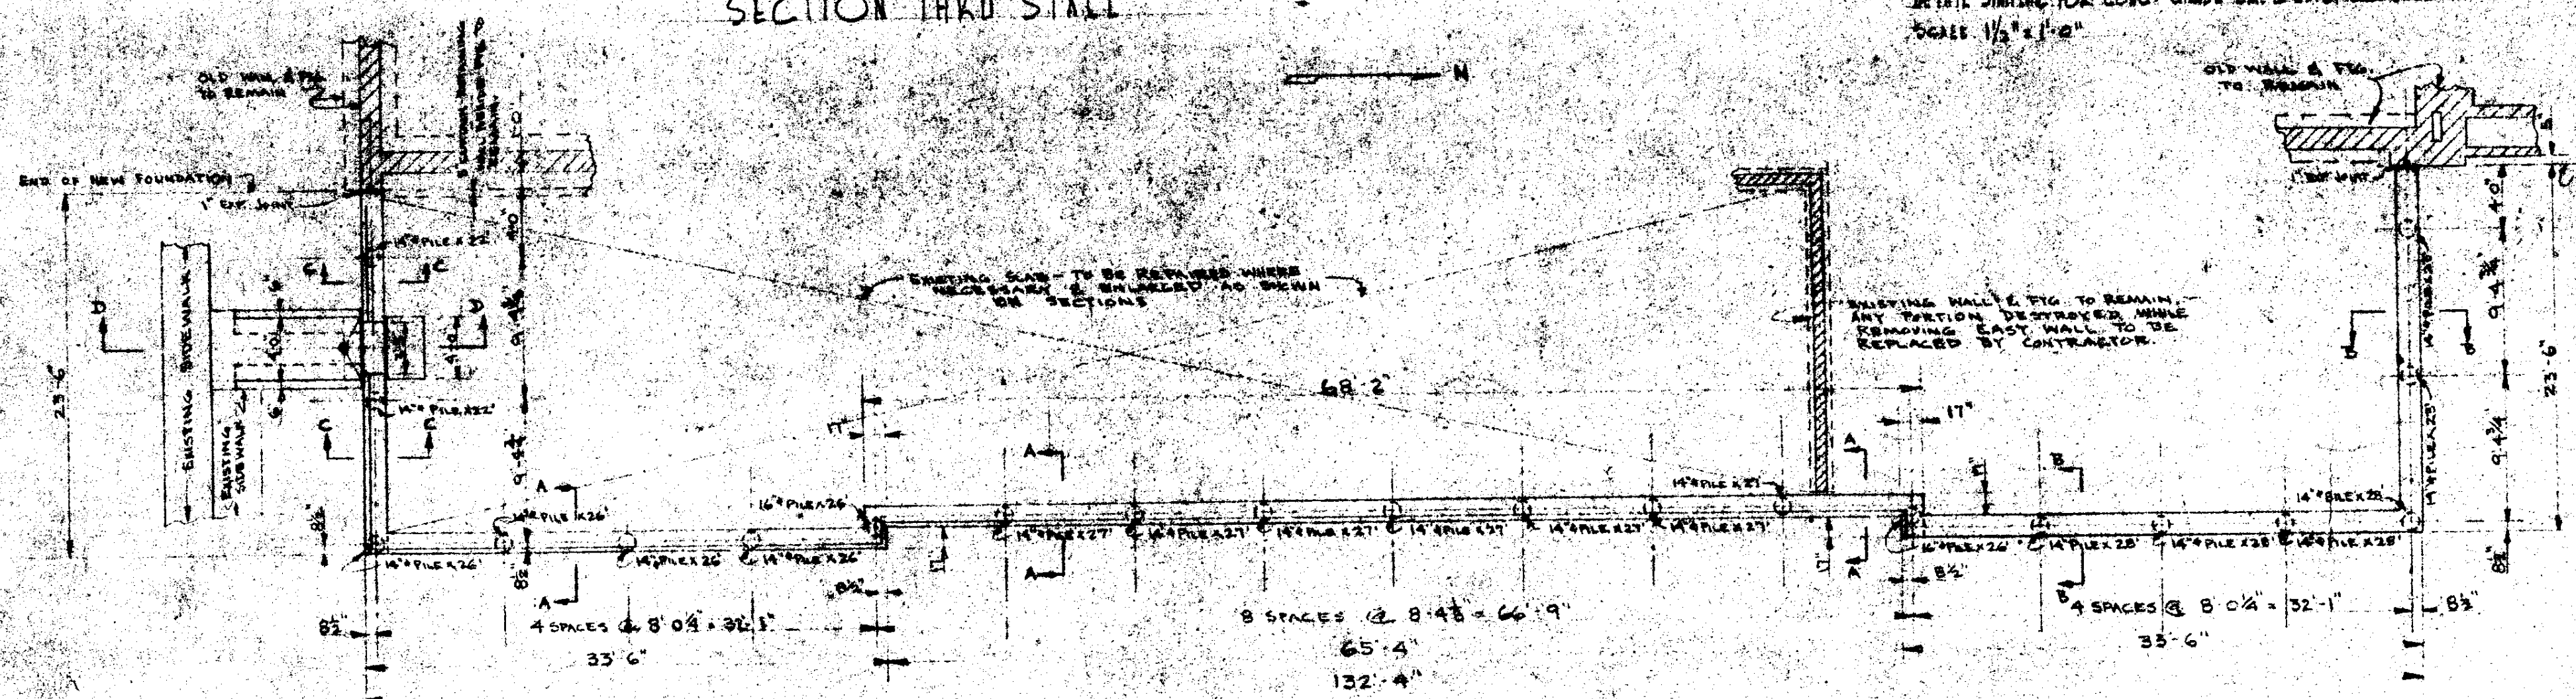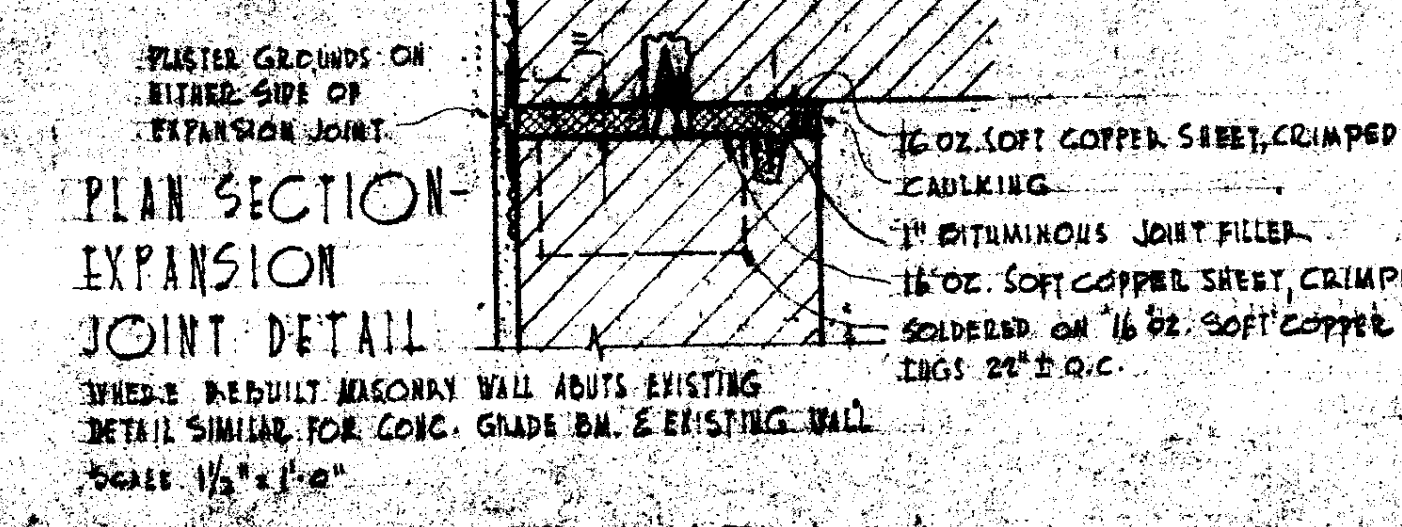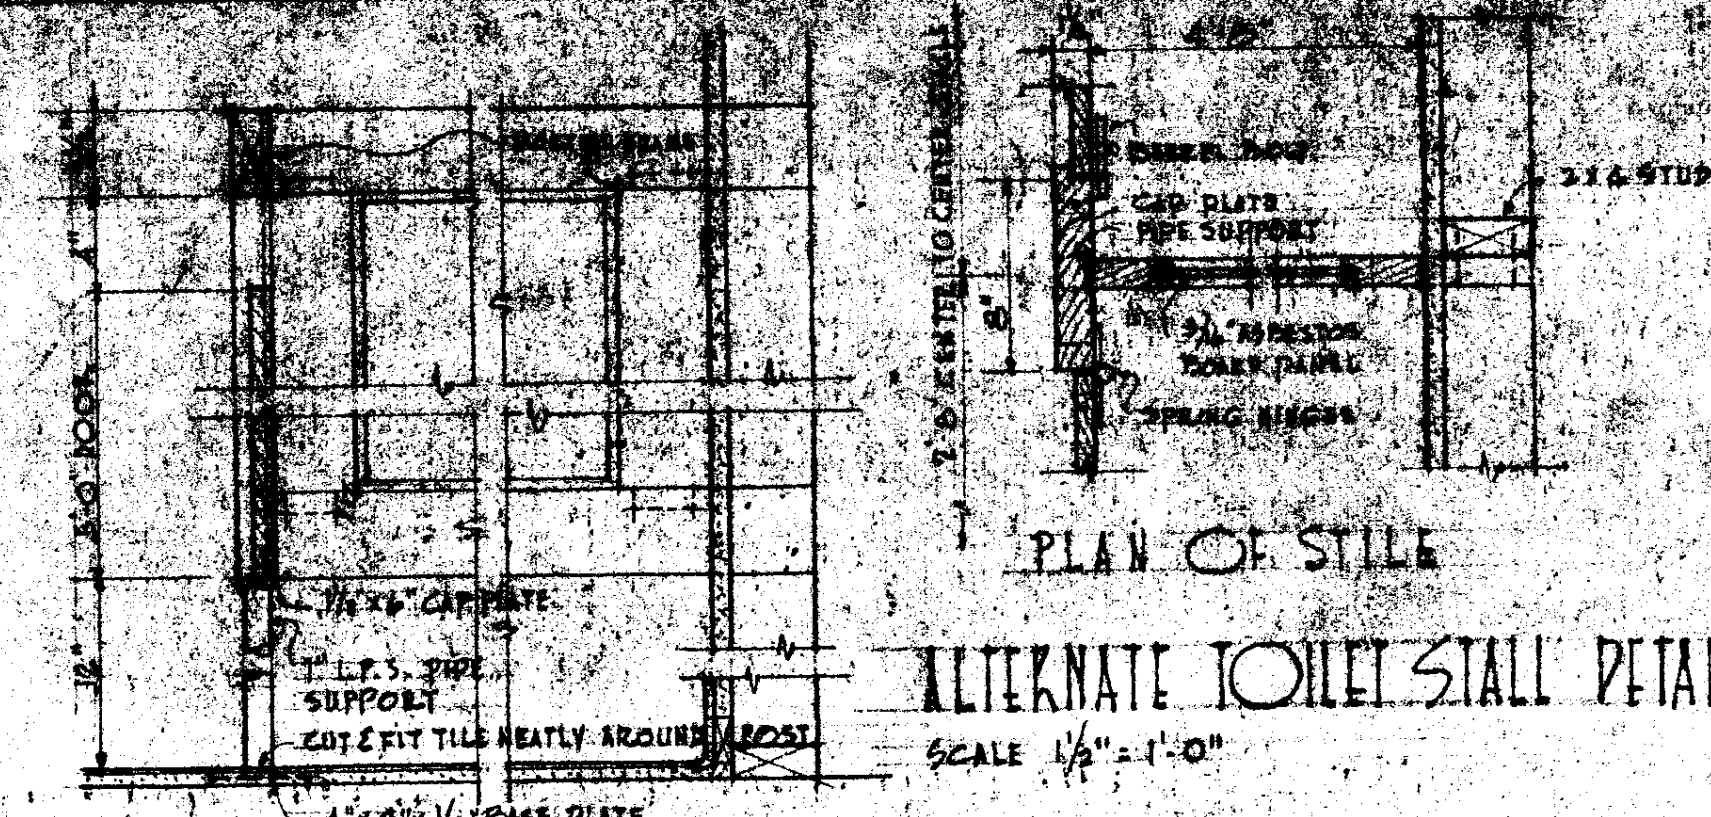

PLAN OF NEW FOUNDATION FOR EAST WALL OF EAST WING
SCALE 1/4" = 1'-0"

- NOTES:
1. PILES ARE TO BE POURED IN PLACE CONC. PILES.
 2. PILE SIZES & LENGTHS, AND SPACING ON PLAN.
 3. ALL PILES TO BE REINFORCED WITH 1" DIA. TOP OF PILE. EXTEND THIS REINFORCING ABOVE PILE TOP TO WITHIN 4" TOP OF 2" DIA. END IN STANDARD HOOK.
 4. ELEV. TOP OF PILE - ELEV. BOT. OF DEEPEST 6" DIA. ADJACENT TO IT. DEPTH OF PILE MEASURED FROM ELEV. TOP OF PILE.
 5. ALL CONC. TO BE 3000 PSI COMPRESSIVE STRENGTH @ 28 DAYS IN ACCORDANCE WITH LATEST A.C.I. SPECIFICATIONS.
 6. REINFORCING STEEL SHALL BE HAND GRADE (BIL. OR BILLET STEEL) DEFORMED BARS IN ACCORDANCE WITH LATEST A.S.T.M. SPECIFICATIONS.
 7. LAP LONGITUDINAL REINFORCING BARS AT ALL SPLICES & CORNERS.
 8. CONC. PROTECTION SHALL BE 3" COVERAGE FOR LONG REINFORCING IN GRADE BEAMS.

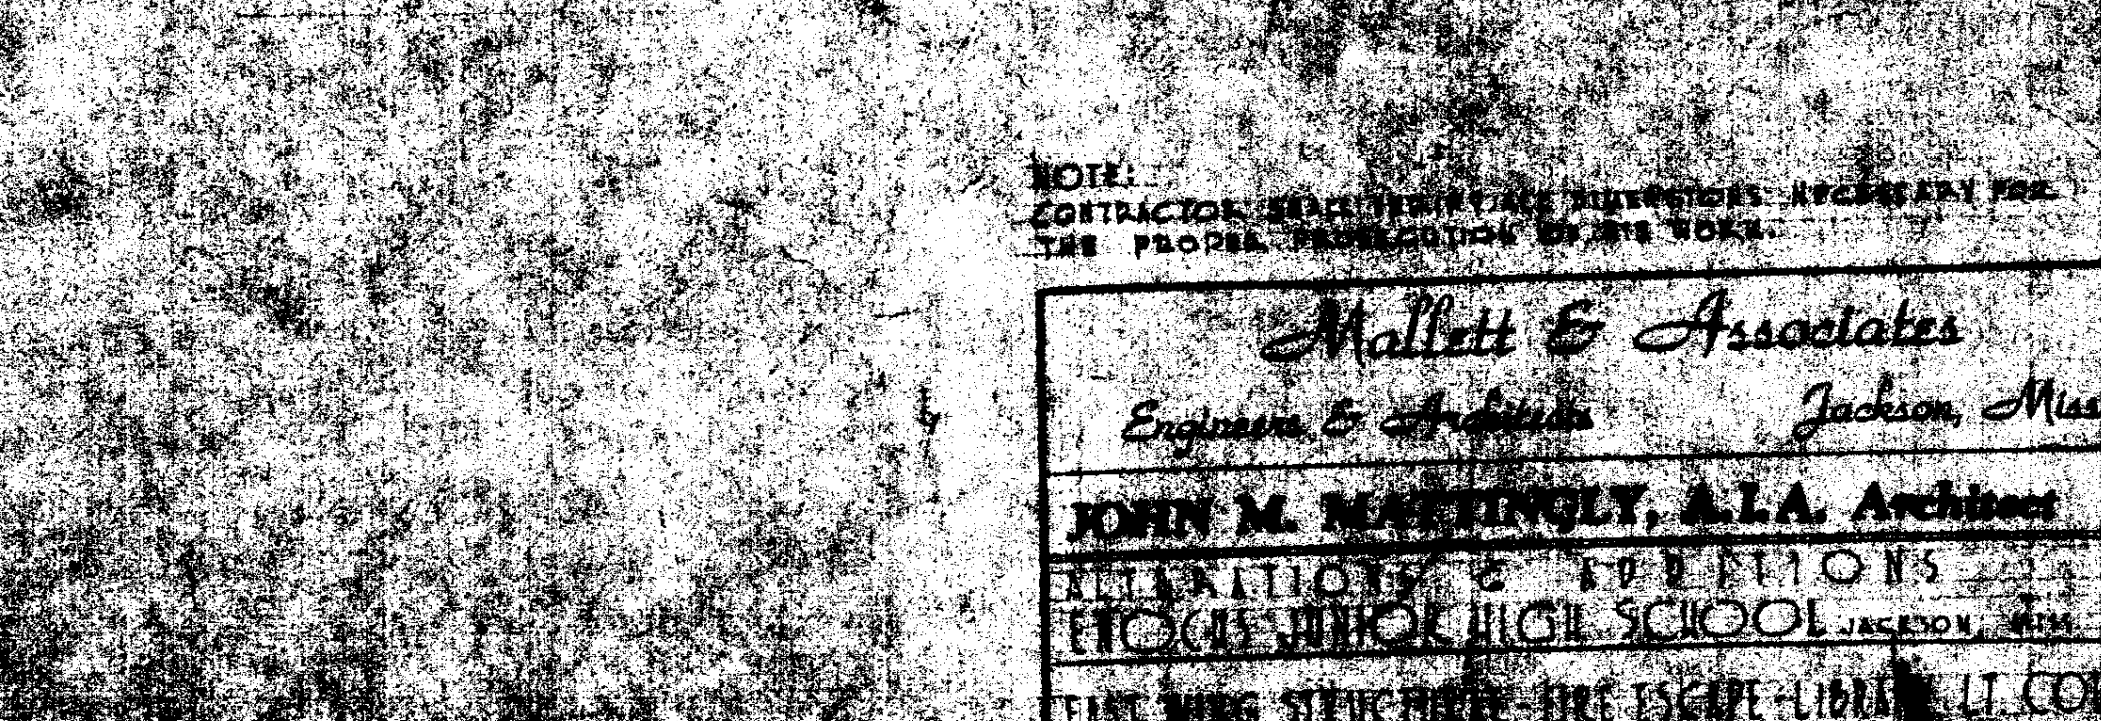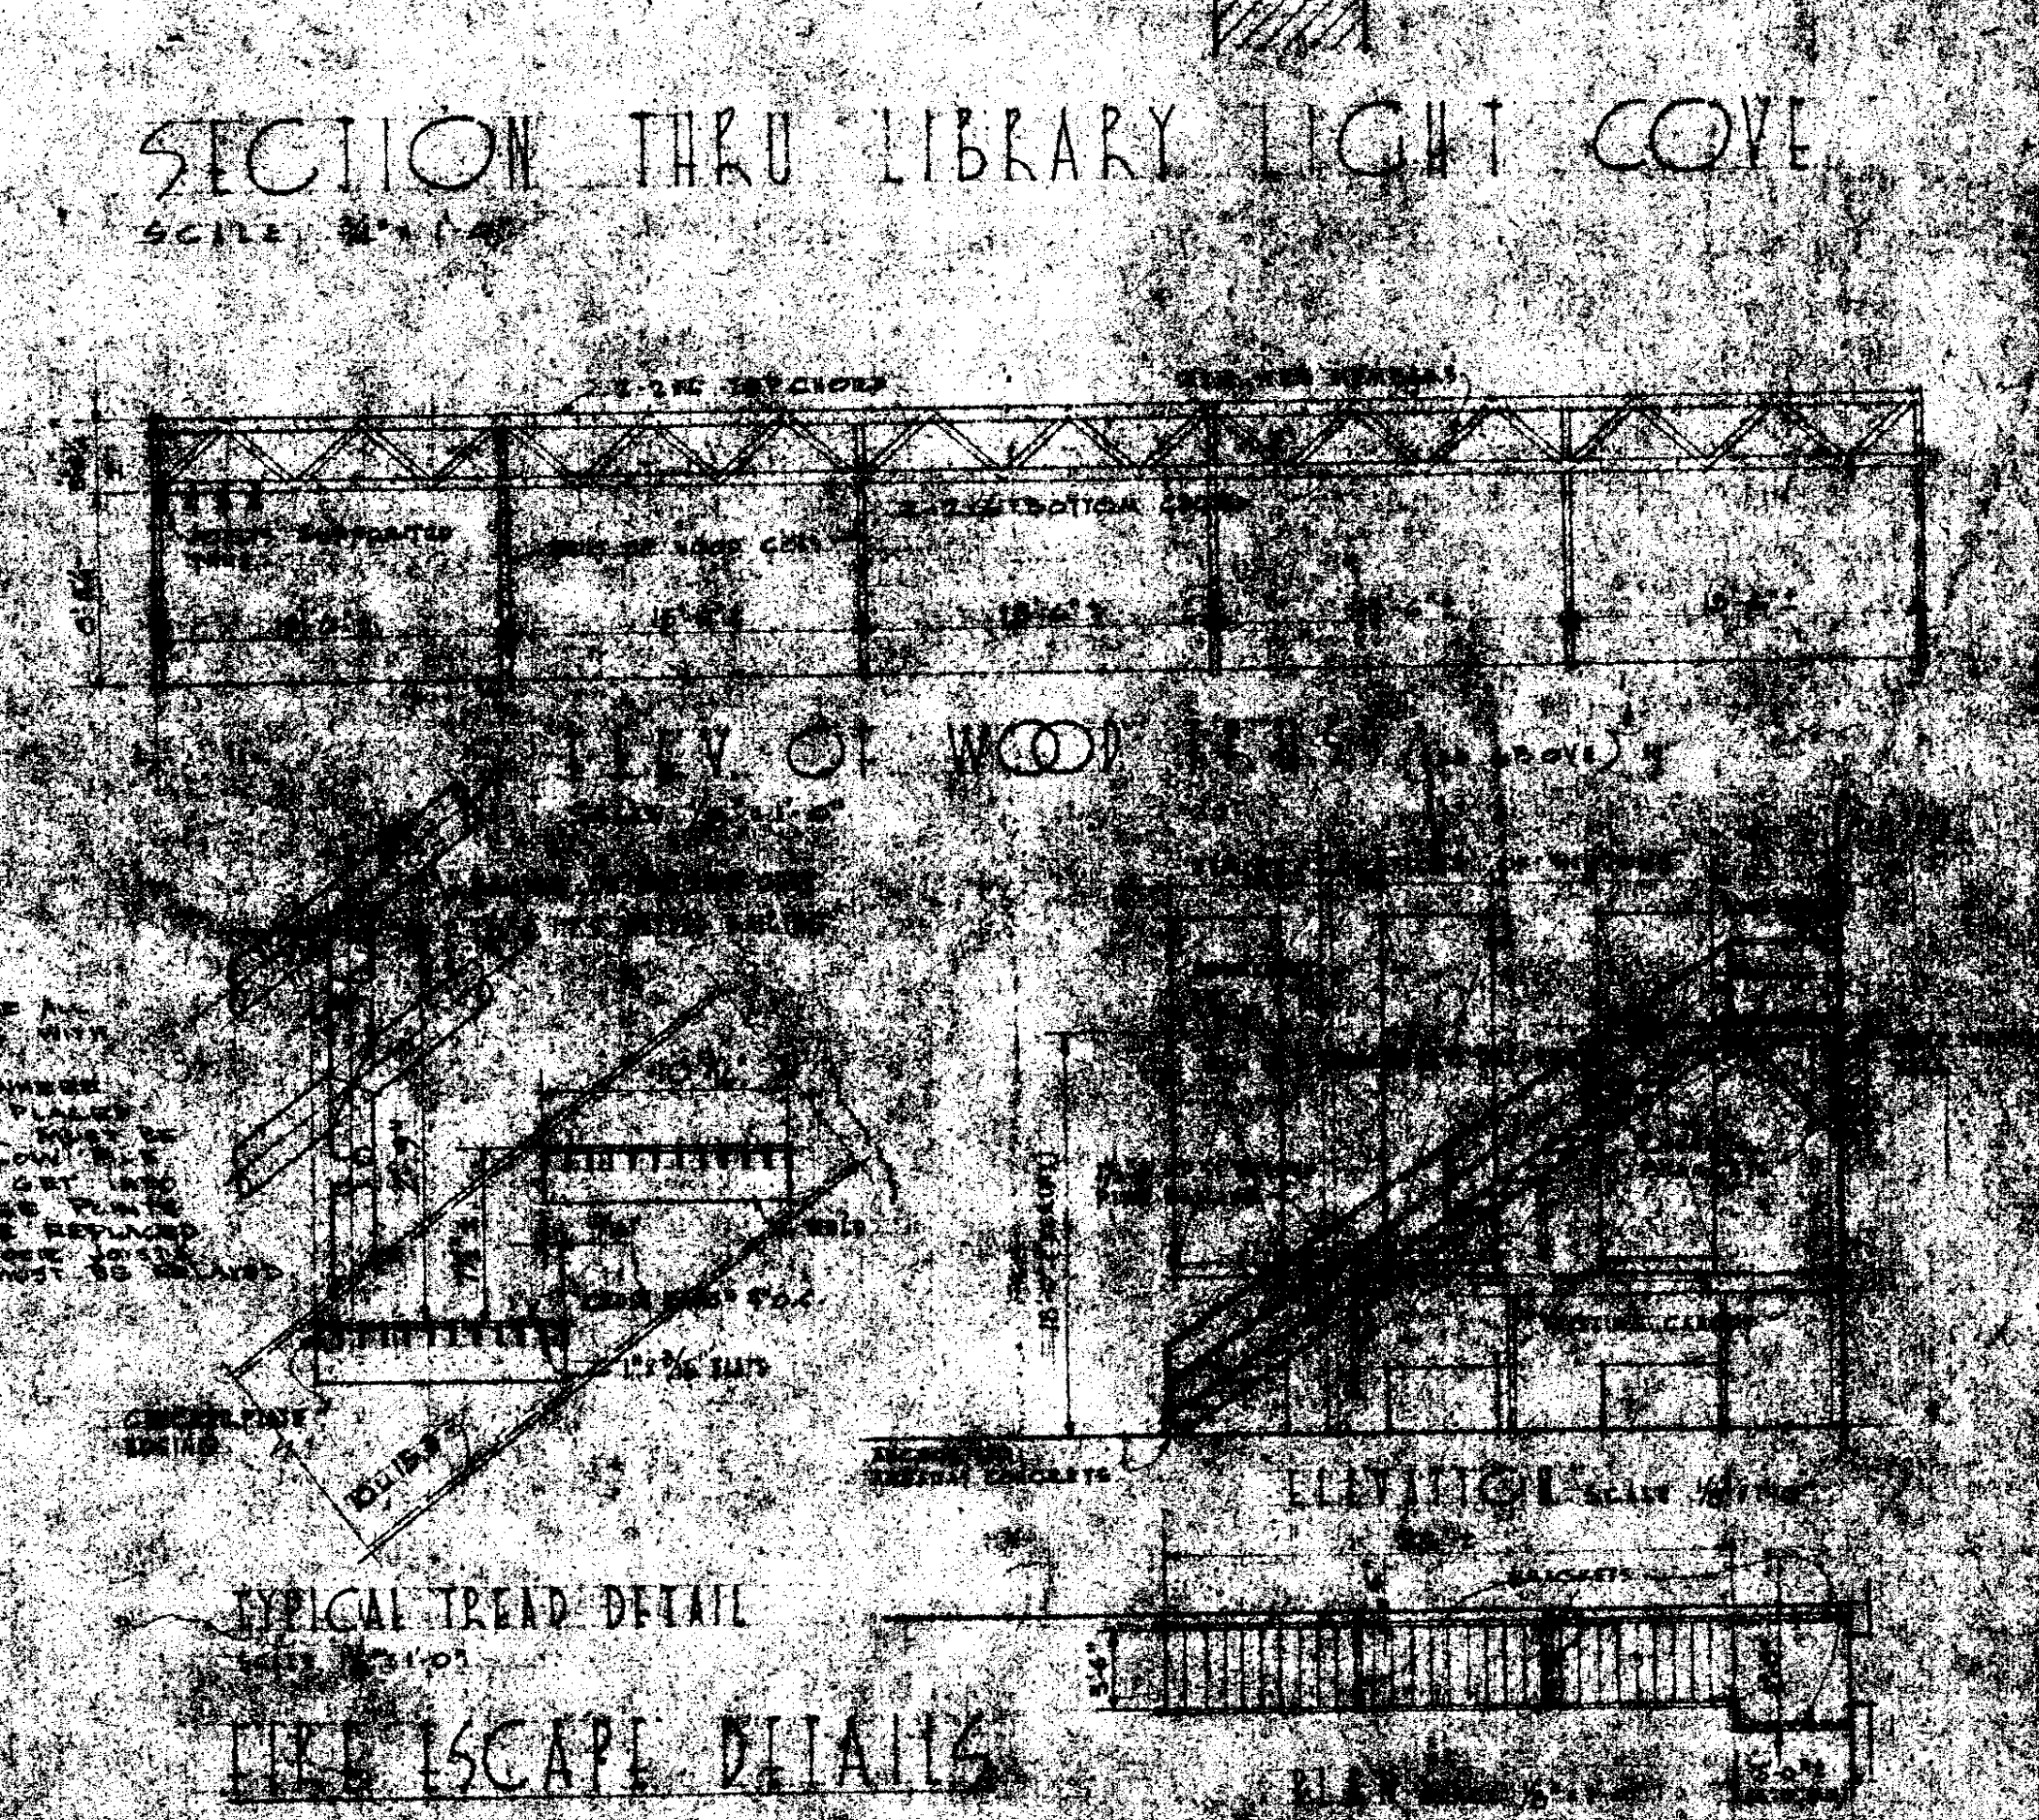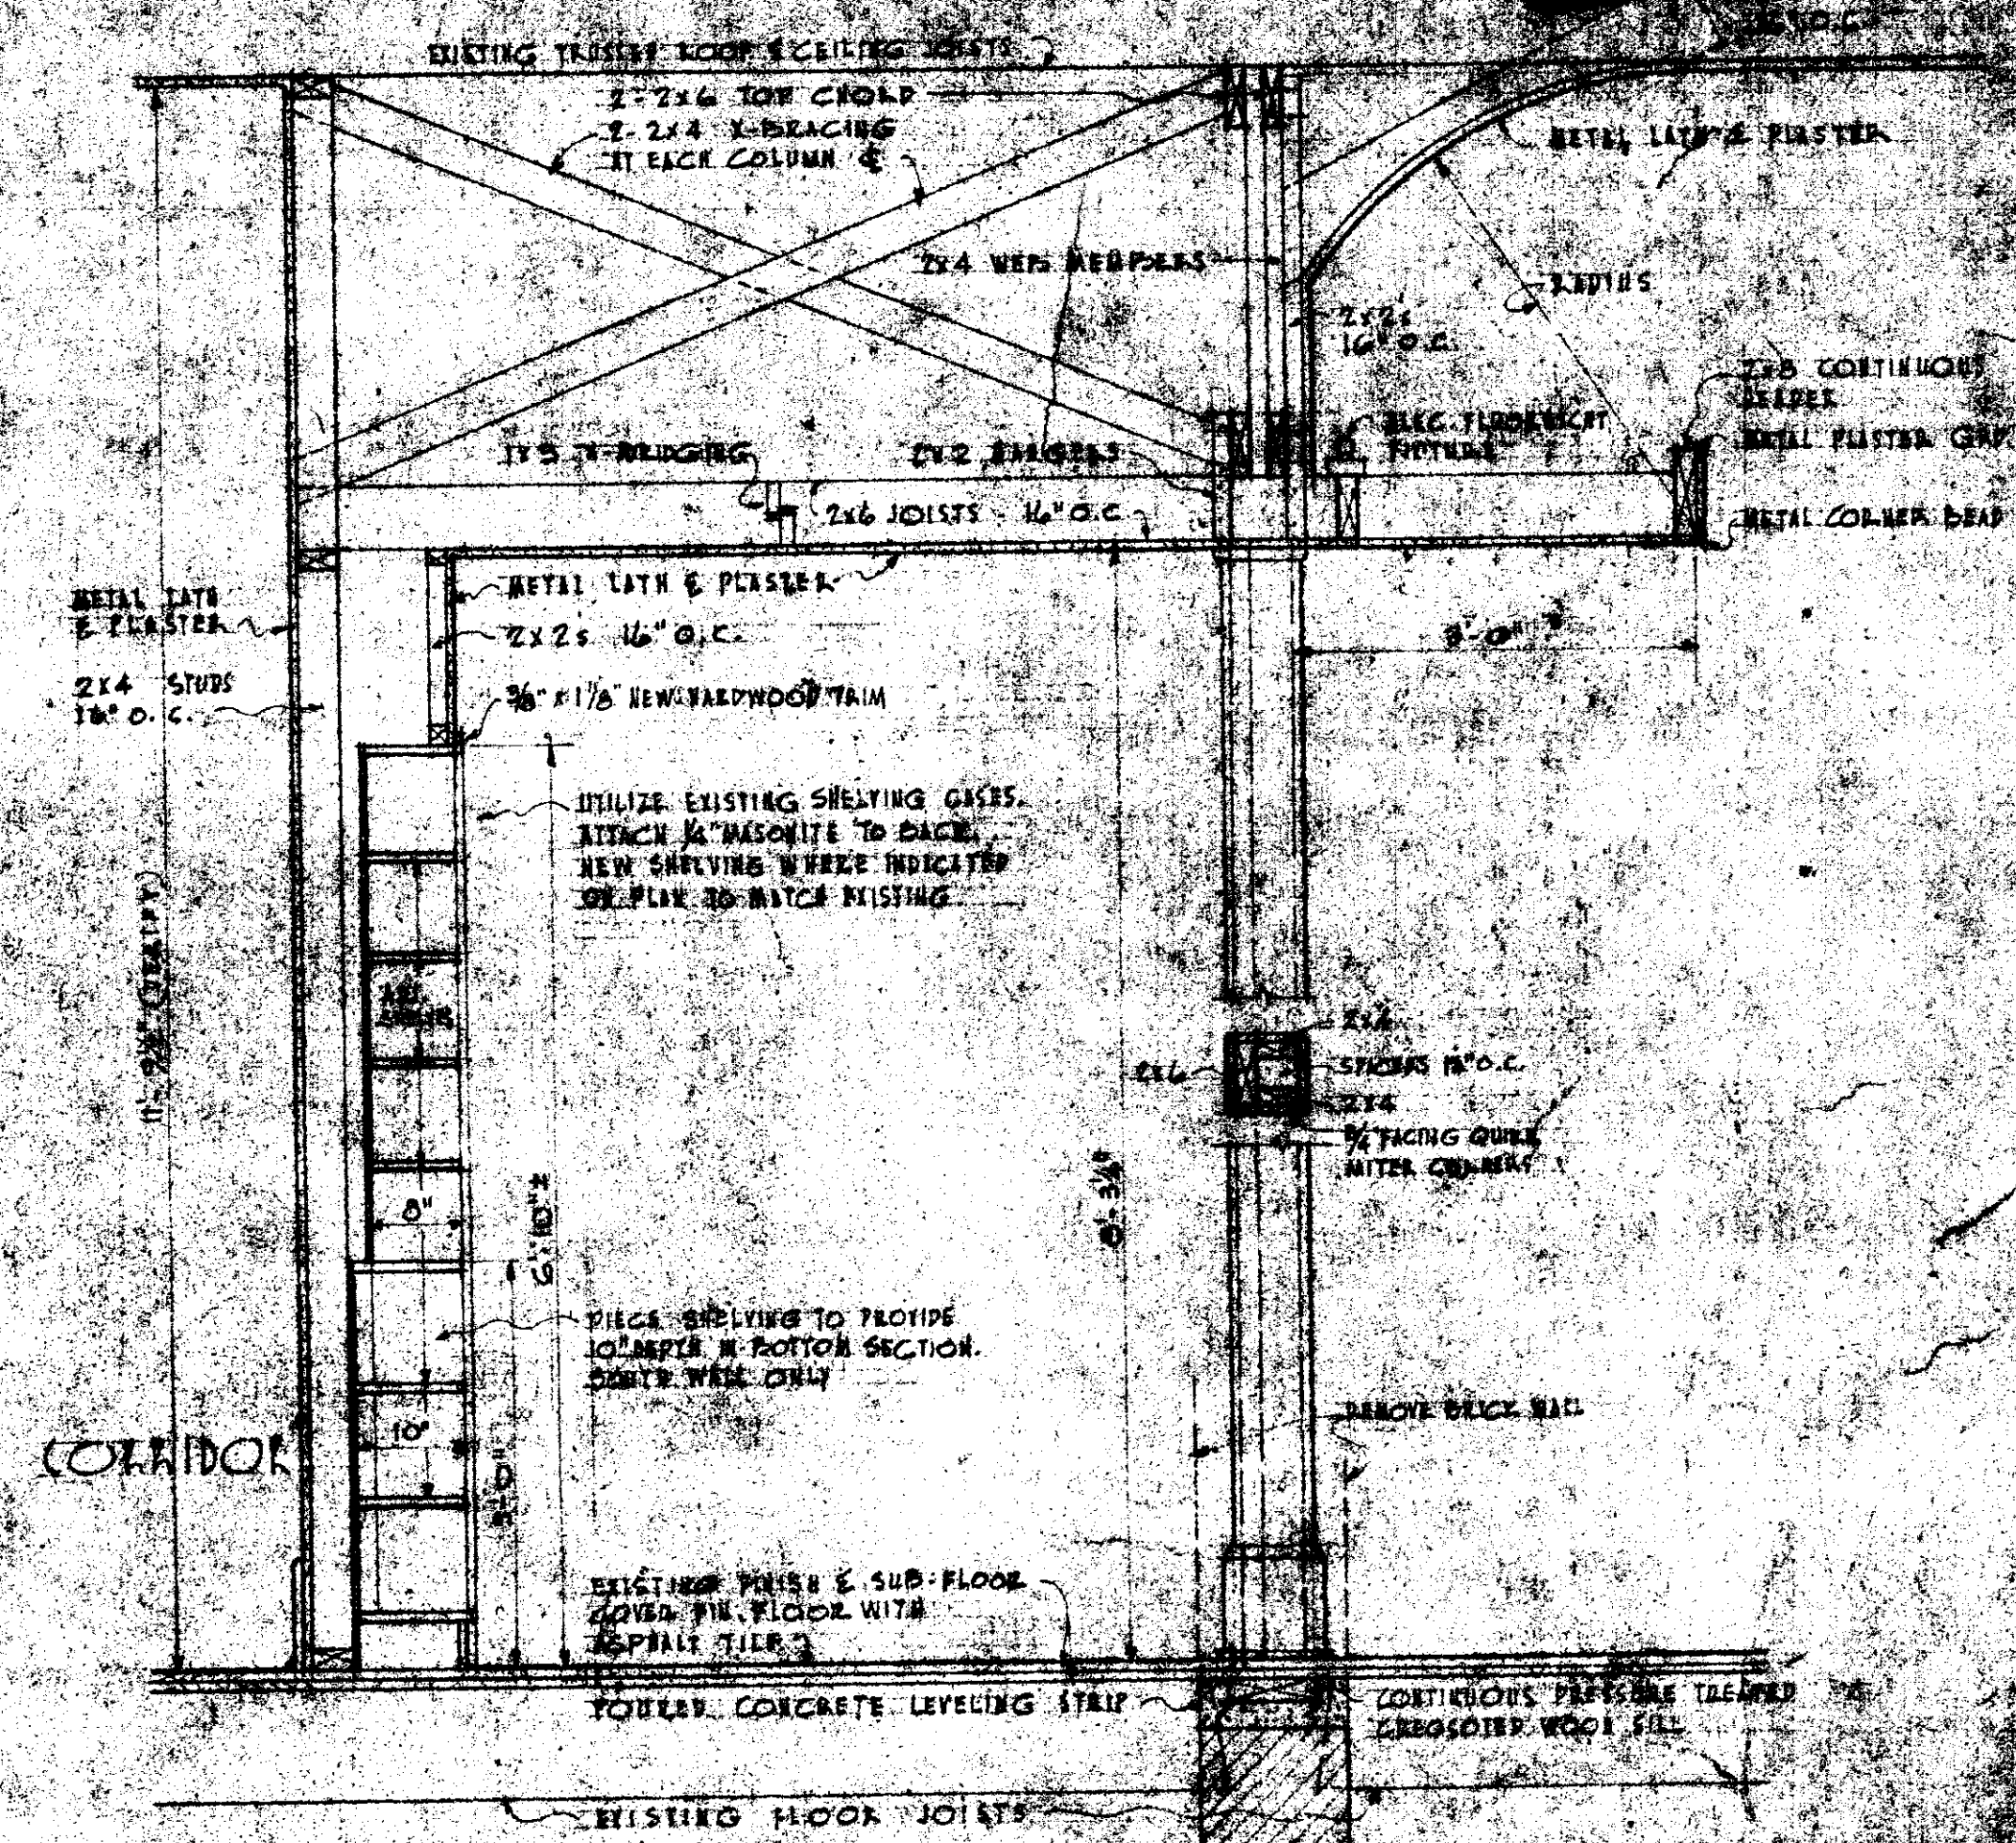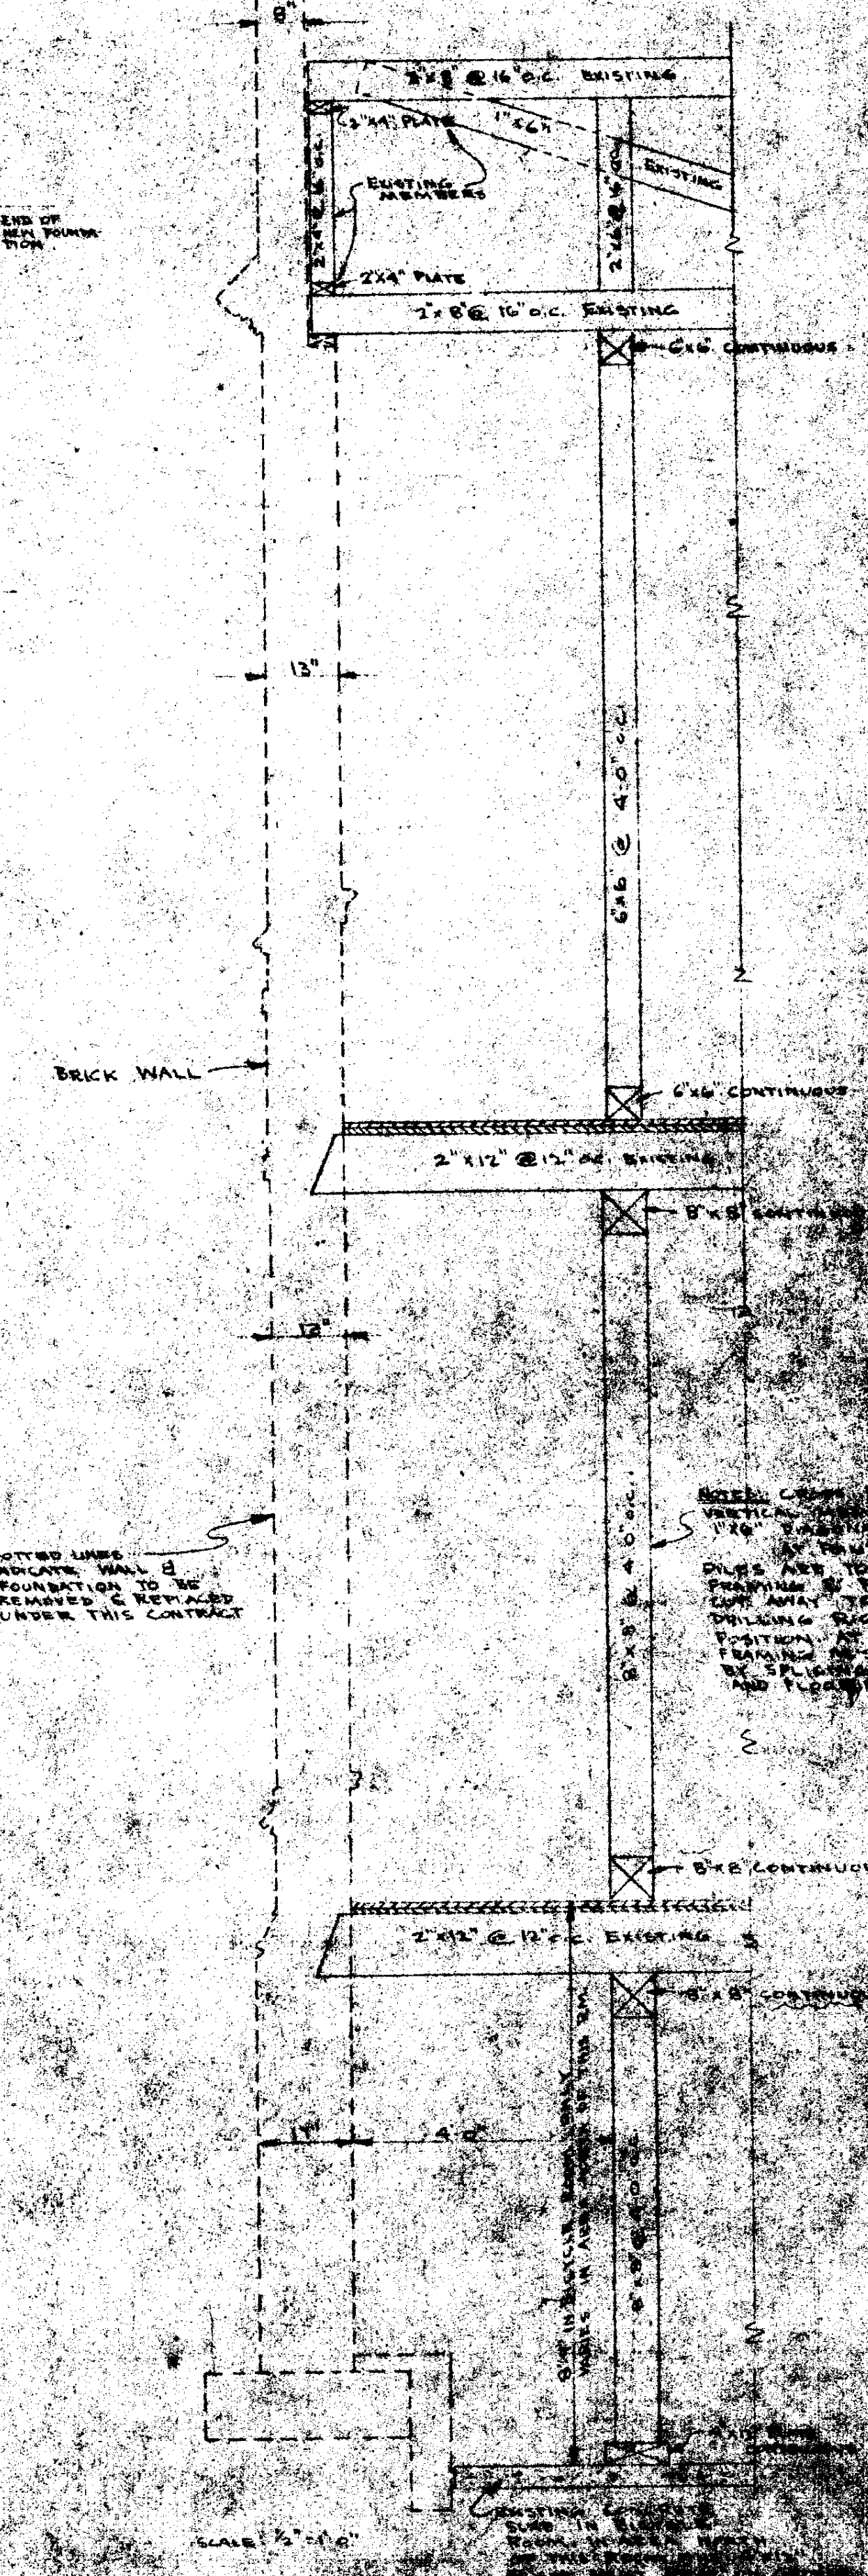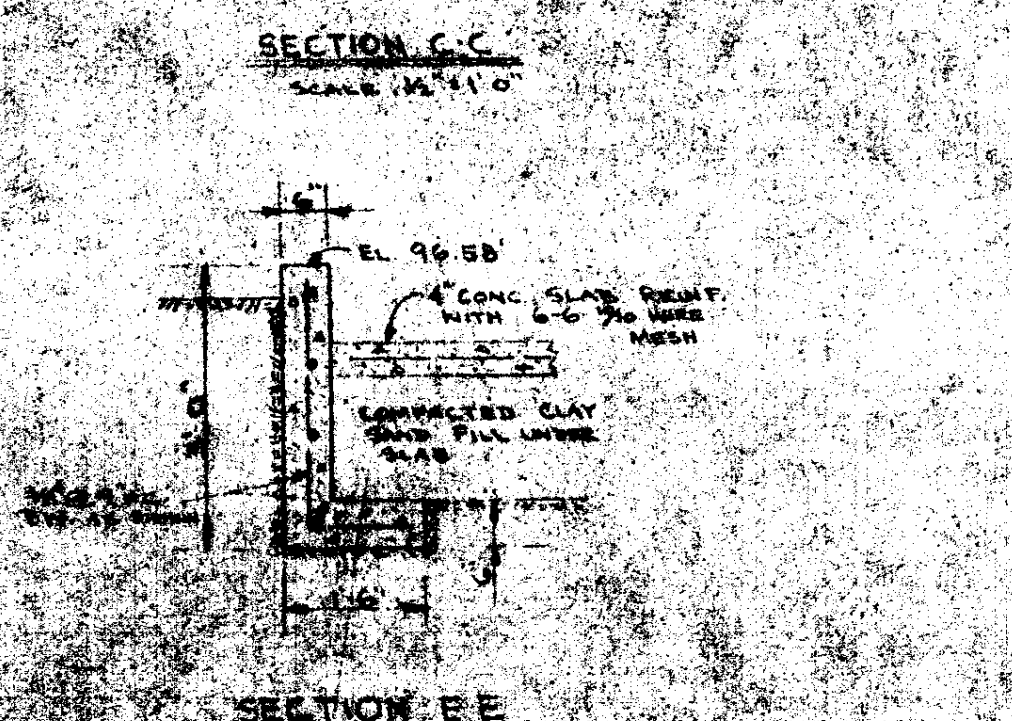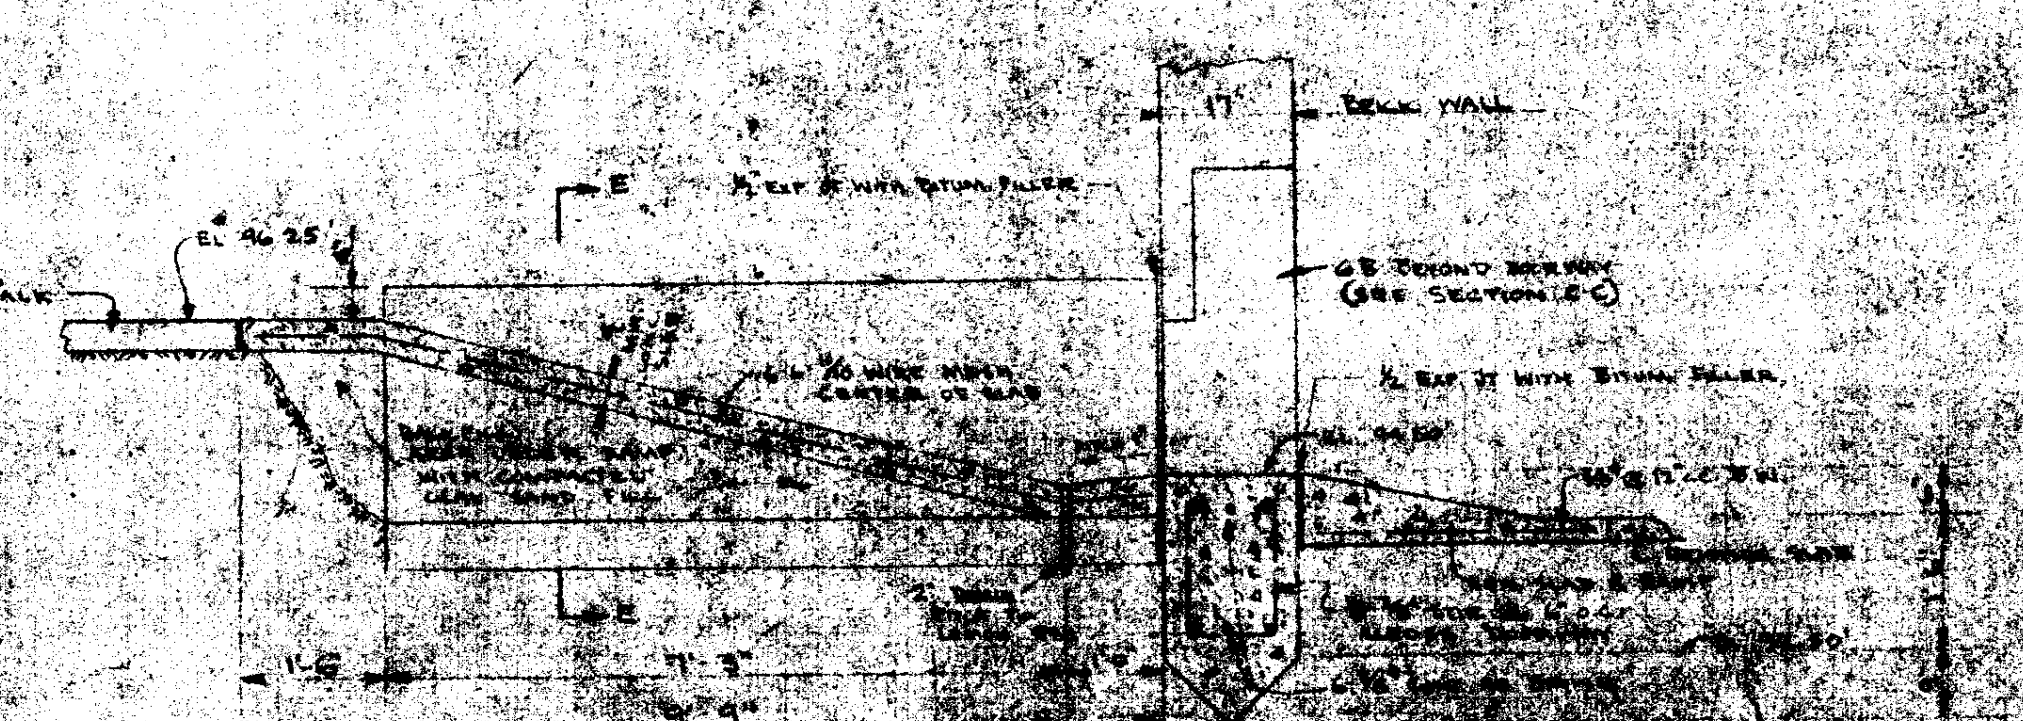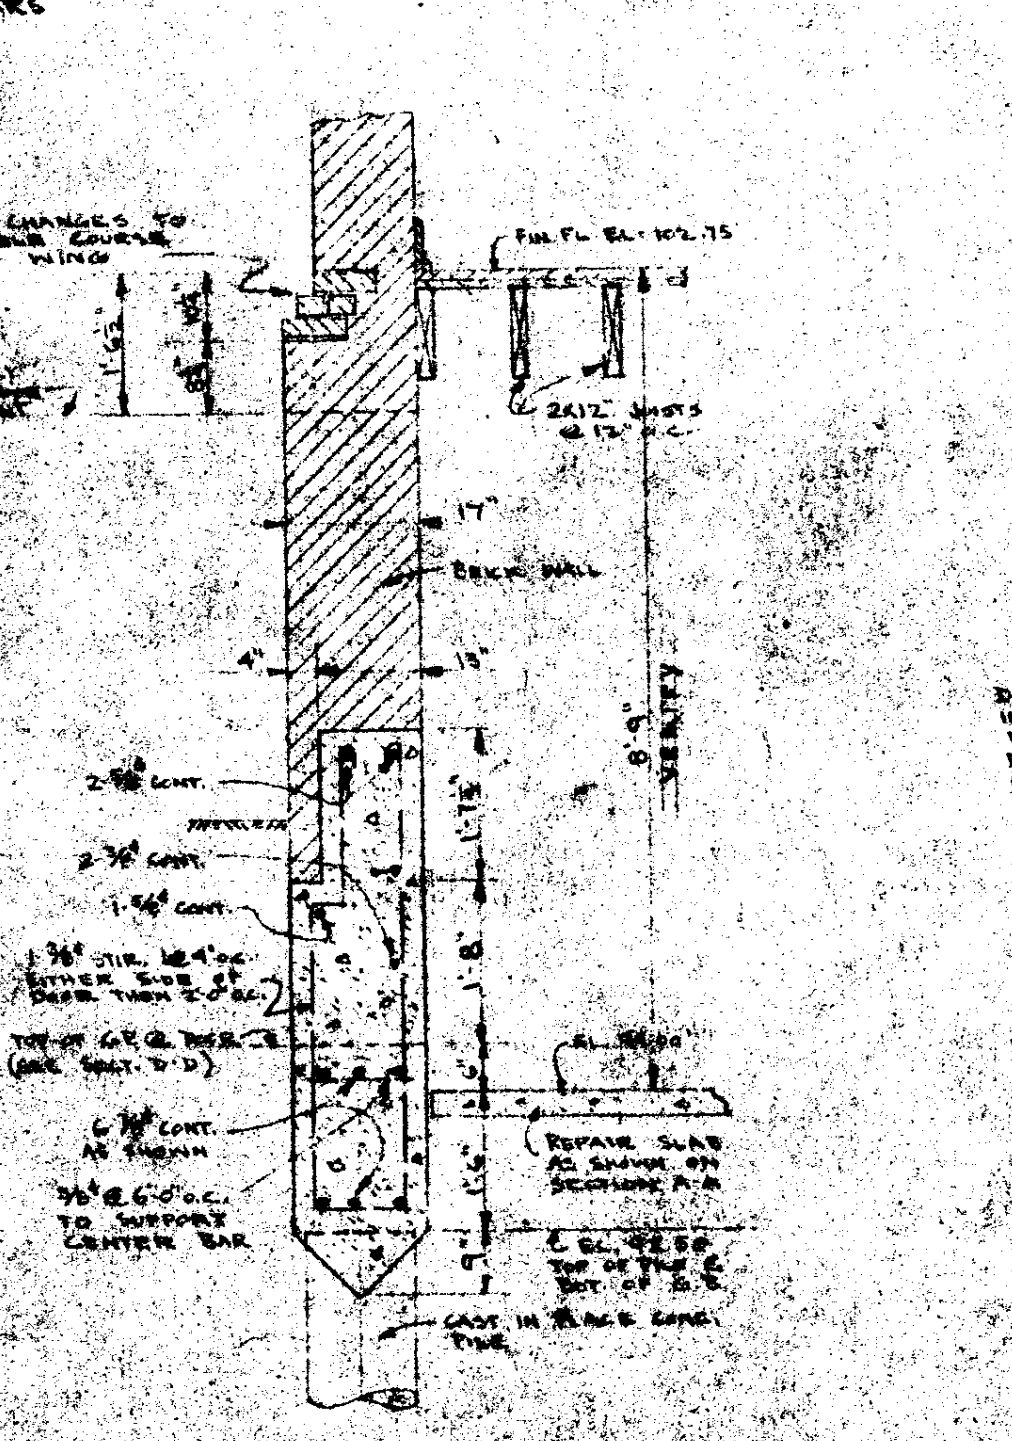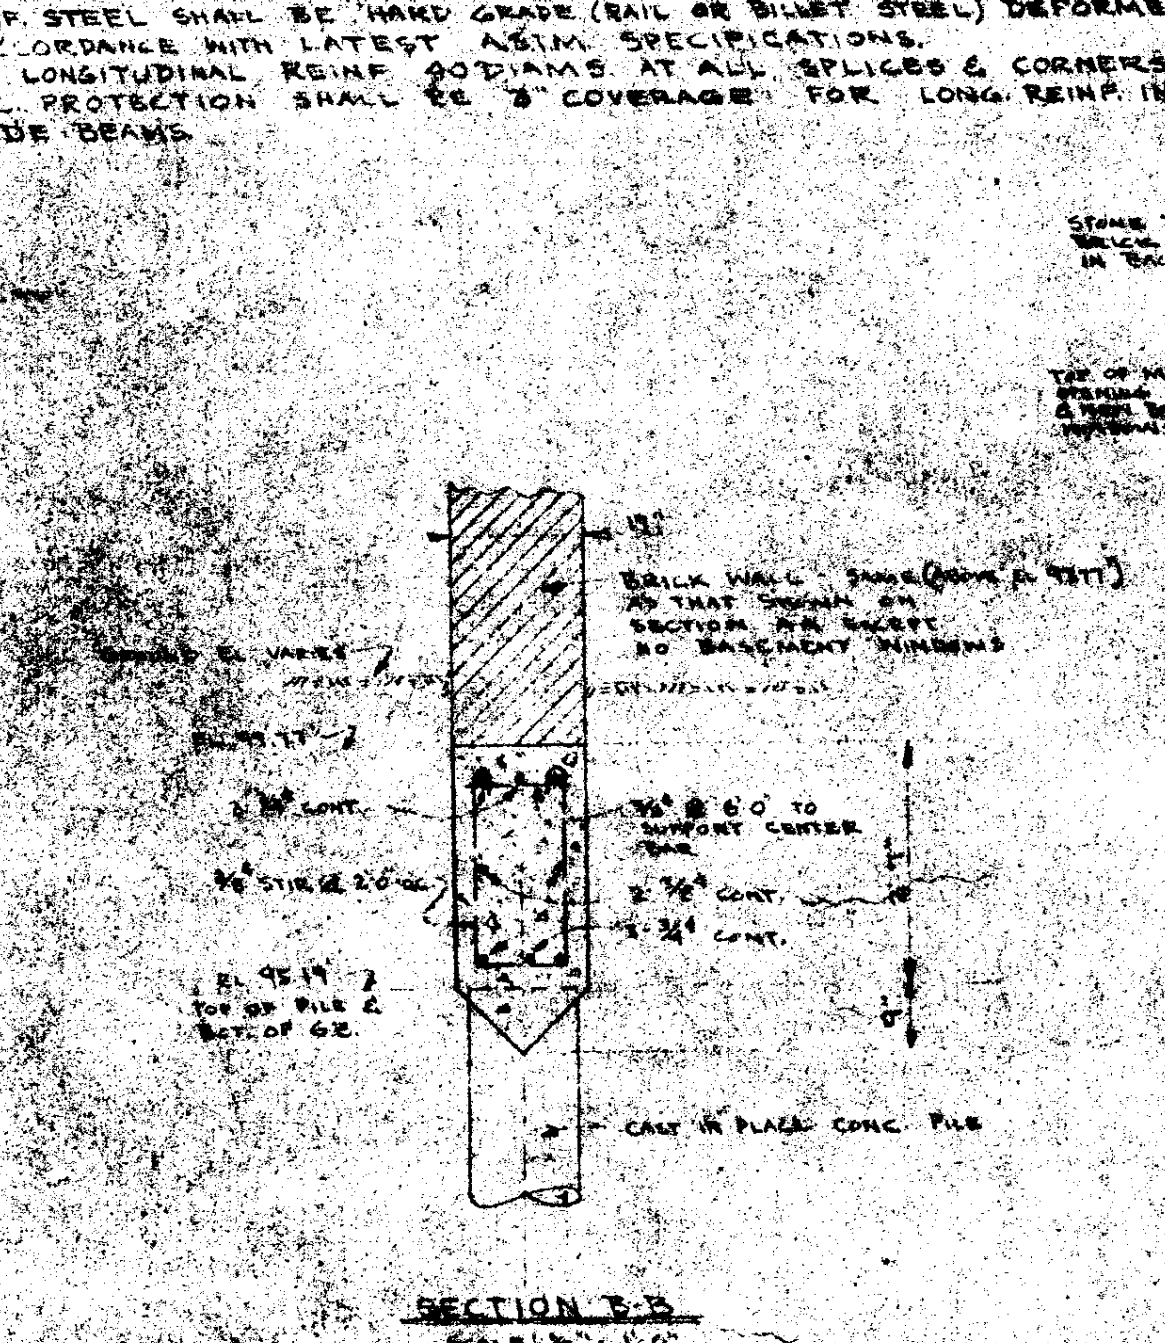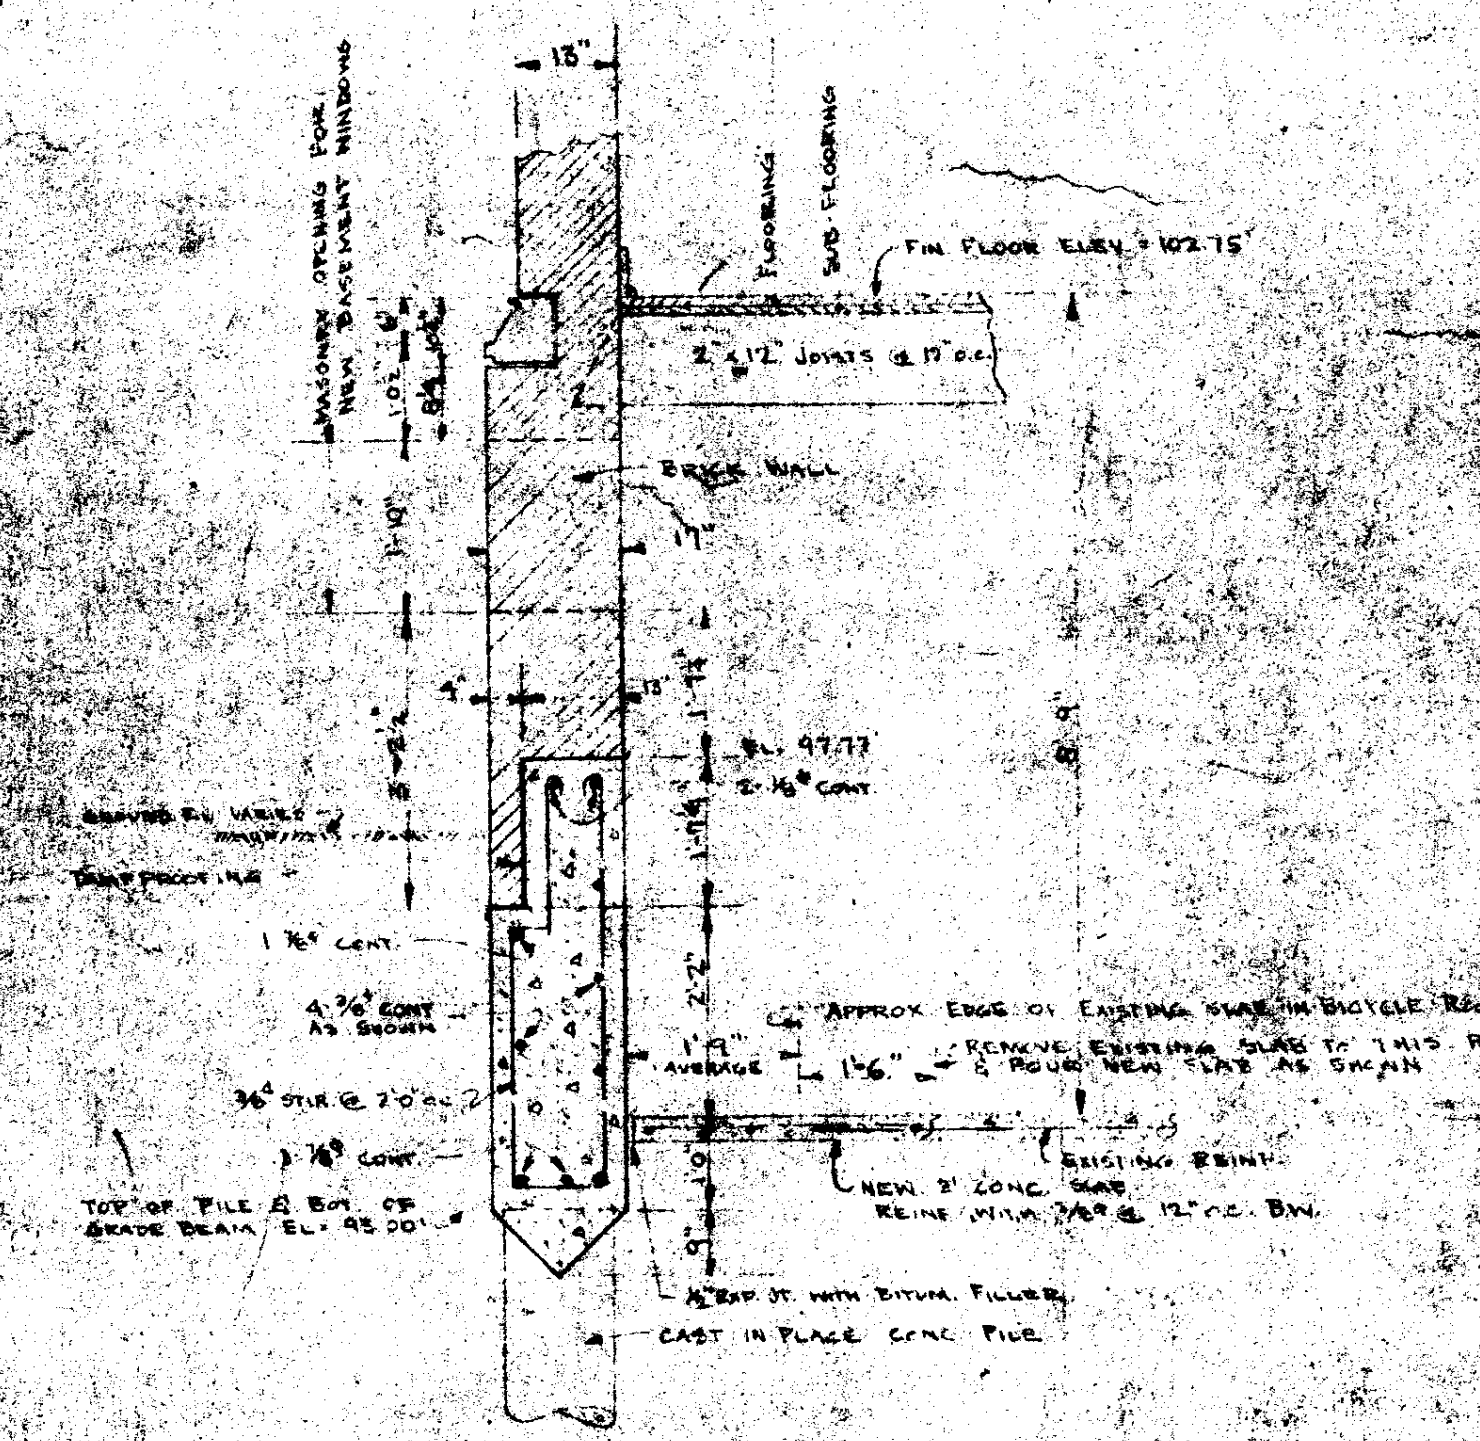

NOT: CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS FOR THE PROPER INSTALLATION OF THE WORK.

Mallett & Associates
Engineers & Architects
John M. Mallett, A.L.A. Architect
JACKSON, MISSISSIPPI
1100 NORTH HIGH SCHOOL
JACKSON, MISSISSIPPI
SHEET NO. 1